



Asbestos Reassessment

St. Charles Mountain
150 East 5th Street, Hamilton,
Ontario

Prepared for:

**Hamilton-Wentworth Catholic
District School Board**

90 Mulberry Street
Hamilton, Ontario, L8N 3R9

August 30, 2022

Pinchin File: 303992.004



Asbestos Reassessment

St. Charles Mountain, 150 East 5th Street, Hamilton, Ontario
Hamilton-Wentworth Catholic District School Board

August 30, 2022
Pinchin File: 303992.004

Issued to: Hamilton-Wentworth Catholic District
School Board

Issued on: August 30, 2022

Pinchin File: 303992.004

Issuing Office: Hamilton, ON

Pinchin Contact: Emily Balfour, Project Manager
365.889.5147
ebalfour@pinchin.com



Author: Luke Thompson, ADip.T.(Arch)
Project Technologist
289.922.8960
lthompson@pinchin.com

Reviewer: Damian Palus, C.E.T
Operations Manager
289.678.0694
dpalus@pinchin.com



EXECUTIVE SUMMARY

Hamilton-Wentworth Catholic District School Board (Client) retained Pinchin Ltd. (Pinchin) to conduct an asbestos building materials reassessment at the subject building.

The objective of the reassessment was to evaluate the condition and quantity of previously reported asbestos-containing materials (ACM), and develop corrective action plans as required for the purposes of long-term management. The results of this reassessment are not intended for construction, renovation, demolition or project tendering purposes.

Summary of Recommendations

The following is a summary of significant recommendations; refer to the body of the report for detailed recommendations:

- Perform a reassessment of asbestos materials on an annual basis.
- Perform a pre-construction assessment and remove all asbestos-containing materials (ACM) prior to alteration or maintenance work if ACM may be disturbed by the work.
- Follow appropriate safe work procedures when handling or disturbing asbestos.
- Sample any presumed ACM prior to alteration or maintenance work if presumed ACM may be disturbed by the work.

This Executive Summary is subject to the same standard limitations as contained in the report and must be read in conjunction with the entire report.



Asbestos Reassessment

St. Charles Mountain, 150 East 5th Street, Hamilton, Ontario
Hamilton-Wentworth Catholic District School Board

August 30, 2022
Pinchin File: 303992.004

TABLE OF CONTENTS

1.0	INTRODUCTION AND SCOPE	1
1.1	Scope of Assessment	1
2.0	BACKGROUND INFORMATION	1
2.1	Building Year of Construction	1
2.2	Existing Reports	1
3.0	FINDINGS	2
3.1	Excluded Asbestos Materials	2
3.2	Confirmed/Presumed Asbestos-Containing Materials and Confirmed Non-Asbestos Materials	3
4.0	RECOMMENDATIONS	8
4.1	General	8
4.2	On-going Management and Maintenance	9
5.0	TERMS AND LIMITATIONS	9
6.0	REFERENCES	9

APPENDICES

APPENDIX I	Asbestos Analytical Certificates
APPENDIX II	Location List
APPENDIX III	Hazardous Materials Summary / Sample Log Report
APPENDIX IV	All Data Report
APPENDIX V	Drawings



1.0 INTRODUCTION AND SCOPE

Hamilton-Wentworth Catholic District School Board (Client) retained Pinchin Ltd. (Pinchin) to conduct an asbestos building materials reassessment at St. Charles Mountain, located at 150 East 5th Street, Hamilton, Ontario.

The reassessment was performed by Luke Thompson, Project Technologist on June 28, 2022.

The objectives of the reassessment were to document the locations, quantities and conditions of previously identified asbestos-containing building materials, and develop corrective action plans as required. This reassessment is only to be used for the purposes of long-term management and routine maintenance. The results of this reassessment are not to be used for construction, renovation, demolition or project tendering purposes.

1.1 Scope of Assessment

The objective of the reassessment was to evaluate the condition and quantity of previously reported asbestos-containing materials (ACM's), and develop corrective action plans as required.

Refer to the Asbestos Building Materials Reassessment Methodology report and Annex A dated 2022, Pinchin File 303992.004, for the methodology used during the reassessment.

2.0 BACKGROUND INFORMATION

2.1 Building Year of Construction

Item	Details
Year of Construction	1972

2.2 Existing Reports

2.2.1 Review of Previous Reports

Pinchin prepared the following reports, which have been reviewed and relied upon as part of this assessment:

- Asbestos Reassessment, St. Charles Mountain, 150 East 5th Street, Hamilton, Ontario, August 2020, Prepared by Pinchin Ltd., Pinchin File: 272113.
- Bulk Sampling Report, Window Replacement, St. Charles Mountain, 150 East 5th Street, Hamilton, Ontario, August 2020, Prepared by Pinchin Ltd., Pinchin File: 272113.002.
- Asbestos Reassessment, St. Charles Mountain, 150 East 5th Street, Hamilton, Ontario, July 2021, Prepared by Pinchin Ltd., Pinchin File: 286533.001



3.0 FINDINGS

The following section summarizes the findings of the reassessment and provides a general description of the asbestos materials identified. For details on quantities, assessment, sample numbers, friability, condition, and locations of asbestos materials; refer to the Hazardous Materials Summary / Sample Log Report and All Data Report in Appendices III and IV, respectively.

Previous analytical sample results have been relied upon and were included in the original asbestos assessment report completed by MTE Consultants Inc.


3.1 Excluded Asbestos Materials



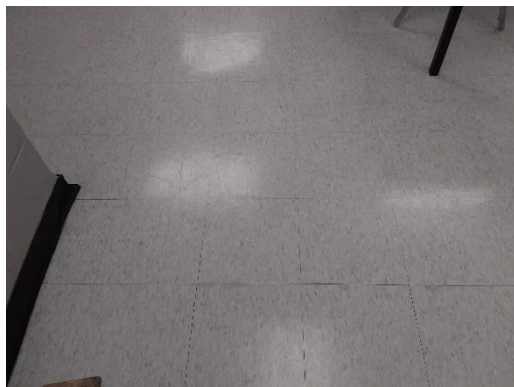
A number of materials which might contain asbestos were not sampled during this reassessment due to limitations in scope and methodology. Where present, these materials are assumed to contain asbestos until otherwise proven by sampling and analysis. These materials are not shown on the drawings in Appendix V. Excluded materials presumed to contain asbestos include:




Material	Friability
Roofing, felts and tar	Non-friable
Concrete floor levelling compound	Non-friable
Electrical components or wiring within control centers, breakers, motors or lights, insulation on wiring	Non-friable
Vermiculite in concrete block wall cavities	Friable
Adhesives and duct mastics	Non-friable
Caulking and butyl seals	Non-friable
Fibre reinforced paints and coatings	Non-friable
Paper products	Non-friable
Soffit and fascia boards	Non-friable
Mechanical packing, ropes and gaskets	Non-friable
Vinyl baseboards	Non-friable
Exterior cladding	Non-friable
Fire resistant doors or metal clad finishes	Non-friable
Vibration dampers on HVAC equipment	Non-friable




3.2 Confirmed/Presumed Asbestos-Containing Materials and Confirmed Non-Asbestos Materials

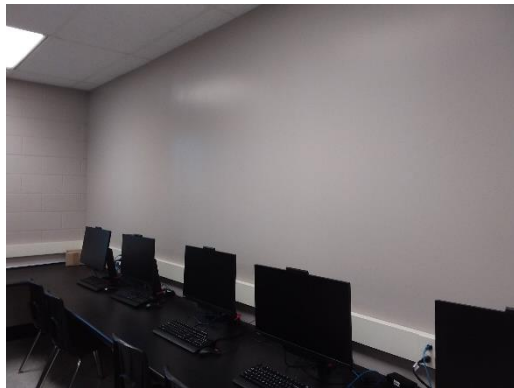


This section includes materials that have been confirmed asbestos-containing by sample analysis or presumed asbestos-containing by visual identification. Refer to the drawings in Appendix V for the locations of confirmed and presumed ACMs indicated via hatching or symbols. The locations of samples from the historical assessments performed by Pinchin, have been included on the drawings.


Material and Application	Asbestos Type/Friability	Photo
Parging cement is present on pipe fittings (elbows, valves, tees, hangers etc.).	Chrysotile/Friable	
Remaining pipes are either uninsulated or insulated with non-asbestos fibreglass or elastomeric insulation (Armaflex).	None	
Ducts are either uninsulated or insulated with non-asbestos fibreglass (foil-faced or canvas).	None	
Mechanical equipment is either uninsulated or insulated with non-asbestos fibreglass.	None	
All ceiling tiles were determined to be non-asbestos by analysis or are presumed to be non-asbestos based on the date of manufacture determined from the date stamp applied to the top of the tiles.	None	

Material and Application	Asbestos Type/Friability	Photo
Non-asbestos texture finish is present on an Exterior (Location 1000) soffit.	None	
Drywall joint compound is present on wall and ceiling finishes.	Chrysotile/Non-friable	
Vinyl floor tiles, 12"x12", dark green with white streaks, are present.	Chrysotile/Non-friable (tile) Chrysotile/Non-friable (mastic)	
Vinyl floor tiles, 12"x12", beige marble, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	

Material and Application	Asbestos Type/Friability	Photo
Vinyl floor tiles, 12"x12", light grey multi-fleck, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	
Vinyl floor tiles, 12"x12", beige with tan streaks, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	
Vinyl floor tiles, 12"x12", beige with brown streaks, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	

Material and Application	Asbestos Type/Friability	Photo
Vinyl floor tiles, 12"x12", white with black fleck, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	
Vinyl floor tiles, 12"x12", black with white fleck, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	
Textile vibration damper is present.	Presumed/Non-Friable	

Material and Application	Asbestos Type/Friability	Photo
Black mastic is present as a sink undercoating.	Presumed/Non-Friable	
Gold mastic is present as a sink undercoating.	Presumed/Non-Friable	
Transite is present as rainwater leaders.	Presumed/Non-Friable	

Material and Application	Asbestos Type/Friability	Photo
Grey window putty is present between glazing and frames on exterior (Location 1000).	Chrysotile/Non-friable	
Remaining caulking and putty associated with windows throughout the site were determined to be non-asbestos by analysis.	None	

Additional notes on the asbestos-containing drywall joint compound discussed above:

- Drywall (gypsum board) and drywall joint compound is present as a wall and ceiling finish throughout the building. As per the methodology, drywall joint compound is sampled at exterior walls, columns or other locations that are unlikely to have been renovated in an attempt to determine the presence of asbestos in the original drywall compound. A total of 9 samples of drywall joint compound were collected (samples S0001A-C, S0002A-C, S0003A-C, lab reference no. 71921025) and it was found that 4 samples contained chrysotile asbestos. The asbestos-positive results indicate that at minimum, the original drywall joint compound application contains asbestos and all drywall joint compound should be presumed to contain asbestos. Further sampling may be considered in an attempt to delineate asbestos-containing drywall compound from newer, non-asbestos drywall compound.

4.0 RECOMMENDATIONS

4.1 General

Perform a detailed intrusive assessment prior to building renovation or demolition operations. The assessment should include; destructive testing (i.e. coring and/or removal of building finishes and components), sampling of other hazardous materials (lead, mercury, PCBs, mould, etc.), and materials not tested in this study (i.e. excluded asbestos materials).



4.2 On-going Management and Maintenance

The following recommendations are made regarding on-going management and maintenance work involving the asbestos materials identified.

4.2.1 Asbestos

Maintain the Asbestos Management Program (AMP).

Perform a reassessment of asbestos materials on an annual basis.

Remove asbestos-containing materials (ACM) prior to alteration or maintenance work if ACM may be disturbed by the work. Follow appropriate asbestos precautions for the classification of work being performed.

Sample presumed ACM prior to alteration or maintenance work if the presumed ACM may be disturbed by the work.

Update the asbestos inventory report upon completion of any abatement and removal of asbestos-containing materials.

5.0 TERMS AND LIMITATIONS

This work was performed subject to the Terms and Limitations presented or referenced in the proposal for this project.

Information provided by Pinchin is intended for Client use only. Pinchin will not provide results or information to any party unless disclosure by Pinchin is required by law. Any use by a third party of reports or documents authored by Pinchin or any reliance by a third party on or decisions made by a third party based on the findings described in said documents, is the sole responsibility of such third parties. Pinchin accepts no responsibility for damages suffered by any third party as a result of decisions made or actions conducted. No other warranties are implied or expressed.

6.0 REFERENCES

The following legislation and documents were referenced in completing the assessment and this report:

1. Asbestos on Construction Projects and in Buildings and Repair Operations, Ontario Regulation 278/05.
2. Designated Substances, Ontario Regulation 490/09.

APPENDIX I
Asbestos Analytical Certificates



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Emily Balfour
Michael Maiorana

Project: 230748,150 East 5th Street, Hamilton, Ontario,Hamilton-Wentworth Catholic School
Board,St. Charles Mountain

Lab Order ID: 71921025
Analysis ID: 71921025_PLM
Date Received: 8/9/2019
Date Reported: 8/19/2019
Date Amended: 9/6/2019

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
S0001A	Drywall joint compound on column, Classroom, Location 1019	None Detected		100% Other	White Non Fibrous Homogeneous
71921025PLM_1					Crushed
S0001B	Drywall joint compound on bulkhead, Storage/Kitchen, Location 1047	3% Chrysotile		97% Other	Tan Non Fibrous Homogeneous
71921025PLM_2					Crushed
S0001C	Drywall joint compound on ceiling, Storage, Location 1041	2% Chrysotile		98% Other	Tan Non Fibrous Homogeneous
71921025PLM_3					Crushed
S0002A	Drywall joint compound on wall, Classroom, Location 1018	None Detected		100% Other	White Non Fibrous Homogeneous
71921025PLM_4					Crushed
S0002B	Drywall joint compound on wall, Photo Copier, Location 1028	2% Chrysotile		98% Other	Tan, White Non Fibrous Homogeneous
71921025PLM_5					Crushed
S0002C	Drywall joint compound on wall, Corridor, Location 1004	2% Chrysotile		98% Other	Tan Non Fibrous Homogeneous
71921025PLM_6					Crushed
S0003A	Drywall joint compound on wall, Classroom, Location 2009	None Detected		100% Other	White Non Fibrous Homogeneous
71921025PLM_7					Crushed
S0003B	Drywall joint compound on wall, Classroom, Location 2012	None Detected		100% Other	White Non Fibrous Homogeneous
71921025PLM_8					Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Bobby Wheatley (1)
Anna Roseman (8)

Analyst

Approved Signatory



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Emily Balfour
Michael Maiorana

Project: 230748,150 East 5th Street, Hamilton, Ontario,Hamilton-Wentworth Catholic School
Board,St. Charles Mountain

Lab Order ID: 71921025
Analysis ID: 71921025_PLM
Date Received: 8/9/2019
Date Reported: 8/19/2019
Date Amended: 9/6/2019

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
S0003C	Drywall joint compound on wall, Classroom, Location 2011	None Detected		100% Other	White Non Fibrous Homogeneous
71921025PLM_9					Crushed


Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Bobby Wheatley (1)
Anna Roseman (8)

Analyst

Approved Signatory

71921025
Version 1-15-2012

Client: Pinchin Ltd. Contact: Emily Balfour 6-875 Main Street West, Suite 200, Hamilton ON L8S 4P9 Address: Phone: 905-577-6206 Fax: 905-577-6207 Email: ebalfour@pinchin.com mmaiorana@pinchin.com 230748, 150 East 5th Street, Hamilton, Ontario, Hamilton- Wentworth Catholic School Board, St. Charles Mountain	*Instructions: Use Column "B" for your contact info To See an Example Click the bottom Example Tab. Enter samples between "<<" and ">>" Begin Samples with a "<<" above the first sample and end with a ">>" below the last sample. Only Enter your data on the first sheet "Sheet1" Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.	Invoice to: ap@pinchin.com  Scientific Analytical Institute 4604 Dundas Dr. Greensboro, NC 27407 Phone: 336.292.3888 Fax: 336.292.3313 Email: lab@sailab.com
Project: Client Notes: P.O. #. 230748 Date Submitted: August 8, 2019 Analysis: PLM - Stop Positive TurnAroundTime: 4days		

Sample Number	Data 1 (Lab use only)	Sample Description	Data 2 (Lab use only)
---------------	-----------------------	--------------------	-----------------------

<<
S0001A
S0001B
S0001C
S0002A
S0002B
S0002C
S0003A
S0003B
S0003C
>>

Drywall joint compound on column, Classroom, Location 1019
 Drywall joint compound on bulkhead, Storage/Kitchen, Location 1047
 Drywall joint compound on ceiling, Storage, Location 1041
 Drywall joint compound on wall, Classroom, Location 1018
 Drywall joint compound on wall, Photo Copier, Location 1028
 Drywall joint compound on wall, Lunch Room, Location 1012
 Drywall joint compound on wall, Classroom, Location 2009
 Drywall joint compound on wall, Classroom, Location 2012
 Drywall joint compound on wall, Classroom, Location 2011

Accepted ☒

Rejected ☐

[Handwritten signature]
[Handwritten signature] 8.9 10:30A



Pinchin Ltd. Asbestos Laboratory *Certificate of Analysis*

Project Name:	Hamilton-Wentworth Catholic School Board, St. Charles Mountain, 150 East 5th Street, Hamilton, Ontario		
Project No.:	0272113.000		
Prepared For:	E. Balfour / M. Maiorana		
Lab Reference No.:	b230653	Date Received:	May 21, 2020
Analyst(s):	K. Cockburn	Date Analyzed:	May 28, 2020
		# Samples submitted:	3
		# Phases analyzed:	1

Method of Analysis:

EPA 600/R-93/116 - Method for the Determination of Asbestos in Bulk Building Materials dated July, 1993

Bulk samples are checked visually and scanned under a stereomicroscope. Slides are prepared and observed under a Polarized Light Microscope (PLM) at magnifications of 40X, 100X or 400X as appropriate. Asbestos fibres are identified by a combination of morphology, colour, refractive index, extinction, sign of elongation, birefringence and dispersion staining colours. A visual estimate is made of the percentage of asbestos present. A reported concentration of less than (<) the regulatory threshold (see chart below) indicates the presence of confirmed asbestos in trace quantities, limited to only a few fibres or fibre bundles in an entire sample. This method complies with provincial regulatory requirements where applicable. Multiple phases within a sample are analyzed and reported separately.

All bulk samples submitted to this laboratory for asbestos analysis are retained for a minimum of three months. Samples may be retrieved, upon request, for re-examination at any time during that period.

The Pinchin Ltd. Mississauga asbestos laboratory is accredited by the National Institute of Standards and Technology, National Voluntary Laboratory Accreditation Program (NVLAP Lab Code 101270-0) for the 'EPA – 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples,' and the 'EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials'; and meets all requirements of ISO/IEC 17025:2005.

This report relates only to the items tested.

NOTE: *This test report may not be reproduced, except in full, without the written approval of the laboratory. The client may not use this report to claim product endorsement by NVLAP or any agency of the U.S. Government. This report is valid only when signed in blue ink by the analyst. Vinyl asbestos floor tiles contain very fine fibres of asbestos and may be missed by some laboratories using the PLM method. Internal verification studies performed by Pinchin indicate that the chance of missing asbestos in floor tiles is no higher than about 2%. The vinyl tile study and laboratory documentation on measurement uncertainty is available upon request. The analysis of dust samples by PLM cannot be used as an indicator of past or present airborne asbestos fibre levels.*



Pinchin Ltd. Asbestos Laboratory
Certificate of Analysis

Project Name: Hamilton-Wentworth Catholic School Board, St. Charles Mountain,
150 East 5th Street, Hamilton, Ontario
Project No.: 0272113.000
Prepared For: E. Balfour / M. Maiorana
Lab Reference No.: b230653
Date Analyzed: May 28, 2020

BULK SAMPLE ANALYSIS

SAMPLE IDENTIFICATION	SAMPLE DESCRIPTION	% COMPOSITION (VISUAL ESTIMATE)			
		ASBESTOS		OTHER	
S0004A Parging cement, Women's Washroom, Location 1003	Homogeneous, grey, soft, parging cement.	Chrysotile	50-75%	Non-Fibrous Material	25-50%
S0004B Parging cement, Corridor, Location 1004				Not Analyzed	
Comments:	Analysis was stopped due to a previous positive result.				
S0004C Parging cement, Classroom, Location 1017				Not Analyzed	
Comments:	Analysis was stopped due to a previous positive result.				

Reviewed by:

Reporting Analyst:



MEMBER OF
PG
THE PINCHIN GROUP

Analyzed by: *KC*
Reviewed by: *HB*
Report Sent by: *HB*

Instructions:

Pinchin Ltd. - Asbestos Laboratory Internal Asbestos Bulk Sample Chain of Custody

Client Name:	Hamilton-Wentworth Catholic School Board	Project Address:	150 East 5th Street, Hamilton, Ontario
Portfolio/Building No:	St. Charles Mountain	Pinchin File:	272113
Submitted by:	Emily Balfour	Email:	ebalfour@pinchin.com
CC Results to:	Michael Maiorana	CC Email:	mmaiorana@pinchin.com
Invoice to:	Accounts Payable	Invoice Email:	ap@pinchin.com
Date Submitted:	May 19 2020	Required by:	May 26 2020
# of Samples:		Priority:	5 Day Turnaround
Year of Building Construction (Mandatory Field):	1972		
Do NOT Stop on Positive (Sample Numbers):			
Pinchin Group Company (Mandatory Field):	Pinchin		

To be Completed by Lab Personnel Only:

Lab Reference #:	b230653CH		Time:	24 hour clock		
Received by:	MAY 21 2020		Date:	Month	Day	Year
Name(s) of Analyst(s):	<i>KC</i> 2020/05/28					
Sample Prefix	Sample No.	Sample Suffix	Sample Description/Location (Mandatory)			
	S0004	A	Parging cement, Women's Washroom, Location 1003 CH 50 75?			
	S0004	B	Parging cement, Corridor, Location 1004 - NA -			
	S0004	C	Parging cement, Classroom, Location 1017 - NA -			



Pinchin Ltd. Asbestos Laboratory *Certificate of Analysis*

Project Name:	Hamilton-Wentworth Catholic School Board, St. Charles Mountain, 150 East 5th Street, Hamilton, Ontario		
Project No.:	0272113.002		
Prepared For:	E. Balfour / M. Maiorana		
Lab Reference No.:	b234629	Date Received:	July 28, 2020
Analyst(s):	W. Mirza / C. Luong	Date Analyzed:	July 31, 2020
		# Samples submitted:	21
		# Phases analyzed:	19

Method of Analysis:

EPA 600/R-93/116 - Method for the Determination of Asbestos in Bulk Building Materials dated July, 1993

Bulk samples are checked visually and scanned under a stereomicroscope. Slides are prepared and observed under a Polarized Light Microscope (PLM) at magnifications of 40X, 100X or 400X as appropriate. Asbestos fibres are identified by a combination of morphology, colour, refractive index, extinction, sign of elongation, birefringence and dispersion staining colours. A visual estimate is made of the percentage of asbestos present. A reported concentration of less than (<) the regulatory threshold (see chart below) indicates the presence of confirmed asbestos in trace quantities, limited to only a few fibres or fibre bundles in an entire sample. This method complies with provincial regulatory requirements where applicable. Multiple phases within a sample are analyzed and reported separately.

All bulk samples submitted to this laboratory for asbestos analysis are retained for a minimum of three months. Samples may be retrieved, upon request, for re-examination at any time during that period.

The Pinchin Ltd. Mississauga asbestos laboratory is accredited by the National Institute of Standards and Technology, National Voluntary Laboratory Accreditation Program (NVLAP Lab Code 101270-0) for the 'EPA – 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples,' and the 'EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials'; and meets all requirements of ISO/IEC 17025:2005.

This report relates only to the items tested.

NOTE: *This test report may not be reproduced, except in full, without the written approval of the laboratory. The client may not use this report to claim product endorsement by NVLAP or any agency of the U.S. Government. This report is valid only when signed in blue ink by the analyst. Vinyl asbestos floor tiles contain very fine fibres of asbestos and may be missed by some laboratories using the PLM method. Internal verification studies performed by Pinchin indicate that the chance of missing asbestos in floor tiles is no higher than about 2%. The vinyl tile study and laboratory documentation on measurement uncertainty is available upon request. The analysis of dust samples by PLM cannot be used as an indicator of past or present airborne asbestos fibre levels.*



Pinchin Ltd. Asbestos Laboratory

Certificate of Analysis

Project Name: Hamilton-Wentworth Catholic School Board,
 St. Charles Mountain, 150 East 5th Street, Hamilton, Ontario
Project No.: 0272113.002
Prepared For: E. Balfour / M. Maiorana

Lab Reference No.: b234629
Date Analyzed: July 31, 2020

BULK SAMPLE ANALYSIS

SAMPLE IDENTIFICATION	SAMPLE DESCRIPTION	% COMPOSITION (VISUAL ESTIMATE)	
		ASBESTOS	OTHER
S0005A Textured plaster soffit, Exterior, Location 1000	2 Phases: a) Homogeneous, light grey, hard, cementitious material. b) Homogeneous, white, hard, cementitious material.	None Detected Chrysotile < 0.5%	Perlite 10-25% Other Non-Fibrous > 75% Non-Fibrous Material > 75%
S0005B Textured plaster soffit, Exterior, Location 1000	2 Phases: a) Homogeneous, light grey, hard, cementitious material. b) Homogeneous, white, hard, cementitious material.	None Detected Chrysotile < 0.5%	Perlite 10-25% Other Non-Fibrous > 75% Non-Fibrous Material > 75%
Comments:	Phase a) is small in size.		
S0005C Textured plaster soffit, Exterior, Location 1000	Homogeneous, white, hard, cementitious material.	Chrysotile < 0.5%	Non-Fibrous Material > 75%
Comments:	There is no light grey cementitious material in this sample to be analyzed.		
S0006A Grey window putty, Exterior, Location 1000	Homogeneous, grey, soft, sticky and rubbery material.	Chrysotile 5-10%	Non-Fibrous Material > 75%
S0006B Grey window putty, Exterior, Location 1000			Not Analyzed
Comments:	Analysis was stopped due to a previous positive result.		



Pinchin Ltd. Asbestos Laboratory
Certificate of Analysis

Project Name: Hamilton-Wentworth Catholic School Board,
St. Charles Mountain, 150 East 5th Street, Hamilton, Ontario
Project No.: 0272113.002
Prepared For: E. Balfour / M. Maiorana
Lab Reference No.: b234629
Date Analyzed: July 31, 2020

BULK SAMPLE ANALYSIS

SAMPLE IDENTIFICATION	SAMPLE DESCRIPTION	% COMPOSITION (VISUAL ESTIMATE)	
		ASBESTOS	OTHER
S0006C Grey window putty, Exterior, Location 1000			Not Analyzed
Comments:	Analysis was stopped due to a previous positive result.		
S0007A Brown caulking around window frame, Exterior, Location 1000	Homogeneous, dark brown, soft, rubbery caulking material.	None Detected	Non-Fibrous Material > 75%
S0007B Brown caulking around window frame, Exterior, Location 1000	Homogeneous, dark brown, soft, rubbery caulking material.	None Detected	Non-Fibrous Material > 75%
S0007C Brown caulking around window frame, Exterior, Location 1000	Homogeneous, dark brown, soft, rubbery caulking material.	None Detected	Non-Fibrous Material > 75%
S0008A Black window putty, Exterior, Location 1000	Homogeneous, black, soft, rubbery material.	None Detected	Non-Fibrous Material > 75%
S0008B Black window putty, Exterior, Location 1000	Homogeneous, black, soft, rubbery material.	None Detected	Non-Fibrous Material > 75%
S0008C Black window putty, Exterior, Location 1000	Homogeneous, black, soft, rubbery material.	None Detected	Non-Fibrous Material > 75%



Pinchin Ltd. Asbestos Laboratory Certificate of Analysis

Project Name: Hamilton-Wentworth Catholic School Board,
 St. Charles Mountain, 150 East 5th Street, Hamilton, Ontario
Project No.: 0272113.002
Prepared For: E. Balfour / M. Maiorana

Lab Reference No.: b234629
Date Analyzed: July 31, 2020

BULK SAMPLE ANALYSIS

SAMPLE IDENTIFICATION	SAMPLE DESCRIPTION	% COMPOSITION (VISUAL ESTIMATE)	
		ASBESTOS	OTHER
S0009A White caulking around window frame, Cafeteria A, Location 1039	Homogeneous, white, soft, rubbery caulking material.	None Detected	Non-Fibrous Material > 75%
S0009B White caulking around window frame, Classroom, Location 2004	Homogeneous, white, soft, rubbery caulking material.	None Detected	Non-Fibrous Material > 75%
S0009C White caulking around window frame, English/Soial Science, Location 1035	Homogeneous, soft, rubbery caulking material.	None Detected	Non-Fibrous Material > 75%
S0010A Grey window putty, Classroom, Location 2004	Homogeneous, grey, soft, sticky and rubbery material.	Chrysotile 5-10%	Non-Fibrous Material > 75%
S0010B Grey window putty, Classroom, Location 2004			Not Analyzed
Comments:	Analysis was stopped due to a previous positive result.		
S0010C Grey window putty, Classroom, Location 2009			Not Analyzed
Comments:	Analysis was stopped due to a previous positive result.		
S0011A Grey caulking around window frame, Exterior, Location 1000	Homogeneous, grey, soft, rubbery caulking material.	None Detected	Non-Fibrous Material > 75%



Pinchin Ltd. Asbestos Laboratory
Certificate of Analysis

Project Name: Hamilton-Wentworth Catholic School Board,
St. Charles Mountain, 150 East 5th Street, Hamilton, Ontario
Project No.: 0272113.002
Prepared For: E. Balfour / M. Maiorana
Lab Reference No.: b234629
Date Analyzed: July 31, 2020

BULK SAMPLE ANALYSIS

SAMPLE IDENTIFICATION	SAMPLE DESCRIPTION	% COMPOSITION (VISUAL ESTIMATE)	
		ASBESTOS	OTHER
S0011B Grey caulking around window frame, Exterior, Location 1000	Homogeneous, grey, soft, rubbery caulking material.	None Detected	Non-Fibrous Material > 75%
S0011C Grey caulking around window frame, Exterior, Location 1000	Homogeneous, grey, soft, rubbery caulking material.	None Detected	Non-Fibrous Material > 75%

Reviewed by:

Reporting Analyst:



Reviewed by:

Report Sent by:

**Instructions:****Pinchin Ltd. - Asbestos Laboratory
Internal Asbestos Bulk Sample Chain of Custody**

Client Name:	Hamilton-Wentworth Catholic School Board	Project Address:	150 East 5th Street, Hamilton, Ontario
Portfolio/Building No:	St. Charles Mountain	Pinchin File:	272113.002
Submitted by:	Emily Balfour	Email:	ebalfour@pinchin.com
CC Results to:	Michael Maiorana	CC Email:	mmaiorana@pinchin.com
Invoice to:	Accounts Payable	Invoice Email:	ap@pinchin.com
Date Submitted:	July 27 2020	Required by:	July 30 2020
# of Samples:	21	Priority:	3 Day Turnaround
Year of Building Construction (Mandatory Field):	1972		
Do NOT Stop on Positive (Sample Numbers):			
Pinchin Group Company (Mandatory Field):	Pinchin		

To be Completed by Lab Personnel Only:

Lab Reference #:	0234629	Time:	24 hour clock		
Received by:	RS	Date:	Month	Day	Year
Name(s) of Analyst(s):	CL/WM	JUL 28 2020 July 31/2020			

Sample Prefix	Sample No.	Sample Suffix	Sample Description/Location (Mandatory)
CL	S0005	A	Textured plaster soffit, Exterior, Location 1000 a) NO b) CH < 0.5%.
	S0005	B	Textured plaster soffit, Exterior, Location 1000 a) NO b) CH < 0.5%.
	S0005	C	Textured plaster soffit, Exterior, Location 1000 CH < 0.5%.
	S0006	A	Grey window putty, Exterior, Location 1000 CH 5-10%.
	S0006	B	Grey window putty, Exterior, Location 1000 - NA -
	S0006	C	Grey window putty, Exterior, Location 1000 - NA -

Sample Prefix	Sample No.	Sample Suffix	Sample Description/Location (Mandatory)
	S0007	A	Brown caulking around window frame, Exterior, Location 1000 ND
	S0007	B	Brown caulking around window frame, Exterior, Location 1000 ND
	S0007	C	Brown caulking around window frame, Exterior, Location 1000 ND
	S0008	A	Black window putty, Exterior, Location 1000 ND
	S0008	B	Black window putty, Exterior, Location 1000 ND
	S0008	C	Black window putty, Exterior, Location 1000 ND
	S0009	A	White caulking around window frame, Cafeteria A, Location 1039 ND
	S0009	B	White caulking around window frame, Classroom, Location 2004 ND
	S0009	C	White caulking around window frame, English/Soial Science, Location 1035 ND
	S0010	A	Grey window putty, Classroom, Location 2004 CH 5-10'
	S0010	B	Grey window putty, Classroom, Location 2004 -NA-
	S0010	C	Grey window putty, Classroom, Location 2009 -NA-
	S0011	A	Grey caulking around window frame, Exterior, Location 1000 ND
	S0011	B	Grey caulking around window frame, Exterior, Location 1000 NP
	S0011	C	Grey caulking around window frame, Exterior, Location 1000 ND

13

APPENDIX II
Location List

Client: Hamilton-Wentworth Catholic District Sch
Building Name: St Charles - Mountain Campus
Survey Date: 2018-07-19

Site: 150 East 5th Street, Hamilton, ON
Last Re-Assessment: 2022-06-28

Location No.	Name or Description	Area ft ²	Floor No.	Bldg. Phase	Notes
1	Presumed Asbestos-Containing Materials	0		A	
1000	Exterior	0		A	
1001	Child Minding	0	1	A	
1002	Men's Washroom	0	1	A	
1003	Women's Washroom	0	1	A	
1004	Corridor	0	1	A	
1005	Storage	0	1	A	
1006	Principal's Office	0	1	A	
1007	Office	0	1	A	
1008	Computer Lab	0	1	A	
1009	VP Office	0	1	A	
1010	Main Office	0	1	A	
1011	Financial Analyst	0	1	A	
1012	Lunch Room	0	1	A	
1013	Stage	0	1	A	
1014	Gym	0	1	A	
1015	Credit Office	0	1	A	
1017	Classroom	0	1	A	
1018	Classroom	0	1	A	
1019	Classroom	0	1	A	
1020	Classroom	0	1	A	
1021	Sink Room	0	1	A	
1022	Custodian Storage	0	1	A	
1023	Storage/Mechanical	0	1	A	
1024	Custodian Office	0	1	A	
1025	Staff Room	0	1	A	
1026	Staff Womens Washroom	0	1	A	
1027	YMCA	0	1	A	
1028	Photo Copier	0	1	A	
1029	Science	0	1	A	
1030	English Room	0	1	A	
1031	English Room	0	1	A	
1032	Business/Computer	0	1	A	
1033	Math	0	1	A	
1034	Math	0	1	A	
1035	English/Social Science	0	1	A	
1036	LBS	0	1	A	
1037	Kitchen	0	1	A	
1038	Cafeteria B and Storage	0	1	A	
1039	Cafeteria A	0	1	A	
1040	Chef Office	0	1	A	
1041	Storage	0	1	A	
1042	Custodian	0	1	A	
1043	Stairwell	0	1	A	
1044	Stairwell	0	1	A	
1045	Stairwell	0	1	A	
1046	Stairwell	0	1	A	
1047	Storage/ Kitchen	0	1	A	
1048	Balcony	0	1	A	
1050	Storage	0	1	A	
1051	Storage	0	1	A	
1052	Storage	0	1	A	
1053	Corridor	0	1	A	
1055	Staff Mens Washroom	0	1	A	
2000	Stairwell	0	2	A	
2001	Classroom, room no. 25	0	2	A	
2002	Hallway	0	2	A	
2003	Classroom, room no. 24	0	2	A	
2004	Classroom	0	2	A	
2005	Classroom, room no. 22	0	2	A	
2006	Classroom, room no. 21	0	2	A	
2007	Stairwell	0	2	A	

Location No.	Name or Description	Area ft ²	Floor No.	Bldg. Phase	Notes
2008	Corridor	0	2	A	
2009	Classroom, room no. 11	0	2	A	
2010	Corridor	0	2	A	
2011	Classroom, room no. 12	0	2	A	
2012	Classroom, room no. 13	0	2	A	
2013	Men's Washroom	0	2	A	
2014	Custodian Room	0	2	A	
2015	Caretaker Closet	0	2	A	
2016	Corridor	0	2	A	
2017	ESL Room, room no. A	0	2	A	
2018	Copy Room	0	2	A	
2019	Spare Room	0	2	A	
2020	Classroom, room no. 14	0	2	A	
2021	Corridor	0	2	A	
2022	Office	0	2	A	
2023	Office	0	2	A	
2024	Office	0	2	A	
2025	Office	0	2	A	
2026	Office	0	2	A	
2027	Office	0	2	A	
2028	Classroom, room no. 32	0	2	A	
2029	Classroom, room no. 33	0	2	A	
2030	Stairwell, room no. A	0	2	A	
2031	Classroom, room no. 17	0	2	A	
2032	Classroom, room no. 16	0	2	A	
2033	Classroom, room no. 15	0	2	A	
2034	Classroom, room no. 20	0	2	A	
2035	Classroom, room no. 19	0	2	A	
2036	Classroom, room no. 18	0	2	A	
2037	Classroom, room no. 26	0	2	A	
2038	Classroom, room no. 27	0	2	A	
2039	Classroom	28	2	A	
2040	Corridor	0	2	A	
2041	Classroom, room no. 31	0	2	A	
2042	Classroom	0	2	A	
2043	Classroom	0	2	A	
2044	Eyewash Station, room no. 2	0	2	A	
2045	Womens Washroom	0	2	A	
2046	Spare Room	0	2	A	

APPENDIX III

Hazardous Materials Summary / Sample Log Report

Client: Hamilton-Wentworth Catholic District Sch

Site: 150 East 5th Street, Hamilton, ON

Building Name: St Charles - Mountain Campus

Survey Date: 2018-07-19

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
Asbestos	S0001 ABC	Ceiling, Wall, Ceiling Column Drywall And Joint Compound	1015,1019,1021,1022,1023,1041,1047,2014	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0002 ABC	Wall Drywall And Joint Compound	1004,1006,1007,1008,1010,1011,1012,1015,1018 1028	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0003 ABC	Wall Drywall And Joint Compound	2009,2011,2012	A	0	0	0	100	None Detected	No	
Asbestos	S0004 ABC	Piping Parging Cement	1003,1004,1014,1017,1018,1019,1020,2025	A	0	0	72	0	Chrysotile	Yes	F
Asbestos	S0005 ABC	Ceiling Soffit Plaster Textured, Outside Location 1044	1000	A	0	0	0	0	Chrysotile	No	
Asbestos	S0006 ABC	Other Window Putty Grey	1000	A	0	0	0	33	Chrysotile	Yes	NF
Asbestos	S0007 ABC	Other Window Caulking Brown, Outside Location 1036	1000	A	0	0	0	0	None Detected	No	
Asbestos	S0008 ABC	Other Window Putty Black, Outside Locations 1007 And 1036	1000	A	0	0	0	0	None Detected	No	
Asbestos	S0009 ABC	Other Window Caulking White	1006,1008,1009,1010,1033,1034,1035,1037,1038 1039,2001,2002,2003,2004,2005,2006,2009,2020 2022,2023,2024,2025,2026,2027,2028,2029	A	0	0	0	0	None Detected	No	
Asbestos	S0010 ABC	Other Window Putty Grey	1006,1008,1009,1010,1033,1034,1035,1037,1038 1039,2001,2003,2004,2005,2006,2009,2020,2022 2023,2024,2025,2026,2027,2028,2029	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0011 ABC	Other Window Caulking Grey	1000	A	0	0	0	0	None Detected	No	
Asbestos	V9000	Floor Vinyl Floor Tile And Mastic 12"x 12". Dark Green With White Streak (previously Sampled)	1005,1017,1018,1020,1024,1039,1047,2015	A	0	0	0	100	Confirmed Asbestos	Yes	NF
Asbestos	V9500	Duct Adhesive/mastic	1	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Duct Textile	1048	A	0	0	0	0	Presumed Asbestos	Yes	NF
Asbestos	V9500	Floor Adhesive/mastic Vinyl Baseboards	1	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Floor Floor Levelling Compound	1	A	0	0	0	100	Presumed Asbestos	Yes	F
Asbestos	V9500	Floor Mastic	1001,1006,1007,1008,1009,1010,1011,1012,1015 1019,1025,1029,1030,1031,1032,1033,1034,1035 1036,1038,1040,1042,2000,2001,2002,2003,2004 2005,2006,2007,2008,2009,2010,2011,2012,2016 2017,2019,2020,2021,2022,2023,2024,2025,2026 2027,2028,2029,2030,2031,2032,2033,2034,2035 2036,2037,2038,2039,2040,2041,2042,2043,2045	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Floor Vinyl Floor Tile And Mastic 12" X 12"	1001,1006,1007,1008,1009,1010,1011,1012,1014	A	0	0	0	99	Presumed	Yes	NF

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
		Beige Marble, 12" X 12" Beige Marble, 12" X 12" Dark Grey With White Streaks, Vinyl Floor Tile 12"x 12" Beige Marble, Vinyl Floor Tile 12"x 12" Beige Marble., Vinyl Floor Tile 12"x 12" Beige With Brown Fleck, Vinyl Floor Tile 12"x 12" Beige With Brown Fleck., Vinyl Floor Tile 12"x 12" Beige With Brown Streak., Vinyl Floor Tile 12"x 12" Beige With Tan Streak., Vinyl Floor Tile 12"x 12" Black With White Fleck., Vinyl Floor Tile 12"x 12" Dark Grey With White Streak., Vinyl Floor Tile 12"x 12" Grey/white Dense Fleck., Vinyl Floor Tile 12"x 12" Light Grey Multi-fleck., Vinyl Floor Tile 12"x 12" White With Black Fleck.	1015,1017,1019,1025,1029,1030,1031,1032,1033,1034,1035,1036,1038,1040,1042,2000,2001,2002,2003,2004,2005,2006,2007,2008,2009,2010,2011,2012,2013,2016,2017,2018,2019,2020,2021,2022,2023,2024,2025,2026,2027,2028,2029,2030,2031,2032,2033,2034,2035,2036,2037,2038,2039,2040,2041,2042,2043,2045,2046						Asbestos		
Asbestos	V9500	Mechanical Equipment Gasket Mechanical Packing, Rope	1	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Mechanical Equipment Expansion Joint Textile Vibration Damper	1	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Door Caulking	1	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Electrical Equipment Cement Product	1	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Sink Mastic, Black Undercoating	1047	A	0	0	1	0	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Sink Mastic, Gold Undercoating	1028	A	0	0	1	0	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Paper	1	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Roof Roofing Material	1	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Electrical Wire Textile	1	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Fire Door Unidentified Material	1	A	0	0	0	100	Presumed Asbestos	Yes	F
Asbestos	V9500	Piping Cement Product	1017,1019	A	20	0	0	0	Presumed Asbestos	Yes	NF
Asbestos	V9500	Wall Column Drywall And Joint Compound	1029,1030,1031,1032,1033,1034,1035,1036,2002,2003,2004,2005,2006,2009,2011,2012,2021,2025,2026,2027,2028,2029,2031,2032,2033,2034,2035,2036,2037,2038,2039,2040,2041,2042,2043	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Wall Vermiculite/concrete Block Walls	1	A	0	0	0	100	Presumed Asbestos	Yes	F
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) 2' X 4' Long Fissure Random Pinhole (previously Sampled)	1027,1028,1050,1051,1053,2000,2008,2009,2011,2012,2013,2015,2016,2017,2018,2019,2045,2046	A	0	0	0	100	Non Asbestos	No	

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) 2' X 4' Long Fissure Random Pinhole.	1052	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) 2' X 4' Short Fissure Random Pinhole. Date Stamped 2010.	2007	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) 2' X 4' Small And Irregular Pinhole. Date Stamped 08/23/09.	1034,1035,1039	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) 2' X 4' Small And Irregular Pinhole. Date Stamped 08/23/09.	1033,2022	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tiles (lay-in) 2' X 4'. Long Fissure Random Pinhole (previously Sampled)	1005	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tiles (lay-in) 2x4 Small And Irregular Pinhole (date Stamped 08/23/09)	1055	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) 2x4, Small And Irregular Pinholes. Date Stamped 08/23/09.	1008	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X 4' Long Fissure Random Pinhole.	2044	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X 4' Short Fissure Random Pinhole.	1017	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X 4' Short Fissure Random Pinhole. Date Stamped 2010.	2029	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X 4' Short Fissure Random Pinhole. Date Stamped 1996.	1015,1019	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X 4' Short Fissure Random Pinhole. Date Stamped 2010.	1050,1051,1052,1053,2001,2003,2004,2005,2006,2008,2010,2026,2030,2031,2032,2033,2034,2035,2036,2037,2038,2039,2040,2041,2042,2043,2044	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X 4' Short Fissure Random Pinhole. Date Stamped 1996.	1018	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X 4' Short Fissure Random Pinhole. Date Stamped 2010.	2002	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X 4' Small And Irregular Pinhole. Date Stamped 08/23/09	1024,1043	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tiles (lay-in) Ceiling Tile 2' X 4' Small And Irregular Pinhole. Date Stamped 08/23/09.	1025,1032,1036,1042,1044,1045,2021,2023,2024,2025,2028	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X	1007	A	0	0	0	100	Non	No	

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
		4' Small And Irregular Pinhole. Date Stamped 08/23/09							Asbestos		
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X 4' Small And Irregular Pinhole. Date Stamped 08/23/09.	1009,1010,1011,1012,1026,1029,1038,1040,1046 2020,2027	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X 4' Textured (previously Sampled)	1037	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X 4'. Small And Irregular Pinhole - Date Stamped 08/23/09.	1001	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X 4'. Small And Irregular Pinhole - Date Stamped 08/23/09.	1002,1003	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Ceiling Tile 2' X 4'. Small And Irregular Pinhole. Date Stamped 08/23/09.	1004,1006	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Floor Terrazzo	1055	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Piping Fibreglass	1055	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Wall Column Drywall And Joint Compound Hwcdsb Sample Agat 19h455712	1032,2001	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Wall Masonry	1007,1055	A	0	0	0	100	Non Asbestos	No	

Legend:

Sample number		Units			
S####	Asbestos sample collected	SF	Square feet	NF	Non Friable material.
L####	Paint sample collected	LF	Linear feet	F	Friable material
P####	PCB sample collected	EA	Each	PF	Potentially Friable material
M####	Mould sample collected	%	Percentage		
V####	Material visually similar to numbered sample collected				
V0000	Known non Hazardous Material				
V9000	Material is visually identified as Hazardous Material				
V9500	Material is presumed to be Hazardous Material				
[Loc. No.]	Abated Material				

APPENDIX IV
All Data Report

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1 : Presumed Asbestos-Containing Materials
Survey Date: 2018-07-19

Site: Adult
Floor:

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Duct		Adhesive/mastic			C	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Adhesive/mastic, vinyl baseboards			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Floor Levelling Compound			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	F
Mechanical Equipment		Gasket, mechanical packing, rope			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Mechanical Equipment	Expansion Joint	Textile, vibration damper			C	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other		Paper			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Door	Caulking			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Electrical Equipment	Cement Product			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Electrical Wire	Textile			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Fire Door	Unidentified Material			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	F
Other	Roof	Roofing material			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Vermiculite/concrete block walls			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	F

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1000 : Exterior
Survey Date: 2018-07-19

Site: Adult
Floor:

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Soffit	Plaster, textured, outside location 1044			C	Y						S0005ABC	Chrysotile	<0.5%	None	
Other	Window	Caulking, brown, outside location 1036			A	Y						S0007ABC	None Detected	N.D.	None	
Other	Window	Caulking, grey			A	Y						S0011ABC	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		33(7)			%	S0006ABC	Chrysotile	5-10%	Confirmed Asbestos	NF
Other	Window	Putty, black, outside locations 1007 and 1036			A	Y						S0008ABC	None Detected	N.D.	None	
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1001 : Child Minding
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4'. Small and Irregular Pinhole - Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige Marble			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation		C	N										
Wall		Masonry			A	Y		100								

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1002 : Men's Washroom
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4'. Small and Irregular Pinhole - Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y										
Piping		Fibreglass	Straight		C	N										
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1003 : Women's Washroom
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4'. Small and Irregular Pinhole - Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y										
Piping		Fibreglass	Straight		C	N										
Piping		Parging Cement			C	N		6(7)			EA	S0004A	Chrysotile	50-75%	Confirmed Asbestos	F
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1004 : Corridor
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4'. Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y										
Piping		Fibreglass	Straight		C	N										
Piping		Parging Cement			C	N		21(7)			EA	S0004B	Chrysotile	50-75%	Confirmed Asbestos	F
Wall		Drywall and joint compound			A	Y		100(7)			%	S0002C	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1005 : Storage
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2' x 4'. Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, 12"x 12". Dark Green with White Streak (previously sampled)			A	Y		100(7)			%	V9000	Confirmed Asbestos		Confirmed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1006 : Principal's Office
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4'. Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Light Grey Multi-fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Drywall and joint compound			A	Y		100(7)			%	V0002	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1007 : Office
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Light Grey Multi-fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Drywall and joint compound			A	Y		100(7)			%	V0002	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y		100			%	V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1008 : Computer Lab
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2x4, small and irregular pinholes. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Light Grey Multi-fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N						V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Drywall and joint compound			A	Y		100(7)			%	V0002	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1009 : VP Office
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Light Grey Multi-fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Piping		Fibreglass			C	N										
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1010 : Main Office
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Light Grey Multi-fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Piping		Fibreglass			C	N										
Wall		Drywall and joint compound			A	Y		100(7)			%	V0002	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1011 : Financial Analyst
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Light Grey Multi-fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass			C	N										
Wall		Drywall and joint compound			A	Y		100(7)			%	V0002	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1012 : Lunch Room
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Light Grey Multi-fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass			C	N										
Wall		Drywall and joint compound			A	Y		100(7)			%	V0002	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1013 : Stage
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Steel			A	Y										
Floor		Wood			A	Y										
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1014 : Gym
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Deck	Steel			A	Y										
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Tan Streak.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N										
Piping		Parging Cement			C	Y		15(7)			EA	V0004	Chrysotile	50-75%	Confirmed Asbestos	F
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1015 : Credit Office
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 1996.			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling		Drywall and joint compound			A	Y		100(7)			%	V0001	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Dark Grey with White Streak.			A	Y			1(7)		%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" White with Black Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V0002	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1017 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Tan Streak.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile and Mastic, 12"x 12". Dark Green with White Streak (previously sampled)			A	Y		100(7)			%	V9000	Confirmed Asbestos		Confirmed Asbestos	NF
Piping ¹		Cement Product			C	N		10(7)			LF	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Parging Cement			C	N		12(7)	4(7)		EA	S0004C	Chrysotile	50-75%	Confirmed Asbestos	F
Wall		Masonry			A	Y										

1 - In pipe chase

Client: Hamilton-Wentworth Catholic District Sch
Location: #1018 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 1996.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, 12"x 12". Dark Green with White Streak (previously sampled)			A	Y		100(7)			%	V9000	Confirmed Asbestos		Confirmed Asbestos	NF
Piping		Parging Cement	Fitting		C	N					EA	V0004	Chrysotile	50-75%	Confirmed Asbestos	F
Wall		Drywall and joint compound			A	Y		100(7)			%	S0002A	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1019 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 1996.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" White with Black Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Cement Product			C	N		10(7)			LF	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Parging Cement			C	N		6(7)			EA	V0004	Chrysotile	50-75%	Confirmed Asbestos	F
Wall	Column	Drywall and joint compound			A	Y		100(7)			%	S0001A	Chrysotile	0.5-5%	Confirmed Asbestos	NF

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1020 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 1996.			C	Y		100								
Floor		Vinyl Floor Tile and Mastic, 12"x 12". Dark Green with White Streak (previously sampled)			A	Y		100(7)			%	V9000	Confirmed Asbestos		Confirmed Asbestos	NF
Piping		Parging Cement			C	N		6(7)			EA	V0004	Chrysotile	50-75%	Confirmed Asbestos	F
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1021 : Sink Room
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y		100(7)			%	V0001	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Concrete (poured)			A	Y										
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1022 : Custodian Storage
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y		100(7)			%	V0001	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Masonry			A	Y										
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1023 : Storage/Mechanical
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y		100(7)			%	V0001	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Masonry			A	Y										
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1024 : Custodian Office
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, 12"x 12". Dark Green with White Streak (previously sampled)			A	Y		100(7)			%	V9000	Confirmed Asbestos		Confirmed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1025 : Staff Room
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige Marble.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1026 : Staff Womens Washroom
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y										
Piping		Fibreglass	Straight		C	N										
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1027 : YMCA
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Concrete (poured)			A	Y										
Piping		Fibreglass	Straight		C	N										
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1028 : Photo Copier
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			A	Y		100			%	V0000	Non-Asbestos		None	
Floor		Concrete (poured)			A	Y										
Other	Sink	Mastic, Gold, undercoating			A	N		1(7)			EA	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Drywall and joint compound			A	Y		100(7)			%	S0002B	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1029 : Science
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			A	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige Marble.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Drywall and joint compound			A	Y						V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1030 : English Room
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige Marble.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Drywall and joint compound			A	Y						V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1031 : English Room
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%					
Floor		Vinyl Floor Tile and Mastic, 12" x 12" beige marble			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Drywall and joint compound			A	Y						V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1032 : Business/Computer
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige Marble.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Drywall and joint compound			A	Y						V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										
Wall	Column	Drywall and joint compound, HWCDSB sample AGAT 19H455712			A	Y		100			%	V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1033 : Math
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige Marble.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Drywall and joint compound			A	Y						V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1034 : Math
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige Marble.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Drywall and joint compound			A	Y						V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1035 : English/Social Science
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige Marble			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						S0009C	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Drywall and joint compound			A	Y						V9500	Presumed Asbestos		Presumed Asbestos	NF

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1036 : LBS
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, 12" x 12" Beige marble			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Drywall and joint compound			A	Y						V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1037 : Kitchen
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Textured (previously sampled)			C	Y		100				V0000	Non-Asbestos		None	
Floor		Ceramic Tiles			A	Y										
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Ceramic Tiles			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1038 : Cafeteria B and Storage
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100				V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige Marble.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1039 : Cafeteria A
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, 12"x 12". Dark Green with White Streak (previously sampled)			A	Y		100(7)			%	V9000	Confirmed Asbestos		Confirmed Asbestos	NF
Other	Window	Caulking, white			A	Y						S0009A	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1040 : Chef Office
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige Marble.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Straight		C	N										
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1041 : Storage
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y		100(7)			%	S0001C	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Concrete (poured)			A	Y										
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1042 : Custodian
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			A	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Streak.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1043 : Stairwell
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y										
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1044 : Stairwell
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y										
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1045 : Stairwell
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y										
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1046 : Stairwell
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y										
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1047 : Storage/ Kitchen
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y		100(7)			%	S0001B	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile and Mastic, 12"x 12". Dark Green with White Streak (previously sampled)			A	Y		100(7)			%	V9000	Confirmed Asbestos		Confirmed Asbestos	NF
Other	Sink	Mastic, Black, undercoating			A	N		1(7)			EA	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1048 : Balcony
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Deck	Steel			A	Y										
Duct ¹		Textile			A	Y		1(7)				V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Concrete (poured)			A	Y										
Wall		Masonry			A	Y										

1 - Expansion joints - woven.

Client: Hamilton-Wentworth Catholic District Sch
Location: #1050 : Storage
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Concrete (poured)			A	Y										
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1051 : Storage
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Concrete (poured)			A	Y										
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1052 : Storage
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Concrete (poured)			A	Y										
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1053 : Corridor
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Concrete (poured)			A	Y										
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #1055 : Staff Mens Washroom
Survey Date: 2018-07-19

Site: Adult
Floor: 1

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small and Irregular Pinhole (date stamped 08/23/09)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2000 : Stairwell
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Black with White Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #2001 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 25
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100				V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										
Wall	Column	Drywall and joint compound, HWCDSB sample AGAT 19H455712			A	Y		100			%	V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2002 : Hallway
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #2003 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 24
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)				V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2004 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						S0009B	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		50(7)			%	S0010AB	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2005 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 22
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2006 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 21
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2007 : Stairwell
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Black with White Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #2008 : Corridor
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Black with White Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N						V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Concrete (poured)			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2009 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 11
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Grey/White Dense Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	S0010C	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100			%	S0003A	None Detected	N.D.	None	
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2010 : Corridor
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Duct		Fibreglass			C	N										
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Black with White Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y					%					

Client: Hamilton-Wentworth Catholic District Sch
Location: #2011 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 12
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Grey/White Dense Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100			%	S0003C	None Detected	N.D.	None	
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2012 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 13
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Grey/White Dense Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100			%	S0003B	None Detected	N.D.	None	
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #2013 : Men's Washroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Dark Grey with White Streak.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N										
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2014 : Custodian Room
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			A	Y		100(7)			%	V0001	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Concrete (poured)			A	Y										
Piping		Fibreglass			C	N										
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #2015 : Caretaker Closet
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, 12"x 12". Dark Green with White Streak (previously sampled)			A	Y		100(7)			%	V9000	Confirmed Asbestos		Confirmed Asbestos	NF
Wall		Concrete (poured)			A	Y										
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2016 : Corridor
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Dark Grey with White Streak.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #2017 : ESL Room
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: A
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Dark Grey with White Streak.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2018 : Copy Room
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #2019 : Spare Room
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2020 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 14
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			A	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										
Wall		Drywall (no compound)			A	Y		100			%					

Client: Hamilton-Wentworth Catholic District Sch
Location: #2021 : Corridor
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall (no compound)			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2022 : Office
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										
Wall		Drywall (no compound)			A	Y		100			%					

Client: Hamilton-Wentworth Catholic District Sch
Location: #2023 : Office
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2024 : Office
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Masonry			A	Y										
Wall		Drywall (no compound)			A	Y		100			%					

Client: Hamilton-Wentworth Catholic District Sch
Location: #2025 : Office
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Piping		Parging Cement	Fitting		C	N		2(7)			EA	V0004	Chrysotile	50-75%	Confirmed Asbestos	F
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2026 : Office
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			A	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2027 : Office
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2028 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 32
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Small and Irregular Pinhole. Date Stamped 08/23/09.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF

Client: Hamilton-Wentworth Catholic District Sch
Location: #2029 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 33
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white			A	Y						V0009	None Detected	N.D.	None	
Other	Window	Putty, grey			A	Y		100(7)			%	V0010	Chrysotile	5-10%	Confirmed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y		100			%					

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2030 : Stairwell
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: A
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			A	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #2031 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 17
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2032 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 16
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #2033 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 15
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2034 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 20
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall	Column	Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF

Client: Hamilton-Wentworth Catholic District Sch
Location: #2035 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 19
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2036 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 18
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #2037 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 26
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										
Wall	Column	Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2038 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 27
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										
Wall	Column	Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF

Client: Hamilton-Wentworth Catholic District Sch
Location: #2039 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 28

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2040 : Corridor
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										
Wall		Drywall (no compound)			A	Y		100			%					

Client: Hamilton-Wentworth Catholic District Sch
Location: #2041 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 31
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										
Wall		Drywall (no compound)			A	Y		100			%					

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2042 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #2043 : Classroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Beige with Brown Fleck			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2044 : Eyewash Station
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #: 2
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Short Fissure Random Pinhole. Date Stamped 2010.			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling		Ceiling Tiles (lay-in), Ceiling Tile 2' x 4' Long Fissure Random Pinhole.			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Concrete (poured)														
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #2045 : Womens Washroom
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, Vinyl Floor Tile 12"x 12" Dark Grey with White Streak.			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2046 : Spare Room
Survey Date: 2018-07-19

Site: Adult
Floor: 2

Building Name: St Charles - Mountain Campus
Room #:
Last Re-Assessment: 2022-06-28

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2' x 4' Long Fissure Random Pinhole (previously sampled)			C	Y		100			%	V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, 12" x 12" dark grey with white streaks			A	Y		100(7)			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y										

Legend:



Sample number		Units		Other	
S####	Asbestos sample collected	SF	Square feet	A	Access
V####	Material visually similar to numbered sample collected	LF	Linear feet	V	Visible
V0000	Known non-asbestos material	EA	Each	AP	Air Plenum
V9000	Visually identified as an asbestos material	%	Percentage	F	Friable material
V9500	Material is presumed to be an asbestos material			NF	Non Friable material
				PF	Potentially Friable material

Access	
A	Accessible to all building occupants
B	Accessible to maintenance and operations staff without a ladder
C	Accessible to maintenance and operations staff with a ladder. Also rarely entered, locked areas
D	Not normally accessible

Condition	
Good	No visible damage or deterioration
Fair	Minor, repairable damage, cracking, delamination or deterioration
Poor	Irreparable damage or deterioration with exposed and missing material

Visible	
Y	The material is visible when standing on the floor of the room, without the removal or opening of other building components (e.g. ceiling tiles or access panels).
N	The material is not visible to view when standing on the floor of the room and requires the removal of a building component (e.g. ceilings tiles or access panels) to view and access. Includes rarely entered crawlspaces, attic spaces, etc. Observations will be limited to the extent visible from the access points.

Air Plenum	
Yes or No	The material is in a return air plenum or in a direct airstream or there is evidence of air erosion (e.g. duct for heating or cooling blowing directly on or across an ACM). This field is only completed where Air Plenum consideration is required by regulation.

Colour Coding	
	The material is known to contain regulated concentrations of asbestos; either by analytical results or visible identification (use of the V9000 code).
	The material is presumed to contain asbestos; based on visual appearances; typically a material known to historically contain asbestos; however, not sampled due to limited access or the destructive nature of the sampling.

Action					
(1)	Clean up of ACM Debris	(2)	Precautions for Access Which may Disturb ACM Debris	(3)	ACM removal
(4)	Precautions for Work Which may Disturb ACM in Poor Condition	(5)	Proactive ACM removal (Minimum repair required for fair condition)	(6)	ACM repair
(7)	Management program and surveillance				

APPENDIX V
Drawings

ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND IS PRESENT ON WALL AND CEILING FINISHES THROUGHOUT THE BUILDING.

NOT ALL KNOWN OR SUSPECTED ASBESTOS BUILDING MATERIALS MAY BE DEPICTED ON THE DRAWING. REFER TO THE ASBESTOS ASSESSMENT REPORT FOR A COMPLETE LIST OF KNOWN AND SUSPECTED ASBESTOS BUILDING MATERIALS.

LEGEND IS COLOUR DEPENDENT. NON-COLOUR COPIES MAY ALTER INTERPRETATION.

BASE PLAN PROVIDED BY CLIENT.



905-577-6206 www.pinchin.com

LEGEND:

- (X) LOCATION NUMBER
- ◎ ASBESTOS BULK SAMPLE

ASBESTOS-CONTAINING MATERIALS:

- P PIPE INSULATION
- VINYL FLOOR TILES AND MASTIC
- S SINK UNDERCOATING
- VD VIBRATION DAMPER
- T TRANSITE

NOTE:

ASBESTOS-CONTAINING MATERIALS NOT HATCHED:
- DRYWALL JOINT COMPOUND ON WALLS AND CEILING
- WINDOW PUTTY SEALANT

CLIENT:



Hamilton-Wentworth
Catholic District School Board
Believing. Achieving. Serving

LOCATION:

ST. CHARLES MOUNTAIN
150 EAST 5TH STREET
HAMILTON, ONTARIO

TITLE:

ASBESTOS REASSESSMENT
FLOOR LEVEL 1

DATE:

AUGUST 2022

PROJECT # :

303992.004

DRAWN BY:

EB

CHECKED BY:


EB

SCALE:

NTS

DRAWING:

1 OF 2


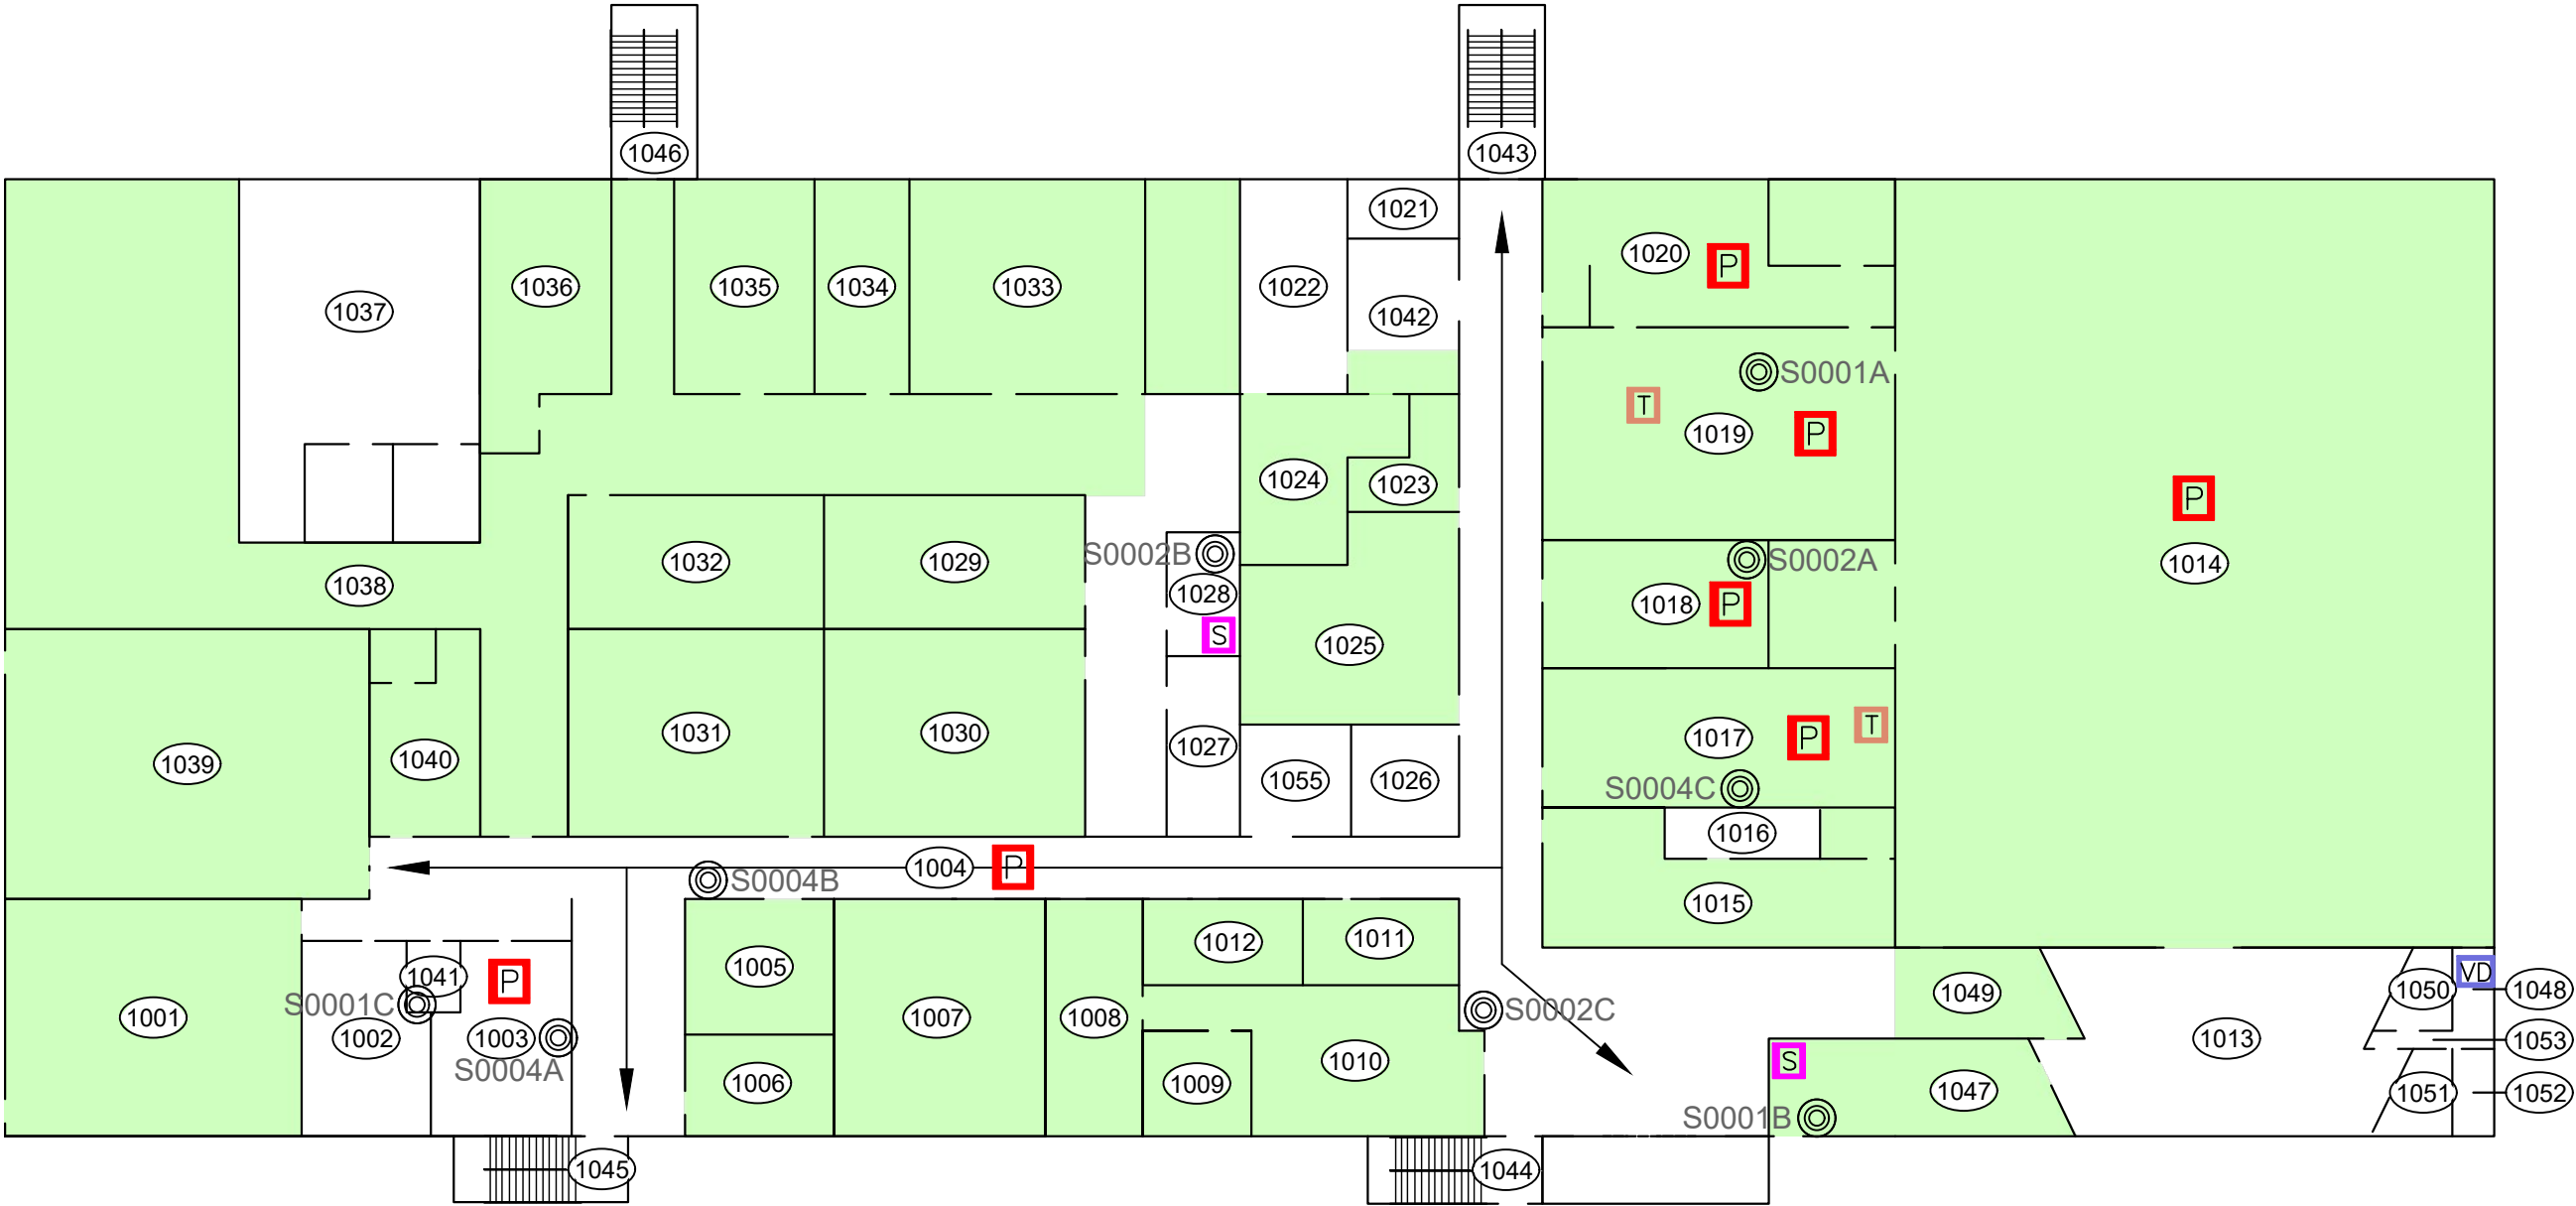


ASBESTOS-CONTAINING DRYWALL JOINT COMPOUND IS PRESENT ON WALL AND CEILING FINISHES THROUGHOUT THE BUILDING.

NOT ALL KNOWN OR SUSPECTED ASBESTOS BUILDING MATERIALS MAY BE DEPICTED ON THE DRAWING. REFER TO THE ASBESTOS ASSESSMENT REPORT FOR A COMPLETE LIST OF KNOWN AND SUSPECTED ASBESTOS BUILDING MATERIALS.

LEGEND IS COLOUR DEPENDENT. NON-COLOUR COPIES MAY ALTER INTERPRETATION.

BASE PLAN PROVIDED BY CLIENT.

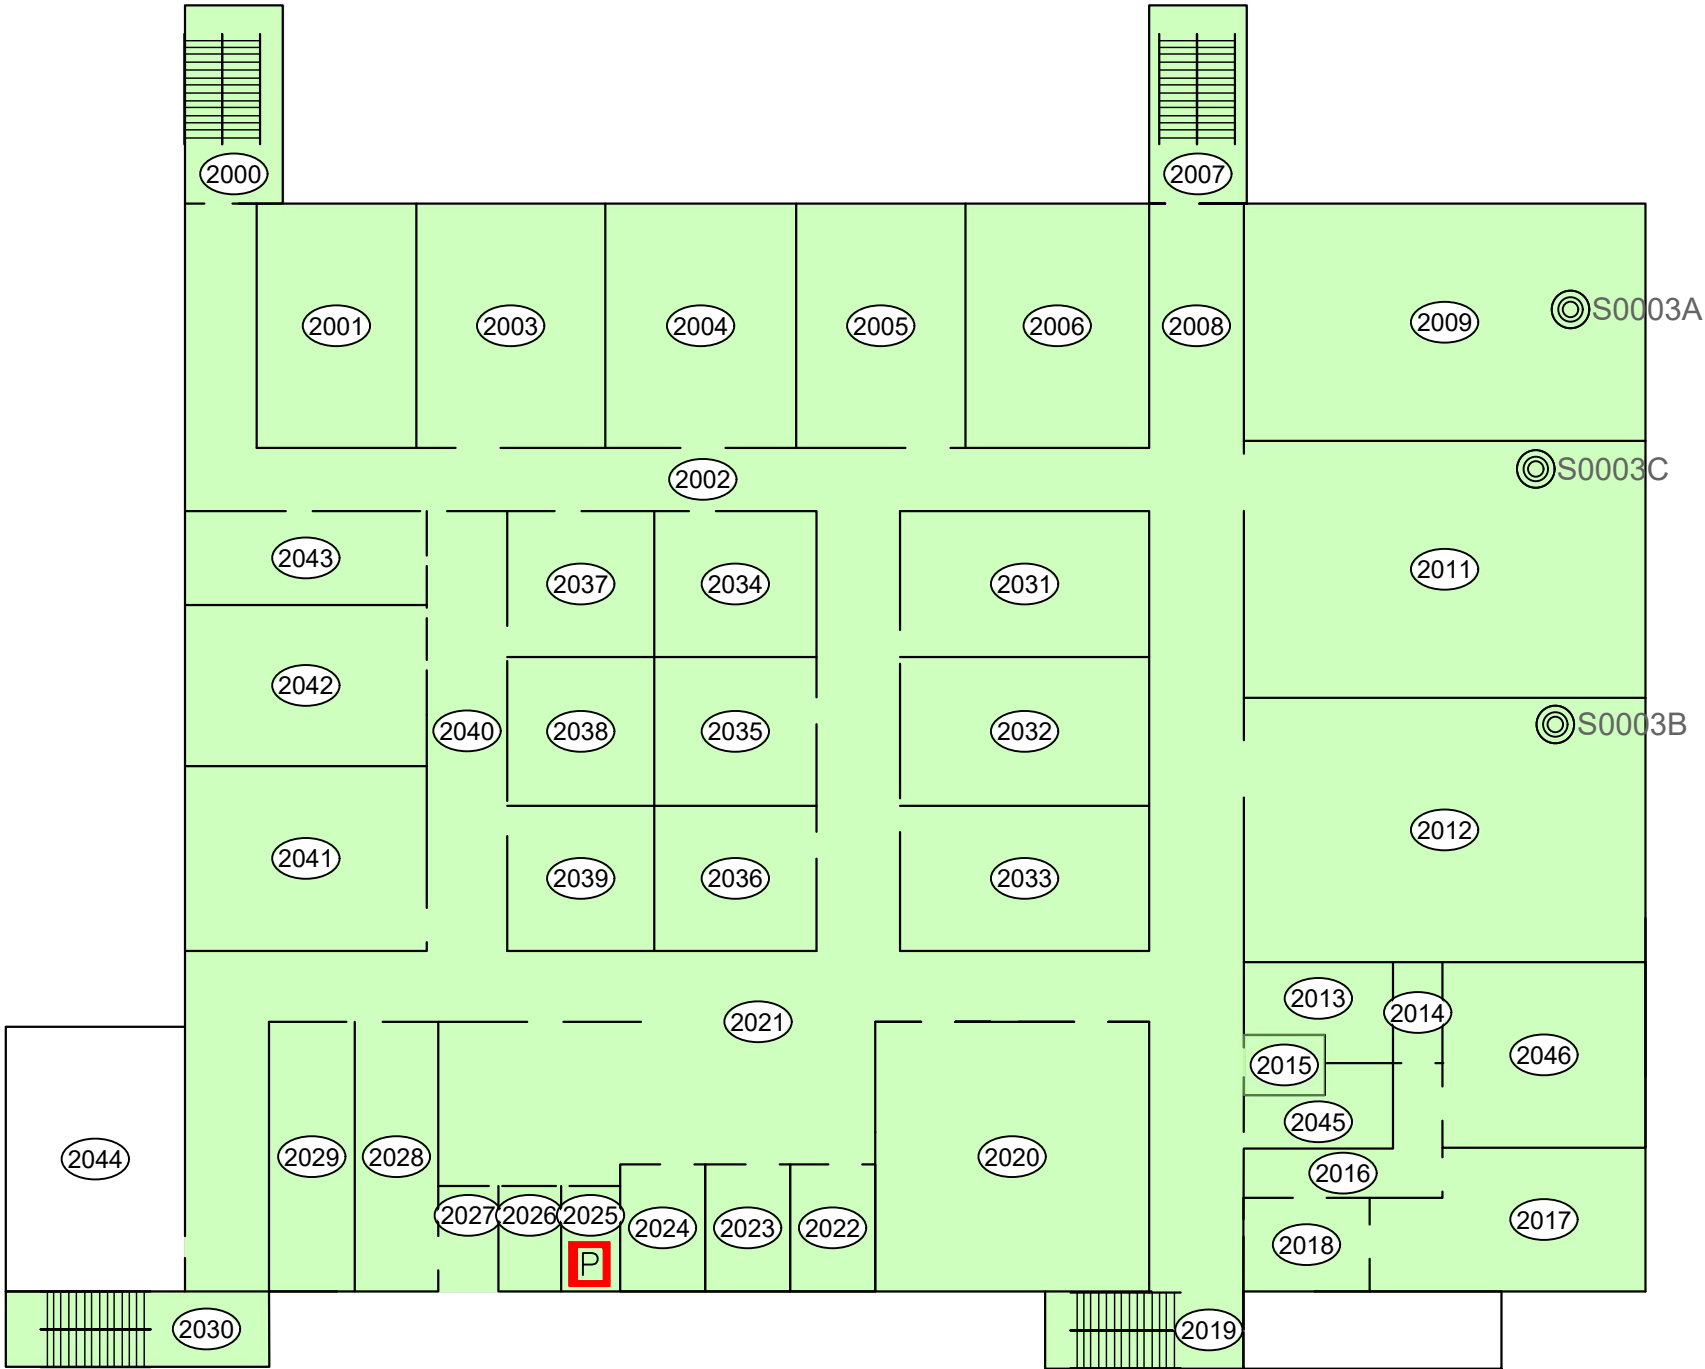

905-577-6206 www.pinchin.com

LEGEND:

- (X) LOCATION NUMBER
- ⊙ ASBESTOS BULK SAMPLE

ASBESTOS-CONTAINING MATERIALS:

- P PIPE INSULATION
- VINYL FLOOR TILES AND MASTIC
- S SINK UNDERCOATING
- VD VIBRATION DAMPER
- T TRANSITE

NOTE:

ASBESTOS-CONTAINING MATERIALS NOT HATCHED:
- DRYWALL JOINT COMPOUND ON WALLS AND CEILING
- WINDOW PUTTY SEALANT

CLIENT:



LOCATION:
ST. CHARLES MOUNTAIN
150 EAST 5TH STREET
HAMILTON, ONTARIO

TITLE:
ASBESTOS REASSESSMENT
FLOOR LEVEL 2

DATE: AUGUST 2022	PROJECT # : 303992.004
DRAWN BY: EB	DRAWING: 2 OF 2
CHECKED BY: EB	
SCALE: NTS	