



Asbestos Reassessment

St. Jean de Brebeuf
200 Acadia Drive, Hamilton,
Ontario

Prepared for:

**Hamilton-Wentworth Catholic
District School Board**

90 Mulberry Street
Hamilton, Ontario, L8N 3R9

August 30, 2022

Pinchin File: 303992.004



Asbestos Reassessment

St. Jean de Brebeuf, 200 Acadia Drive, Hamilton, Ontario
Hamilton-Wentworth Catholic District School Board

August 30, 2022
Pinchin File: 303992.004

Issued to: Hamilton-Wentworth Catholic District
School Board
Issued on: August 30, 2022
Pinchin File: 303992.004
Issuing Office: Hamilton, ON
Pinchin Contact: Emily Balfour, Project Manager
365.889.5147
ebalfour@pinchin.com



Author: _____
Emily Balfour
Project Manager
365.889.5147
ebalfour@pinchin.com

Reviewer: _____
Damian Palus, C.E.T.
Operations Manager
289.678.0694
dpalus@pinchin.com



EXECUTIVE SUMMARY

Hamilton-Wentworth Catholic District School Board (Client) retained Pinchin Ltd. (Pinchin) to conduct an asbestos building materials reassessment at the subject building.

The objective of the reassessment was to evaluate the condition and quantity of previously reported asbestos-containing materials (ACM), and develop corrective action plans as required for the purposes of long-term management. The results of this reassessment are not intended for construction, renovation, demolition or project tendering purposes.

Summary of Recommendations

The following is a summary of significant recommendations; refer to the body of the report for detailed recommendations:

- Perform a reassessment of asbestos materials on an annual basis.
- Perform a pre-construction assessment and remove all asbestos-containing materials (ACM) prior to alteration or maintenance work if ACM may be disturbed by the work.
- Follow appropriate safe work procedures when handling or disturbing asbestos.
- Sample any presumed ACM prior to alteration or maintenance work if presumed ACM may be disturbed by the work.

This Executive Summary is subject to the same standard limitations as contained in the report and must be read in conjunction with the entire report.



TABLE OF CONTENTS

1.0	INTRODUCTION AND SCOPE	1
2.0	BACKGROUND INFORMATION	1
2.1	Building Year of Construction	1
2.2	Existing Reports.....	1
3.0	FINDINGS	2
3.1	Excluded Asbestos Materials	2
3.2	Confirmed/Presumed Asbestos-Containing Materials and Confirmed Non-Asbestos Materials	3
4.0	RECOMMENDATIONS.....	12
4.1	General	12
4.2	Remedial Work	12
4.3	On-going Management and Maintenance	12
5.0	TERMS AND LIMITATIONS	12
6.0	REFERENCES.....	13

APPENDICES

APPENDIX I	Asbestos Analytical Certificates
APPENDIX II	Location List
APPENDIX III	Hazardous Materials Summary / Sample Log Report
APPENDIX IV	All Data Report
APPENDIX V	Drawings



1.0 INTRODUCTION AND SCOPE

Hamilton-Wentworth Catholic District School Board (Client) retained Pinchin Ltd. (Pinchin) to conduct an asbestos building materials reassessment at St. Jean de Brebeuf, located at 200 Acadia Drive, Hamilton, Ontario.

The reassessment was performed by Emily Balfour, Project Manager, on June 28, 2022 and Luke Thompson, Project Technologist, on July 11, 2022.

The objectives of the reassessment were to document the locations, quantities and conditions of previously identified asbestos-containing building materials and develop corrective action plans as required. This reassessment is only to be used for the purposes of long-term management and routine maintenance. The results of this reassessment are not to be used for construction, renovation, demolition or project tendering purposes.

The objective of the reassessment was to evaluate the condition and quantity of previously reported asbestos-containing materials (ACM's), and develop corrective action plans as required.

Additional objectives included sampling of presumed asbestos-containing ceiling finishes (i.e. texture finish).

Refer to the Asbestos Building Materials Reassessment Methodology report and Annex A dated 2022, Pinchin File 303992.004, for the methodology used during the reassessment.

2.0 BACKGROUND INFORMATION

2.1 Building Year of Construction and Additions

Item	Details
Year of Construction	1973
Year(s) of Additions	1999, 2017

2.2 Existing Reports

2.2.1 Review of Previous Reports

Pinchin previously prepared the following report, which has been reviewed and relied upon as part of this assessment:

- Asbestos Assessment, St. Jean de Brebeuf, 200 Acadia Drive, Hamilton, Ontario, September 2018, Prepared by Pinchin Ltd., Pinchin File: 224334.



Asbestos Reassessment

St. Jean de Brebeuf, 200 Acadia Drive, Hamilton, Ontario
Hamilton-Wentworth Catholic District School Board

August 30, 2022
Pinchin File: 303992.004

- Asbestos Reassessment, St. Jean de Brebeuf, 200 Acadia Drive, Hamilton, Ontario, September 2019, Prepared by Pinchin Ltd., Pinchin File: 243241.
- Asbestos Reassessment, St. Jean de Brebeuf, 200 Acadia Drive, Hamilton, Ontario, June 2020, Prepared by Pinchin Ltd., Pinchin File: 272113.
- Asbestos Reassessment, St. Jean de Brebeuf, 200 Acadia Drive, Hamilton, Ontario, June 2021, Prepared by Pinchin Ltd., Pinchin File: 286533.001.

3.0 FINDINGS

The following section summarizes the findings of the reassessment and provides a general description of the asbestos materials identified. For details on quantities, assessment, sample numbers, friability, condition, and locations of asbestos materials; refer to the Hazardous Materials Summary / Sample Log Report and All Data Report in Appendices III and IV, respectively.

Previous analytical sample results have been relied upon and were included in the original asbestos assessment report completed by MTE Consultants Inc. Additional samples results where collected by Pinchin have been included in Appendix I.

3.1 Excluded Asbestos Materials

A number of materials which might contain asbestos were not sampled during this reassessment due to limitations in scope and methodology. Where present, these materials are assumed to contain asbestos until otherwise proven by sampling and analysis. These materials are not shown on the drawings in Appendix V. Materials presumed to contain asbestos include:

Material	Friability
Roofing, felts and tar	Non-friable
Concrete floor levelling compound	Non-friable
Elevator and lift brakes	Non-friable
Electrical components or wiring within control centers, breakers, motors or lights, insulation on wiring	Non-friable
Moulded plastic components (laboratory bench tops)	Non-friable
Vermiculite in concrete block wall cavities	Friable
Adhesives and duct mastics	Non-friable
Caulking and butyl seals	Non-friable

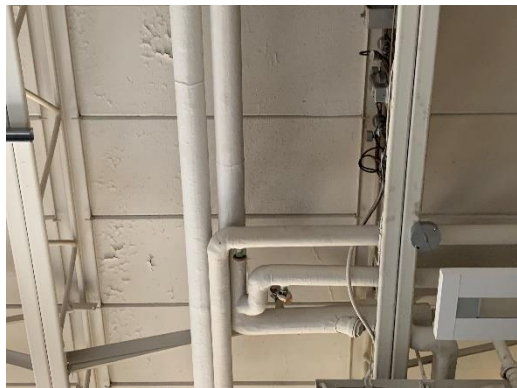


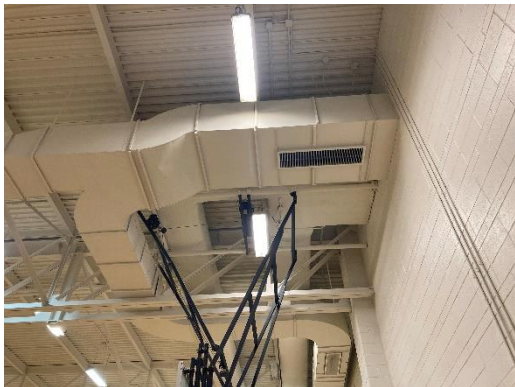
Material	Friability
Fibre reinforced paints and coatings	Non-friable
Paper products	Non-friable
Soffit and fascia boards	Non-friable
Mechanical packing, ropes and gaskets	Non-friable
Vinyl baseboards	Non-friable
Exterior cladding	Non-friable
Fire resistant doors or metal clad finishes	Non-friable
Stucco, plaster or other cementitious parge coatings	Potentially friable
Vibration dampers on HVAC equipment	Non-friable
Ceramic tile thin-set	Non-friable

3.2 Confirmed/Presumed Asbestos-Containing Materials and Confirmed Non-Asbestos Materials

This section includes materials that have been confirmed asbestos-containing by sample analysis or presumed asbestos-containing by visual identification. Refer to the drawings in Appendix V for the locations of confirmed and presumed ACMs indicated via hatching or symbols. The locations of samples from the historical assessments, performed by Pinchin, have been included on the drawings.

Material and Application	Asbestos Type/Friability	Photo
Non-asbestos containing fireproofing is present on structural steel including beams, trusses, joists, corrugated steel deck, concrete deck, columns.	None	

Material and Application	Asbestos Type/Friability	Photo
Texture finish is present on plaster ceilings in the Chapel (Location 1055) and plaster walls at the Catwalks (Location 2055). Texture finish is also present on soffits and columns at the former Main Entrance (Location 1037) and on the soffit in the Hallway (Location 1041). Overspray from the asbestos-containing texture coat is presumed to be present above the ceiling at light fixture openings, on the deck, ducts and within junction boxes.	Chrysotile/Friable	
Parging cement is present on pipe fittings (elbows, valves, tees, hangers etc.)	Chrysotile/Friable	
A white corrugated paper insulation (trade name Aircell), containing chrysotile asbestos, is present on straight sections of domestic water and heating system pipes.	Chrysotile/Friable	

Material and Application	Asbestos Type/Friability	Photo
Sweatwrap covered with parging cement, containing asbestos, over all seams and butt joints on the insulation, is present on straight sections of pipes.	Chrysotile/Friable	
Non-asbestos fibreglass insulation covered with tar paper, containing asbestos, is present on straight sections of pipes.	Chrysotile/Non-friable	
Remaining pipes are either uninsulated or insulated with non-asbestos fibreglass or elastomeric insulation (Armaflex).	None	
Non-asbestos tape is present on ducts.	None	
Ducts are presumed to be insulated with fiberglass and parging cement in the Gymnasium (Location 1100) but were not confirmed due to the elevated height of the material.	Presumed/Friable	
Remaining ducts are either uninsulated or insulated with non-asbestos fibreglass (foil-faced or canvas).	None	

**Asbestos Reassessment**

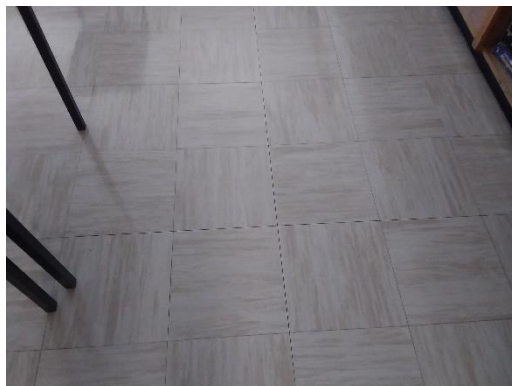
St. Jean de Brebeuf, 200 Acadia Drive, Hamilton, Ontario
Hamilton-Wentworth Catholic District School Board

August 30, 2022
Pinchin File: 303992.004

Material and Application	Asbestos Type/Friability	Photo
Mechanical equipment is either uninsulated or insulated with non-asbestos fibreglass.	None	
All ceiling tiles were determined to be non-asbestos by previous sampling or are presumed to be non-asbestos based on the date of manufacture determined from the date stamp applied to the top of the tiles or the age of the materials determined from the age of the building renovation.	None	
Smooth plaster present on walls and ceilings does not contain asbestos.	None	
Non-asbestos drywall joint compound is present on wall and ceiling finishes.	None	
Asbestos in drywall joint compound was banned in Canada in 1980. Drywall joint compound in the 2017 addition was installed after 1986 (1980 plus a reasonable non-compliance period based on our experience) and is assumed to contain no asbestos.	None	
Transite board is present behind electrical panels.	Presumed/Non-friable	
Transite pipe is present as rain water leaders.	Presumed/Non-friable	

Material and Application	Asbestos Type/Friability	Photo
Transite board is present in fume hoods and acid/base storage cabinets.	Presumed/Non-friable	
Vinyl sheet flooring, with a faux wood pattern is present.	Presumed/Potentially Friable (mastic)	
Vinyl floor tiles, 12"x12", beige with tan streak, are present.	Chrysotile/Non-friable (tile) Chrysotile/Non-friable (mastic)	

Material and Application	Asbestos Type/Friability	Photo
Vinyl floor tiles, 12"x12", blue dense fleck, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	
Vinyl floor tiles, 12"x12", red dense fleck, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	
Vinyl floor tiles, 12"x12", grey dense fleck, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	
Vinyl floor tiles, 12"x12", green dense fleck, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	

Material and Application	Asbestos Type/Friability	Photo
Vinyl floor tiles, 12"x12", evergreen dense fleck, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	
Vinyl floor tiles, 12"x12", beige with brown streak, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	
Vinyl floor tiles, 9"x9", beige with brown streak, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	

Material and Application	Asbestos Type/Friability	Photo
Vinyl floor tiles, 9"x9", white with multi-colour streak, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	
Vinyl floor tiles, 9"x9", brown with white streak, are present.	Presumed/Non-friable (tile) Presumed/Non-friable (mastic)	
Remaining vinyl floor tiles were determined to be non-asbestos by sample analysis or presumed to be non-asbestos based on historical knowledge of the date of installation. Mastic under new non-asbestos vinyl floor tiles that were not previously sampled are presumed to contain asbestos until further sampling can prove otherwise.	None (tile) Presumed/Non-friable (mastic)	

Material and Application	Asbestos Type/Friability	Photo
Foil faced heat shield paper is present in incandescent light fixtures.	Chrysotile/Friable	
Bakelite is present as sinks and countertops.	Presumed/Non-Friable	
Caulking, in various colours, is present throughout the exterior of the building around window frames, louvers, and expansion joints.	Chrysotile/Non-Friable	
Gold mastic is present as a sink undercoating.	Presumed/Non-Friable	



4.0 RECOMMENDATIONS

4.1 General

Perform a detailed intrusive assessment prior to building renovation or demolition operations. The assessment should include; destructive testing (i.e. coring and/or removal of building finishes and components), sampling of other hazardous materials (lead, mercury, PCBs, mould, etc.), and materials not tested in this study (i.e. excluded asbestos materials).

4.2 Remedial Work

No remedial work is recommended.

4.3 On-going Management and Maintenance

The following recommendations are made regarding on-going management and maintenance work involving the asbestos materials identified.

4.3.1 Asbestos

Maintain the Asbestos Management Program (AMP).

Perform a reassessment of asbestos materials on an annual basis.

Remove asbestos-containing materials (ACM) prior to alteration or maintenance work if ACM may be disturbed by the work. Follow appropriate asbestos precautions for the classification of work being performed.

Sample presumed ACM prior to alteration or maintenance work if the presumed ACM may be disturbed by the work.

Update the asbestos inventory report upon completion of any abatement and removal of asbestos-containing materials.

5.0 TERMS AND LIMITATIONS

This work was performed subject to the Terms and Limitations presented or referenced in the proposal for this project.

Information provided by Pinchin is intended for Client use only. Pinchin will not provide results or information to any party unless disclosure by Pinchin is required by law. Any use by a third party of reports or documents authored by Pinchin or any reliance by a third party on or decisions made by a third party based on the findings described in said documents, is the sole responsibility of such third parties. Pinchin accepts no responsibility for damages suffered by any third party as a result of decisions made or actions conducted. No other warranties are implied or expressed.



6.0 REFERENCES

The following legislation and documents were referenced in completing the assessment and this report:

1. Asbestos on Construction Projects and in Buildings and Repair Operations, Ontario Regulation 278/05.
2. Designated Substances, Ontario Regulation 490/09.

J:\303000s\0303992.000 HWCDSB,Various2022Projects,ASB,CONS\0303992.004 HWCDSB,AllFacilities,2022,ASB,REASSMT\Deliverables\Secondary\St. Jean de Brebeuf\Report\303992.004 St Jean de Brebeuf ACM Reassmnt Report HWCDSB Aug 30 2022.docx

Template: Master Report for Asbestos Reassessment, HAZ, April 23, 2019

APPENDIX I
Asbestos Analytical Certificates



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9
Project: 224334 St Jean de Brebeuf

Attn: Leslie Cantar

Lab Order ID: 51820602
Analysis ID: 51820602_PLM
Date Received: 8/13/2018
Date Reported: 8/22/2018

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
S0039A	Aircell, Loc: 1064, Transportation	5% Chrysotile	90% Cellulose	5% Other	Gray Fibrous Homogeneous
51820602PLM_1					Ashed, Teased
S0039B	Aircell, Loc: 1064, Transportation	Not Analyzed			
51820602PLM_2					
S0039C	Aircell, Loc: 1064, Transportation	Not Analyzed			
51820602PLM_3					
S0040A	24"x48" lay-in, random width-wise fissures, Loc: 1070, Studio T-153S	None Detected	50% Fiber Glass 30% Cellulose	10% Perlite 10% Other	White, Gray Fibrous Homogeneous
51820602PLM_4					Ashed, Teased
S0040B	24"x48" lay-in, random width-wise fissures, Loc: 1070, Studio T-153S	None Detected	50% Mineral Wool 30% Cellulose	10% Perlite 10% Other	White, Gray Fibrous Homogeneous
51820602PLM_5					Ashed, Teased
S0040C	24"x48" lay-in, random width-wise fissures, Loc: 1070, Studio T-153S	None Detected	50% Fiber Glass 30% Cellulose	10% Perlite 10% Other	White, Gray Fibrous Homogeneous
51820602PLM_6					Ashed, Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAL. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Bethany Nichols (6)

Analyst

Approved Signatory

51820602

Version 1-15-2012

Client:	Pinchin Ltd.	*Instructions: Use Column "B" for your contact info To See an Example Click the bottom Example Tab. 63 Begin Samples with a "<<" above the first sample and end with a ">>" below the last sample. Only Enter your data on the first sheet "Sheet1" Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.
Contact:	Leslie Cantar	
Address:	6-875 Main St W, Hamilton, ON	
Phone:	280.237.4294	
Fax:	905.577.6207	
Email:	lcantar@pinchin.com	
Project:	224334 St Jean de Brebeuf	
Client Notes:	Stop positive on all samples.	
P.O. #:	224334 (SJB)	
Date Submitted:	08-09-2018	
Analysis:	PLM BULK EPA 600	
TurnAroundTime:	6+ days	

 Scientific
 Analytical
 Institute

 4604 Dundas Dr.
 Greensboro, NC 27407
 Phone: 336.292.3888
 Fax: 336.292.3313
 Email: lab@sailab.com

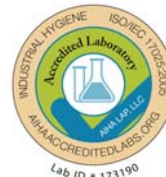
Sample Number	Data 1 (Lab use only)	Sample Description	Data 2 (Lab use only)
<<			
S0039A		Aircell, Loc:1064, Transportation	
S0039B		Aircell, Loc:1064, Transportation	
S0039C		Aircell, Loc:1064, Transportation	
S0040A		24"x48" lay-in, random width-wise fissures, Loc:1070, Studio T-153S	
S0040B		24"x48" lay-in, random width-wise fissures, Loc:1070, Studio T-153S	
S0040C		24"x48" lay-in, random width-wise fissures, Loc:1070, Studio T-153S	
>>			

Accepted ☒Rejected ☐
 K. Havelin
 8/13/18
 10:30am



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Stephen Holmquist
Leslie Cantar

Project: 243241.004,200 Acadia Drive, Hamilton, Ontario, Hamilton-Wentworth Catholic
District School Board, St. Jean de Brebeuf

Lab Order ID: 71915215
Analysis ID: 71915215_PLM
Date Received: 6/7/2019
Date Reported: 6/12/2019
Date Amended: 6/12/2019

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
0041A	Caulking on panels below window, grey, exterior	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_1					Dissolved
0041B	Caulking on panels below window, grey, exterior	1% Chrysotile		99% Other	Gray, Black Non Fibrous Heterogeneous
71915215PLM_2					Dissolved
0041C	Caulking on panels below window, grey, exterior	Not Analyzed			
71915215PLM_3					
0042A - A	Plaster ceiling, Location 1004	5% Chrysotile		95% Other	White Fibrous Heterogeneous
71915215PLM_4	insulation - small sample				Teased
0042A - B	Plaster ceiling, Location 1004	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_32	finish				Crushed
0042A - C	Plaster ceiling, Location 1004	< 0.5% Libby Amphibole		100% Other	Tan Non Fibrous Heterogeneous
71915215PLM_33	base				Crushed
0042B - A	Plaster ceiling, Location 1001	None Detected		100% Other	White Non Fibrous Homogeneous
71915215PLM_5	finish				Crushed
0042B - B	Plaster ceiling, Location 1001	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_34	base				Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (39)

Analyst

Approved Signatory



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Stephen Holmquist
Leslie Cantar

Project: 243241.004,200 Acadia Drive, Hamilton, Ontario, Hamilton-Wentworth Catholic
District School Board, St. Jean de Brebeuf

Lab Order ID: 71915215
Analysis ID: 71915215_PLM
Date Received: 6/7/2019
Date Reported: 6/12/2019
Date Amended: 6/12/2019

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
0042C - A	Plaster ceiling, Location 1025	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_6	finish				Crushed
0042C - B	Plaster ceiling, Location 1025	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_35	base				Crushed
0042D - A	Plaster ceiling, Location 1023	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_7	finish				Crushed
0042D - B	Plaster ceiling, Location 1023	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_36	base				Crushed
0042E - A	Plaster ceiling, Location 2012	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_8	finish				Crushed
0042E - B	Plaster ceiling, Location 2012	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_38	base				Crushed
0042F - A	Plaster ceiling, Location 2001	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_9	finish				Crushed
0042F - B	Plaster ceiling, Location 2001	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_39	base				Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (39)

Analyst

Approved Signatory



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Stephen Holmquist
Leslie Cantar

Project: 243241.004,200 Acadia Drive, Hamilton, Ontario, Hamilton-Wentworth Catholic
District School Board, St. Jean de Brebeuf

Lab Order ID: 71915215
Analysis ID: 71915215_PLM
Date Received: 6/7/2019
Date Reported: 6/12/2019
Date Amended: 6/12/2019

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
0042G - A	Plaster ceiling, Location 2043	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_10	finish				Crushed
0042G - B	Plaster ceiling, Location 2043	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_37	base				Crushed
0043A	Caulking around window, white, Location 1002	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_11					Dissolved
0043B	Caulking around window, white, Location 1002	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_12					Dissolved
0043C	Caulking around window, white, Location 1002	None Detected		100% Other	White Non Fibrous Heterogeneous
71915215PLM_13					Dissolved
0044A	Caulking on expansion joints, white, courtyard	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_14					Dissolved
0044B	Caulking on expansion joints, white, courtyard	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_15					Dissolved
0044C	Caulking on expansion joints, white, courtyard	1% Chrysotile		99% Other	Gray Non Fibrous Heterogeneous
71915215PLM_16					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (39)

Analyst

Approved Signatory



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Stephen Holmquist
Leslie Cantar

Project: 243241.004,200 Acadia Drive, Hamilton, Ontario, Hamilton-Wentworth Catholic
District School Board, St. Jean de Brebeuf

Lab Order ID: 71915215
Analysis ID: 71915215_PLM
Date Received: 6/7/2019
Date Reported: 6/12/2019
Date Amended: 6/12/2019

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
0045A	Caulking within window frame, off-white, courtyard	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_17					Dissolved
0045B	Caulking within window frame, off-white, courtyard	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_18					Dissolved
0045C	Caulking within window frame, off-white, courtyard	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71915215PLM_19					Dissolved
0046A	Caulking around louvers, black/grey, courtyard	2% Chrysotile		98% Other	Black, Gray Non Fibrous Heterogeneous
71915215PLM_20					Dissolved
0046B	Caulking around louvers, black/grey, courtyard	Not Analyzed			
71915215PLM_21					
0046C	Caulking around louvers, black/grey, courtyard	Not Analyzed			
71915215PLM_22					
0047A	Puck mastic, brown, Location 1023	None Detected		100% Other	Brown Non Fibrous Heterogeneous
71915215PLM_23					Dissolved
0047B	Puck mastic, brown, Location 1023	None Detected		100% Other	Brown Non Fibrous Heterogeneous
71915215PLM_24					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (39)

Analyst

Approved Signatory



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Stephen Holmquist
Leslie Cantar

Project: 243241.004,200 Acadia Drive, Hamilton, Ontario, Hamilton-Wentworth Catholic
District School Board, St. Jean de Brebeuf

Lab Order ID: 71915215
Analysis ID: 71915215_PLM
Date Received: 6/7/2019
Date Reported: 6/12/2019
Date Amended: 6/12/2019

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
0047C	Puck mastic, brown, Location 1023	None Detected		100% Other	Brown Non Fibrous Heterogeneous
71915215PLM_25					Dissolved
0048A	Caulking on window sill, grey, exterior of Location 2010	3% Chrysotile		97% Other	Gray Non Fibrous Heterogeneous
71915215PLM_26					Dissolved
0048B	Caulking on window sill, grey, exterior of Location 2010	Not Analyzed			
71915215PLM_27					
0048C	Caulking on window sill, grey, exterior of Location 2010	Not Analyzed			
71915215PLM_28					
0049A	Caulking at window frame, grey, exterior	3% Chrysotile		97% Other	Gray Non Fibrous Heterogeneous
71915215PLM_29					Dissolved
0049B	Caulking at window frame, grey, exterior	Not Analyzed			
71915215PLM_30					
0049C	Caulking at window frame, grey, exterior	Not Analyzed			
71915215PLM_31					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (39)

Analyst

Approved Signatory

7/19/15

Version 1-15-2012

Client:	Pinchin Ltd.	*Instructions: Use Column "B" for your contact info To See an Example Click the bottom Example Tab. Enter samples between "<<" and ">>" Begin Samples with a "<<" above the first sample and end with a ">>" below the last sample. Only Enter your data on the first sheet "Sheet1" Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included In the electronic data returned to you to facilitate your reintegration of the report data.	Invoice to:
Contact:	Stephen Holmquist		ap@pinchin.com
Address:	875 Main Street W., Unit 11 Hamilton, ON L8S 4R9		 Scientific Analytical Institute 4604 Dundas Dr. Greensboro, NC 27407 Phone: 336.292.3888 Fax: 336.292.3313 Email: lab@sailab.com
Phone:	905-577-6206		
Fax:	905-577-6207		
Email:	sholmquist@pinchin.com lcantar@pinchin.com		
Project:	243241.004,200 Acadia Drive, Hamilton, Ontario, Hamilton-Wentworth Catholic District School Board, St. Jean de Brebeuf		
Client Notes:			
P.O. #:	243241.004		
Date Submitted:	June 6, 2019		
Analysis:	PLM - Stop Positive except 0042A-G		
TurnAroundTime:	4days		

Sample Number	Data 1 (Lab use only)	Sample Description	Data 2 (Lab use only)
---------------	-----------------------	--------------------	-----------------------

<<

0041A		Caulking on panels below window, grey, exterior
0041B		Caulking on panels below window, grey, exterior
0041C		Caulking on panels below window, grey, exterior
0042A		Plaster ceiling, Location 1004
0042B		Plaster ceiling, Location 1001
0042C		Plaster ceiling, Location 1025
0042D		Plaster ceiling, Location 1023
0042E		Plaster ceiling, Location 2012
0042F		Plaster ceiling, Location 2001
0042G		Plaster ceiling, Location 2043
0043A		Caulking around window, white, Location 1002
0043B		Caulking around window, white, Location 1002

Accepted ☒Rejected ☐

Bohler

6/7
1030 P

71915215

0043C	Caulking around window, white, Location 1002
0044A	Caulking on expansion joints, white, courtyard
0044B	Caulking on expansion joints, white, courtyard
0044C	Caulking on expansion joints, white, courtyard
0045A	Caulking within window frame, off-white, courtyard
0045B	Caulking within window frame, off-white, courtyard
0045C	Caulking within window frame, off-white, courtyard
0046A	Caulking around louvers, black/grey, courtyard
0046B	Caulking around louvers, black/grey, courtyard
0046C	Caulking around louvers, black/grey, courtyard
0047A	Puck mastic, brown, Location 1023
0047B	Puck mastic, brown, Location 1023
0047C	Puck mastic, brown, Location 1023
0048A	Caulking on window sill, grey, exterior of Location 2010
0048B	Caulking on window sill, grey, exterior of Location 2010
0048C	Caulking on window sill, grey, exterior of Location 2010
0049A	Caulking at window frame, grey, exterior
0049B	Caulking at window frame, grey, exterior
0049C	Caulking at window frame, grey, exterior
>>	



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Emily Balfour
Michael Maiorana

Lab Order ID: 71919573
Analysis ID: 71919573_PLM
Date Received: 7/25/2019
Date Reported: 7/30/2019
Date Amended: 8/21/2019

Project: 230748,200 Acadia Drive, Hamilton, Ontario, Hamilton-Wentworth Catholic School Board, St. Jean de Brebeuf

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
S0050A	Texture coat on soffit, Hallway, Location 1041	2% Chrysotile		98% Other	White Non Fibrous Heterogeneous
71919573PLM_1					Crushed
S0050B	Texture coat on soffit, Hallway, Location 1041	Not Analyzed			
71919573PLM_2					
S0050C	Texture coat on soffit, Hallway, Location 1041	Not Analyzed			
71919573PLM_3					
S0051A	Mastic, Hallway, Location 2029	3% Chrysotile		97% Other	Black Non Fibrous Heterogeneous
71919573PLM_4					Dissolved
S0051A		Not Analyzed			
71919573PLM_5	duplicate sample number				
S0051B	Mastic, Hallway, Location 2027	Not Analyzed			
71919573PLM_6					
S0051C	Mastic, Hallway, Location 2026	Not Analyzed			
71919573PLM_7					

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAL. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Bart Huber (7)

Analyst

Approved Signatory

71919573
Revised

Version 1-15-2012

Client: Contact: Address: Phone: Fax: Email: Project: Client Notes: P.O. #. Date Submitted: Analysis: TurnAroundTime:	Pinchin Ltd. Emily Balfour 6-875 Main Street West, Suite 200, Hamilton ON L8S 4P9 905-577-6206 905-577-6207 ebalfour@pinchin.com mmajorana@pinchin.com 230748, 200 Acadia Drive, Hamilton, Ontario, Hamilton-Wentworth Catholic School Board, St. Jean de Brebeuf 230748 July 24, 2019 PLM - Stop Positive 4days	*Instructions: <i>Use Column "B" for your contact info</i> <i>To See an Example Click the bottom Example Tab.</i> Enter samples between "<<" and ">>" Begin Samples with a "<<" above the first sample and end with a ">>" below the last sample. Only Enter your data on the first sheet "Sheet1" <i>Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.</i>	Invoice to: ap@pinchin.com  Scientific Analytical Institute 4604 Dundas Dr. Greensboro, NC 27407 Phone: 336.292.3888 Fax: 336.292.3313 Email: lab@sailab.com
--	--	--	--

Sample Number	Data 1 (Lab use only)	Sample Description	Data 2 (Lab use only)
---------------	-----------------------	--------------------	-----------------------

<<			
S0050A		Texture coat on soffit, Hallway, Location 1041	
S0050A		Texture coat on soffit, Hallway, Location 1041	
S0050A		Texture coat on soffit, Hallway, Location 1041	
S0051A		Mastic, Hallway, Location 2029	
S0051B		Mastic, Hallway, Location 2027	
S0051C		Mastic, Hallway, Location 2026	
>>			

Accepted



Rejected



J. Amund 8.21
10:30A

APPENDIX II
Location List

Client: Hamilton-Wentworth Catholic District Sch
Building Name: St Jean de Brebeuf
Survey Date: 2018-08-03

Site: 200 Acadia Drive, Hamilton, ON
Last Re-Assessment: 2022-07-11

Location No.	Name or Description	Area ft ²	Floor No.	Bldg. Phase	Notes
1	General	0	1	A	
1000	Classroom 119, room no. 119	0	1	A	
1001	Classroom 117, room no. 117	0	1	A	
1002	Classroom 115A, room no. 115A	0	1	A	
1003	Co-op Office, room no. 115B	0	1	A	
1004	Office, room no. 113A	0	1	A	
1005	Classroom 113, room no. 113	0	1	A	
1006	Stairwell	0	1	A	
1007	Amalgamated into Loc 1010	0	1	A	
1008	Amalgamated into Loc 1010	0	1	A	
1009	Amalgamated into Loc 1010	0	1	A	
1010	Student Services, room no. 109	0	1	A	
1011	Hallway	0	1	A	
1012	Hallway	0	1	A	
1013	Hallway	0	1	A	
1014	Stairwell	0	1	A	
1015	Classroom 113, room no. 113	0	1	A	
1016	Classroom 112, room no. 112	0	1	A	
1017	Classroom 114, room no. 114	0	1	A	
1018	Girls Washroom, room no. 116	0	1	A	
1019	Boys Washroom, room no. 118	0	1	A	
1020	Classroom 120, room no. 120	0	1	A	
1021	Classroom 122, room no. 122	0	1	A	
1022	Classroom 124, room no. 124	0	1	A	
1023	Classroom 126, room no. 126	0	1	A	
1024	Classroom 121, room no. 121	0	1	A	
1025	Classroom 121A, room no. 121A	0	1	A	
1026	Classroom 123, room no. 123	0	1	A	
1027	Resource/Spec. Ed, room no. 125/127	0	1	A	
1028	Spec. Education Washroom, room no. 127	0	1	A	
1029	Boys Washroom	0	1	A	
1030	Custodial Closet	0	1	A	
1031	Girls Washroom, room no. 132	0	1	A	
1032	Mens Staff Washroom	0	1	A	
1033	Staff Lounge	0	1	A	
1034	Photocopy Supply Room	0	1	A	
1035	Womens Staff Washroom	0	1	A	
1036	Photocopy Room	0	1	A	
1037	Amalgamated into Loc 1010	0	1	A	
1038	Amalgamated into Loc 1010	0	1	A	
1039	Amalgamated into Loc 1010	0	1	A	
1040	Stairwell	0	1	A	
1041	Hallway	0	1	A	
1042	Library	0	1	A	
1043	Hallway	0	1	A	
1044	Hallway	0	1	A	
1045	Cafeteria	0	1	A	
1046	Kitchen	0	1	A	
1047	Math Department	0	1	A	
1048	Stairwell	0	1	A	
1049	Classroom 131, room no. 131	0	1	A	
1050	Hallway	0	1	A	
1051	Hallway	0	1	A	
1052	Hallway	0	1	A	
1053	Woodworking Washroom	0	1	A	
1054	Custodial Closet	0	1	A	
1055	Chapel	0	1	A	
1056	Chapel Office	0	1	A	
1057	Classroom T-152, room no. T-	0	1	A	

Location No.	Name or Description	Area ft ²	Floor No.	Bldg. Phase	Notes
	152				
1058	Classroom T-154, room no. T-154	0	1	A	
1059	Boiler Room, room no. T-156	0	1	A	
1060	Boiler Room Lockers	0	1	A	
1061	Boiler Room Tool Room	0	1	A	
1062	Boiler Room Washroom	0	1	A	
1063	Woodworking, room no. T-160	0	1	A	
1064	Transportation Services	0	1	A	
1065	Art T-149B, room no. T-149B	0	1	A	
1066	Art T-149A, room no. T-149A	0	1	A	
1067	Tech Services T-157B, room no. T-157B	0	1	A	
1068	Tech Services T-157A, room no. T-157A	0	1	A	
1069	Manufacturing, room no. T-155	0	1	A	
1070	Studio, room no. T-153S	0	1	A	
1071	Computer Lab, room no. T-153G	0	1	A	
1072	Computer Engineering, room no. T-151	0	1	A	
1073	Hallway	0	1	A	
1074	Hallway	0	1	A	
1075	Vestibule	0	1	A	
1076	Front Foyer	0	1	A	
1077	Stairs	0	1	A	
1078	Auditorium	0	1	A	
1079	Stage	0	1	A	
1080	Auditorium Hallway	0	1	A	
1081	Stage Hallway	0	1	A	
1082	Auditorium Washroom	0	1	A	
1083	Kilters Room	0	1	A	
1084	Co-Inst. Office	0	1	A	
1085	Boys Washroom	0	1	A	
1086	Girls Washroom	0	1	A	
1087	Mens Locker Room	0	1	A	
1088	Phys Ed. Department	0	1	A	
1089	Fitness Centre	0	1	A	
1090	Music Room	0	1	A	
1091	Gym Storage	0	1	A	
1092	Gym Storage	0	1	A	
1093	Gym Storage	0	1	A	
1094	Gym Storage Corridor	0	1	A	
1095	Gym Storage	0	1	A	
1096	Gym Storage	0	1	A	
1097	Gym Storage	0	1	A	
1098	Gym Storage	0	1	A	
1099	Gym Storage	0	1	A	
1100	Gym	0	1	A	
1101	Hallway to Gym	0	1	A	
1102	Hallway Foyer	0	1	A	
1103	Staff Locker Room	0	1	A	
1104	Hallway to Gym	0	1	A	
1105	Womens Locker Room	0	1	A	
1106	Custodial Closet	0	1	A	
1107	Womens Locker Room	0	1	A	
1108	Custodial Closet, room no. 116B	0	1	A	
1109	Custodial Closet	0	1	A	
1110	Storage	0	1	A	
1111	Boiler Room Lunchroom	0	1	A	
1112	Gym Storage	0	1	A	
1113	Hallway to Gym	0	1	A	
1114	Storage	0	1	A	
1115	Storage by Stage	0	1	A	
1116	2018 Addition	0	1	A	
2000	French Classroom 219, room	0	2	A	

Location No.	Name or Description	Area ft ²	Floor No.	Bldg. Phase	Notes
	no. 219				
2001	French Classroom 217, room no. 217	0	2	A	
2002	English Office 215, room no. 215	0	2	A	
2003	Storage	0	2	A	
2004	Science Classroom 213, room no. 213	0	2	A	
2005	Stairwell	0	2	A	
2006	English Classroom 211, room no. 211	0	2	A	
2007	Science Classroom 209, room no. 209	0	2	A	
2008	Storage, room no. 208	0	2	A	
2009	Science Classroom 207, room no. 207	0	2	A	
2010	Science Classroom 205, room no. 205	0	2	A	
2011	Science Classroom 203, room no. 203	0	2	A	
2012	Classroom 201, room no. 201	0	2	A	
2013	Stairwell	0	2	A	
2014	Classroom 240, room no. 240	0	2	A	
2015	Classroom 237, room no. 237	0	2	A	
2016	Classroom 235, room no. 235	0	2	A	
2017	Classroom 233, room no. 233	0	2	A	
2018	Stairwell	0	2	A	
2019	History Classroom 231, room no. 231	0	2	A	
2020	Math Classroom 229, room no. 229	0	2	A	
2021	Math Classroom 227, room no. 227	0	2	A	
2022	Math Classroom 225, room no. 225	0	2	A	
2023	Family Studies 223, room no. 223	0	2	A	
2024	Family Studies 221, room no. 221	0	2	A	
2025	Stairwell	0	2	A	
2026	Hallway	0	2	A	
2027	Hallway	0	2	A	
2028	Hallway	0	2	A	
2029	Hallway	0	2	A	
2030	English Classroom 210, room no. 210	0	2	A	
2031	English Classroom 212, room no. 212	0	2	A	
2032	English Classroom 214, room no. 214	0	2	A	
2033	Girls Washroom	0	2	A	
2034	Boys Washroom	0	2	A	
2035	French Classroom 220, room no. 220	0	2	A	
2036	French Classroom 222, room no. 222	0	2	A	
2037	Math Classroom 224, room no. 224	0	2	A	
2038	Math Classroom 226, room no. 226	0	2	A	
2039	Boys Washroom	0	2	A	
2040	Custodial Closet	0	2	A	
2041	Girls Washroom	0	2	A	
2042	Storage	0	2	A	
2043	Science Classroom 234, room no. 234	0	2	A	
2044	History Classroom 236, room no. 236	0	2	A	
2045	Storage	0	2	A	

Location No.	Name or Description	Area ft ²	Floor No.	Bldg. Phase	Notes
2046	Foyer	0	2	A	
2047	Storage	0	2	A	
2048	Stairwell	0	2	A	
2049	Dance Studio 200A, room no. 200A	0	2	A	
2050	Health Sciences 200B, room no. 200B	0	2	A	
2051	Stairwell	0	2	A	
2052	Fan Room	0	2	A	
2053	Custodial Closet	0	2	A	
2054	Science Storage	0	2	A	
2055	Catwalk	0	2	A	

APPENDIX III

Hazardous Materials Summary / Sample Log Report

Client: Hamilton-Wentworth Catholic District Sch

Site: 200 Acadia Drive, Hamilton, ON

Building Name: St Jean de Brebeuf

Survey Date: 2018-08-03

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
Asbestos	S0001 A	Structure Beam, Deck Fireproofing (cementitious) Amec-1 (12-feb-09)	2052	A	0	0	0	0	None Detected	No	
Asbestos	S0002 A	Duct Parging Cement Amec-2 (12-feb-09)	2052	A	0	0	0	0	None Detected	No	
Asbestos	S0003 A	Other Electrical Panel Cement Product Amec-3 (12-feb-09)	2052	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0004 A	Wall Fibreglass Amec-4 (12-feb-09)	2052	A	0	0	0	0	None Detected	No	
Asbestos	S0005 AB	Piping Parging Cement Amec-5 (12-feb-09) - Canvas Wrapped Parging With Tar Paper And Cellulose (sweatwrap & Parging)	1025,2051	A	30	0	0	0	Chrysotile	Yes	F
Asbestos	S0006 ABCDEF	Ceiling, Wall, Ceiling, Wall Bulkhead Drywall And Joint Compound Amec-6 (12-feb-09)	1002,1003,1004,1005,1010,1034,1036,1042,1045,1050,1051,1052,1053,1055,1058,1059,1063,1064,1067,1068,1070,1071,1072,1082,1084,1094,1105,2004,2017,2049,2050,2051,2055	A	0	0	0	100	None Detected	No	
Asbestos	S0007 ABCDEG	Ceiling, Structure, Wall Plaster Amec-7 (12-feb-09)	1000,1003,1006,1014,1015,1016,1017,1018,1019,1020,1021,1022,1027,1029,1030,1031,1033,1034,1035,1036,1040,1045,1046,1048,1049,1054,1055,1057,1058,1060,1061,1062,1063,1064,1075,1077,1080,1081,1083,1085,1086,1087,1090,1091,1092,1093,1094,1095,1097,1098,1099,1103,1106,1107,1108,1109,1110,1111,1112,1114,1115,2000,2002,2003,2004,2005,2006,2007,2008,2009,2010,2011,2013,2014,2015,2016,2017,2018,2019,2020,2021,2022,2023,2024,2025,2030,2031,2032,2033,2034,2035,2036,2037,2038,2039,2040,2041,2042,2044,2045,2046,2047,2048,2051,2053,2054	A	0	0	0	100	None Detected	No	
Asbestos	S0008 AD	Structure Fireproofing (cementitious) Amec-8 (12-feb-09)	1027,1028,1079,1087,1104,1105,1107,1112,1113	A	0	0	0	0	None Detected	No	
Asbestos	S0009 ABC	Ceiling Acoustic Tile Ceiling Tiles (lay-in) Amec-9 (12-feb-09)	1002,1003,1027,1028,1073,1074,1087,1088,1100,1101,1103,1104,1105,1107,1112,1113,2014,2015,2016,2017,2049,2050,2055	A	0	0	0	0	None Detected	No	
Asbestos	S0010 ABC	Ceiling Acoustic Tile Ceiling Tiles (lay-in) Amec-10 (12-feb-09)	1005,1043,1044,1050,1051,1052,1073,1074,1087,1090,2026,2027,2028,2029	A	0	0	0	0	None Detected	No	
Asbestos	S0011 ABC	Ceiling Acoustic Tile Ceiling Tiles (lay-in) Amec-11 (12-feb-09)	1004,1005,1011,1013,1033,1041,1043,1044,1050,1051,1052,1070,1071,1072,1073,1074,1087,2026,2027,2028,2029	A	0	0	0	0	None Detected	No	
Asbestos	S0012 ACEF	Structure Fireproofing (cementitious) Amec-12 (12-feb-09)	1011,1012,1013,1041,1043,1044,1050,1051,1052,1073,1074,1075,1076,1101,1102,2026,2027,2028,2029	A	0	0	0	0	None Detected	No	
Asbestos	S0013 A	Ceiling Acoustic Tile Ceiling Tiles (lay-in) Amec-13 (12-feb-09)	1032,1050,1051,1052,1073,1074	A	0	0	0	0	None Detected	No	

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
Asbestos	S0015 AC	Piping, Other, Piping Light Fixture Tar Paper Amec-15 (12-feb-09)	1002,1011,1012,1013,1024,1073,1081,1108,2040	A	0	0	0	100	None Detected	No	
Asbestos	S0016 A	Other Light Fixture Foil Face Amec-16 (12-feb-09)	1082,1110,1115,2045	A	0	0	5	100	Chrysotile	Yes	NF
Asbestos	S0018 A	Ceiling Acoustic Tile Ceiling Tiles (lay-in) Amec-18 (12-feb-09)	1011,1012,1013,1075,1076,1102	A	0	0	0	0	None Detected	No	
Asbestos	S0019	Ceiling Acoustic Tile Ceiling Tiles (lay-in) Amec-19 (12-feb-09)	1042	A	0	0	0	0	None Detected	No	
Asbestos	S0022 A	Wall Plaster Amec-22 (12-feb-09)	1080,1081	A	0	0	0	0	None Detected	No	
Asbestos	S0024 A	Ceiling Acoustic Tile Ceiling Tiles (lay-in) Amec-24 (12-feb-09)	1055,1056	A	0	0	0	0	None Detected	No	
Asbestos	S0030 A	Ceiling Soffit Texture Coat Amec-30 (12-feb-09)	1010	A	0	0	0	100	Chrysotile	Yes	F
Asbestos	S0031 A	Wall, Ceiling Texture Coat Amec-31 (12-feb-09)	1055,2055	A	0	1200	0	100	Chrysotile	Yes	F
Asbestos	S0032 A	Piping Tar Paper Tar Paper On Fibreglass - Amec-32 (12-feb-09)	2055	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	V0033	Piping Parging Cement "advanced Environmental Corporation"	1002,1003,1004,1025,1036,1046,1061,1063,1064,1068,1069,1081,2046	A	0	0	177	0	Chrysotile	Yes	F
Asbestos	V0034	Ceiling, Wall Acoustic Tile Ceiling Tiles (lay-in) Sample Id 10074-sjb-201 (sampled 25-may-10) - 1' X 1' Glued-on Ceiling Tile, Large Pinhole Pattern	1000,1001,1015,1016,1017,1020,1021,1022,1023,1047,2000,2001,2006,2012,2019,2020,2021,2030,2031,2032,2035,2036,2037,2038,2044	A	0	700	0	100	None Detected	No	
Asbestos	V0035	Ceiling Acoustic Tile Ceiling Tiles (lay-in) Sample Id 10074-sjb-202 (sampled 25-may-10)	1045	A	0	0	0	0	None Detected	No	
Asbestos	S0037	Floor Vinyl Floor Tile (no Mastic) Sample Id 2017-s01 (sampled 15-aug-17). Layer 1 Vft, Layer 2 Mastic	1065,1066,1067,1068,1069,1070,1071,1088,1091,1095,1096,1097,1099,2050	A	0	0	0	100	None Detected	No	
Asbestos	S0038	Floor Vinyl Floor Tile (no Mastic) Sample Id 2017-s02 (sampled 15-aug-17). Layer 1 Vft, Layer 2 Mastic	2000,2001,2002,2003,2006,2012,2019,2020,2021,2022,2023,2024,2031,2032,2035,2036,2037,2038	A	0	25950	0	100	Chrysotile	Yes	NF
Asbestos	S0039	Piping Aircell	1064	A	220	0	0	0	Chrysotile	Yes	F
Asbestos	S0040	Ceiling Ceiling Tiles (lay-in) 24" X 48" Random Width-wise Fissures	1070	A	0	0	0	100	None Detected	No	
Asbestos	S0041 ABC	Other Window Caulking	1	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0042 ABCDEFG	Ceiling Plaster	1001,1004,1023,1025,2001,2012,2043	A	0	0	0	0	None Detected	No	
Asbestos	S0043 ABC	Other Window Caulking White	1002	A	0	0	0	0	None Detected	No	
Asbestos	S0044 ABC	Other Expansion Joint Caulking White, Courtyard	1	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0045 ABC	Other Window Caulking Off-white, Courtyard	1	A	0	0	0	100	None Detected	No	

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
Asbestos	S0046 ABC	Other Caulking Black/grey, Around Louvers	1	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0047 ABC	Ceiling Mastic Puck, Brown	1023	A	0	0	0	100	None Detected	No	
Asbestos	S0048 ABC	Other Window Caulking Grey, Window Sill	2010	A	0	0	0	0	Chrysotile	Yes	NF
Asbestos	S0049 ABC	Other Window Caulking Grey, Window Frame	1	A	0	0	0	100	Chrysotile	Yes	NF
Asbestos	S0050 ABC	Ceiling Soffit Texture Coat	1041	A	0	0	0	100	Chrysotile	Yes	F
Asbestos	S0051 ABC	Floor Mastic	2026,2027,2028,2029	A	0	3000	0	100	Chrysotile	Yes	NF
Asbestos	V9500	Duct Fibreglass W/parging	1100	A	0	0	0	100	Presumed Asbestos	Yes	F
Asbestos	V9500	Floor Floor Levelling Compound	1	A	0	0	0	100	Presumed Asbestos	Yes	F
Asbestos	V9500	Floor Mastic Under New Non-asbestos Floor Tiles	1000,1001,1002,1005,1010,1015,1016,1017,1020,1021,1022,1023,1024,1025,1026,1027,1033,1034,1035,1036,1041,1049,1054,1055,1056,1057,1058,1072,1077,1087,1088,1103,1105,1107,2004,2007,2008,2009,2010,2011,2015,2016,2017,2030,2043,2044,2045,2047,2050,2054	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Floor Vinyl Floor Tile (no Mastic) 12x12 Green Dense Fleck, 12x12 Beige W Brown Streak, 12x12 Blue Dense Fleck, 12x12 Evergreen Dense Fleck, 12x12 Green Dense Fleck, 12x12 Grey Dense Fleck, 12x12 Light Blue Dense Fleck, 12x12 Light Blue Dense Fleck (under Counters), 12x12 Light Green Dense Fleck, 12x12 Lime Green Dense Fleck, 12x12 Red Dense Fleck, 12x12 Beige Fleck, 9x9 Beige W Brown Streak, 9x9 Brown W White Streak, 9x9 Orange With Brown Streak (under Counters), 9x9 White W Multi-colour Streak	1000,1001,1002,1005,1015,1016,1017,1020,1021,1022,1023,1024,1025,1026,1027,1035,1041,1049,1054,1057,1072,1077,1087,1088,1095,1096,1097,1103,1105,1107,2004,2007,2008,2009,2010,2011,2015,2016,2017,2030,2043,2044,2045,2047,2050,2054	A	0	800	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Floor Vinyl Floor Tile And Mastic 12x12 Beige And Browns Flecks, 12x12 Beige With Brown Flecks, 12x12 Beige With Brown Streaks, 12x12 Green Flecks, 9x9 Beige	1042,1055,1063,1077,1100,1110,1112	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Floor Vinyl Sheet Flooring Faux Wood Pattern	2049	A	0	0	0	100	Presumed Asbestos	Yes	PF
Asbestos	V9500	Other Countertop Adhesive/mastic Duct, Baseboard, Etc	1	A	0	0	0	50	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Countertop, Sink Bakelite	2003,2007,2009,2010,2011,2054	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Door Caulking	1	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Door, Fumehood, Electrical Equipment	1,2004,2009,2054	A	0	280	0	100	Presumed	Yes	NF

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
		Cement Product Transite Components Electrical And Switchgear Equipment							Asbestos		
Asbestos	V9500	Other Electric Light Fixture Foil Face	1053,1080	A	0	0	3	0	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Sink Mastic, Gold	1066,1071,2014	A	0	0	3	0	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Paper	1	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Electrical Wire Textile Woven Jacketing And Insulation On Older Wiring	1	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Other Fire Door Thermal Insulation	1059	A	0	0	1	0	Presumed Asbestos	Yes	F
Asbestos	V9500	Piping Rain Water Leader Cement Product	1011	A	40	0	0	0	Presumed Asbestos	Yes	NF
Asbestos	V9500	Structure Roof Roofing Material	1	A	0	0	0	100	Presumed Asbestos	Yes	NF
Asbestos	V9500	Wall Vermiculite/concrete Block Walls	1	A	0	0	0	100	Presumed Asbestos	Yes	F
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) 2016	1067	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tiles (lay-in) 2x2 Ph Flecks (2016)	1078	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tiles (lay-in) 2x4 2016	1010	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) 2x4 2018	1084	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tiles (lay-in) 2x4 Small Flecks And Pinholes (2012)	1012	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tiles (lay-in) 2x4 Pinhole And Texture (2014)	1041	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Ceiling Tiles (lay-in) Horizontal	1063	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Concrete (precast)	1063,1065,1066,1068,1070,1072	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Drywall And Joint Compound (2018)	1075,1076	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Drywall And Joint Compound 2018	1011	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Ceiling Deck Steel	2052	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Duct Canvas	2052	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Carpet	1042,1055,1056	A	0	0	0	0	Non Asbestos	No	

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
Asbestos	V0000	Floor Ceramic Tiles	1033,1048,1061,1076,1079,1083,1084,1087,1103 1105,1107,1110,1111,1115,2042,2046	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Ceramic Tiles Multi-colour	1003,1004,1051,1052,2014	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Ceramic Tiles Multi-coloured	1032	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Concrete (poured)	1028,1059,1063,1064,1080,2052	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Concrete (poured) Painted	1042	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Laminate Wood Pattern	1042	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Mastic	1090	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Mastic (new 2017)	1114	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Rubber Green	1089	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Floor Terrazzo	1018,1019,1035,1043,1044,1045,1046,1047,1048 1060,1062,1073,1074,1075,1081,1082,1085,1086 1102,1104,1106,1108,1109,1112,1113,2005,2013 2033,2034,2053	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Terrazzo Multi-colour	1006,1011,1012,1013,1014,1040,1050,1051,1052 1053,1092,1093,1094,1098,1101,2018,2025,2039 2040,2041,2051	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Terrazzo Multi-coloured	1029,1030,1031,1032,2048	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile 12x12 Grey	1010	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile (no Mastic) 12x12 Beige W Brown Streak (new 2017)	1114	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile (no Mastic) 12x12 Beige With Blue Flecks (2016)	1067	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile (no Mastic) 12x12 Grey With White And Dark Grey Fleck (new)	1072	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile (no Mastic) New 2017 12x12 Beige Dense Fleck	1090	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Floor Tile And Mastic 12x12 Beige	1010	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Floor Vinyl Sheet Flooring Vinyl Plank	1033,1034,1036	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Floor Wood	1079,1100,2055	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Piping Fibreglass	1002,1003,1004,1005,1011,1012,1013,1024,1027	A	0	0	0	0	Non	No	

HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Type	Positive	Friability
			1036,1046,1055,1059,1063,1064,1066,1068,1069 1072,1073,1074,1075,1076,1078,1079,1088,1089 1097,1099,1100,1101,1102,1105,1114,2040,2047 2052						Asbestos		
Asbestos	V0000	Structure Concrete (precast)	1069	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Structure Deck Steel	1042,1079,1088,1089,1096,1100	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Structure Deck Wood	1042	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Wall Ceramic Tiles	1032,1075	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Wall Ceramic Tiles Multi-colour	1011,1012,1013	A	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Wall Drywall And Joint Compound (2018)	1076,1116	A	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Wall Masonry	1000,1001,1002,1003,1004,1005,1006,1010,1011 1012,1013,1014,1015,1016,1017,1018,1019,1020 1021,1022,1023,1024,1025,1026,1027,1028,1029 1030,1031,1032,1033,1034,1035,1036,1040,1041 1042,1043,1044,1045,1046,1047,1048,1049,1050 1051,1052,1053,1054,1055,1056,1057,1058,1059 1060,1061,1062,1063,1064,1065,1066,1067,1068 1069,1070,1071,1072,1075,1077,1078,1079,1080 1081,1082,1083,1084,1085,1086,1087,1088,1089 1091,1092,1093,1094,1095,1096,1097,1098,1099 1100,1101,1102,1103,1104,1105,1106,1107,1108 1109,1110,1111,1112,1113,1114,1115,2000,2001 2002,2003,2004,2005,2006,2007,2008,2009,2010 2011,2012,2013,2014,2015,2016,2017,2018,2019 2020,2021,2022,2023,2024,2025,2026,2027,2028 2029,2030,2031,2032,2033,2034,2035,2036,2037 2038,2039,2040,2041,2042,2043,2044,2045,2046 2047,2048,2049,2050,2051,2052,2053,2054	A	0	0	0	0	Non Asbestos	No	

Legend:

Sample number		Units			
S####	Asbestos sample collected	SF	Square feet	NF	Non Friable material.
L####	Paint sample collected	LF	Linear feet	F	Friable material
P####	PCB sample collected	EA	Each	PF	Potentially Friable material
M####	Mould sample collected	%	Percentage		
V####	Material visually similar to numbered sample collected				
V0000	Known non Hazardous Material				
V9000	Material is visually identified as Hazardous Material				
V9500	Material is presumed to be Hazardous Material				
[Loc. No.]	Abated Material				

APPENDIX IV
All Data Report

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1 : General
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Floor Levelling Compound			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	F
Other		Paper			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other		Adhesive/mastic, duct, baseboard, etc			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other		Caulking, black/grey, around louvers	Exterior		A	Y		100			%	S0046ABC	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Other	Door	Caulking			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Electrical Equipment	Cement Product, Transite components electrical and switchgear equipment			B	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Electrical Wire	Textile, Woven jacketing and insulation on older wiring			B	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Expansion Joint	Caulking, white, courtyard	Exterior		A	Y		100			%	S0044ABC	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Other	Window	Caulking	Exterior		A	Y		100			%	S0041ABC	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Other	Window	Caulking, off-white, courtyard	Exterior		A	Y		33			%	S0045ABC	None Detected	N.D.	None	
Other	Window	Caulking, grey, window frame	Exterior		A	Y		100			%	S0049ABC	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Structure	Roof	Roofing material			C	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Vermiculite/concrete block walls			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	F

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1000 : Classroom 119
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 119
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y		100			%	V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1001 : Classroom 117
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 117
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0042B	None Detected	N.D.	None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1002 : Classroom 115A
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 115A
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, white	Exterior		A	Y						S0043ABC	None Detected	N.D.	None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	N		3			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Piping		Tar Paper	Insulation		C	N						V0015	None Detected		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1003 : Co-op Office
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 115B
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	N		2			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1004 : Office
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 113A
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0042A	None Detected	N.D.	None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		2			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1005 : Classroom 113
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 113
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Red Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1006 : Stairwell
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1010 : Student Services
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 109
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 2016			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling	Soffit	Texture Coat	Exterior		C	Y		100			%	S0030A	Chrysotile	0.5-5%	Confirmed Asbestos	F
Floor		Vinyl Floor Tile and Mastic, 12x12 beige			A	Y		100			%	V0000	Non-Asbestos		None	
Floor		Ceramic Tiles			A	Y										
Floor		Mastic, under new non-asbestos floor tiles		Vinyl Floor Tile	D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile, 12x12 grey			A	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1011 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound, 2018			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0018	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Tar Paper	Insulation		C	N						S0015C	None Detected		None	
Piping ¹	Rain Water Leader	Cement Product			B	Y		40			LF	V9500	Presumed Asbestos		Presumed Asbestos	NF
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						S0012F	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Glass			A	Y										

1 - Hatch

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1012 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0018	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small flecks and pinholes (2012)			C	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Tar Paper	Insulation		C	N						V0015	None Detected		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1013 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Wood			C	Y										
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0018	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Tar Paper	Insulation		C	N						V0015	None Detected		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1014 : Stairwell
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1015 : Classroom 113
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 113
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Red Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1016 : Classroom 112
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 112
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1017 : Classroom 114
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 114
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1018 : Girls Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 116
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1019 : Boys Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 118
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1020 : Classroom 120
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 120
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1021 : Classroom 122
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 122
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1022 : Classroom 124
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 124
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1023 : Classroom 126
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 126
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						S0042D	None Detected	N.D.	None	
Ceiling		Mastic, puck, brown			C	N		33			%	S0047ABC	None Detected	N.D.	None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Blue Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1024 : Classroom 121
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 121
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 SPH			C	Y		900	1		SF	S0036	[None]	0.5-5%	[Abated]	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation		C	N						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	N		3			EA	V0033	[None]	25-50%	[Abated]	
Piping		Tar Paper	Insulation		C	N						V0015	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1025 : Classroom 121A
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 121A
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0042C	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Parging Cement	Straight		A	Y		15			LF	S0005B	Chrysotile	25-50%	Confirmed Asbestos	F
Piping		Parging Cement	Fitting		A	Y		2			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1026 : Classroom 123
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 123
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 SPH			C	Y		100			%	V0036	[None]	0.5-5%	[Abated]	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Blue Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1027 : Resource/Spec. Ed
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 125/127
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						S0009C	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Grey Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Structure					A	Y						V0007	None Detected		None	
Structure		Fireproofing (Cementitious), Beige Spray Applied			C	N						V0008	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1028 : Spec. Education Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 127
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Concrete (poured)		Paint	A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	N						V0008	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1029 : Boys Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Coloured			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1030 : Custodial Closet
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007C	None Detected		None	
Floor		Terrazzo, Multi-Coloured			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1031 : Girls Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 132
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Coloured			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1032 : Mens Staff Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small Pinhole			C	Y						V0013	None Detected		None	
Floor		Ceramic Tiles, Multi-Coloured			A	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo, Multi-Coloured			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1033 : Staff Lounge
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Vinyl Floor Tile and Mastic, 12x12 beige with Brown flecks			A	Y		100			%	V9500	[None]		[Abated]	
Floor		Vinyl Sheet Flooring, vinyl plank			A	Y						V0000	Non-Asbestos		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Ceramic Tiles			A	Y										
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Rose with Brown Fleck			A	Y		100			%	V9500	[None]		[Abated]	
Floor		Vinyl Floor Tile (No Mastic), 9x9 Beige with Brown Fleck			A	Y		100			%	V9500	[None]		[Abated]	
Piping		Not Insulated			C	Y										
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1034 : Photocopy Supply Room
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Bulkhead	Drywall and joint compound			C	Y						V0006	None Detected		None	
Floor		Vinyl Sheet Flooring, vinyl plank			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	[None]		[Abated]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1035 : Womens Staff Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 White w Multi-Colour Streak			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1036 : Photocopy Room
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Vinyl Sheet Flooring, vinyl plank			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	[None]		[Abated]	
Floor		Vinyl Floor Tile (No Mastic), 9x9 White w Multi-Colour Streak			A	Y		100			%	V9500	[None]		[Abated]	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		A	Y		2			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall ¹		Drywall and joint compound			A	Y		100			%	V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

1 - Adjacent corridor

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1040 : Stairwell
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1041 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 pinhole and texture (2014)			C	Y						V0000	Non-Asbestos		None	
Ceiling	Soffit	Texture Coat			C	Y		33			%	S0050ABC	Chrysotile	0.5-5%	Confirmed Asbestos	F
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1042 : Library
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Textured Pinhole			C	Y						V0019	None Detected		None	
Floor		Concrete (poured), Painted			A	Y						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, 12x12 green flecks			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Carpet			A	Y						V0000	Non-Asbestos		None	
Floor		Laminate, Wood Pattern			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass		Polyvinyl chloride (PVC)	A	Y										
Structure	Deck	Steel			C	Y						V0000	Non-Asbestos		None	
Structure	Deck	Wood			C	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1043 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						S0011C	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1044 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						S0012E	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1045 : Cafeteria
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 pinhole flecks			C	Y						V0035	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1046 : Kitchen
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass			C	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		4			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1047 : Math Department
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		700			SF	V0034	None Detected	N.D.	None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1048 : Stairwell
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1049 : Classroom 131
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 131
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007D	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Brown Streak			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass		Polyvinyl chloride (PVC)	A	Y										
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1050 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small Pinhole			C	Y						V0013	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1051 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small Pinhole			C	Y						V0013	None Detected		None	
Floor		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass			C	N										
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1052 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small Pinhole			C	Y						V0013	None Detected		None	
Floor		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1053 : Woodworking Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0006	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Other	Electric Light Fixture	Foil Face			C	Y		1			EA	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1054 : Custodial Closet
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Beige w Brown Streak			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1055 : Chapel
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling		Texture Coat		Plaster	C	Y		1200			SF	V0031	Chrysotile	0.5-5%	Confirmed Asbestos	F
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Stickdown Scattered			C	Y						S0024A	None Detected		None	
Floor		Vinyl Floor Tile and Mastic, 12x12 beige with Brown flecks			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Carpet			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						S0006C	None Detected		None	
Wall		Plaster			A	Y						V0007	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1056 : Chapel Office
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Stickdown Scattered			C	Y						V0024	None Detected		None	
Floor		Carpet			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1057 : Classroom T-152
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: T-152
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Beige w Brown Streak			A	Y		97	3		%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Plaster			A	Y						V0007	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1058 : Classroom T-154
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: T-154
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Laminate, Wood			A	Y										
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Beige w Brown Streak			A	Y		100			%	V9500	[None]		[Abated]	
Wall		Drywall and joint compound			A	Y		100			%	V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1059 : Boiler Room
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: T-156
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0006	None Detected		None	
Floor		Concrete (poured)			A	Y						V0000	Non-Asbestos		None	
Other	Fire Door	Thermal Insulation			A	Y		1			EA	V9500	Presumed Asbestos		Presumed Asbestos	F
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1060 : Boiler Room Lockers
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1061 : Boiler Room Tool Room
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y		100			%	V0007	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement			A	Y		2			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Piping		Parging Cement			C	Y		2			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1062 : Boiler Room Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1063 : Woodworking
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: T-160
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Concrete (precast)			C	Y						V0000	Non-Asbestos		None	
Ceiling		Ceiling Tiles (lay-in), Horizontal			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Concrete (poured)			A	Y						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile and Mastic, 12x12 beige with Brown streaks			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Ceramic Tiles			A	Y										
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		30			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Piping		Parging Cement	Fitting		A	Y		10			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1064 : Transportation Services
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Concrete (poured)			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		55			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Piping		Parging Cement	Fitting		A	Y		7			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Piping		Aircell			A	Y		20			LF	S0039	Chrysotile	5-10%	Confirmed Asbestos	F
Piping		Aircell			C	Y		200			LF	S0039	Chrysotile	5-10%	Confirmed Asbestos	F
Structure		Concrete (precast)			C	Y										
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1065 : Art T-149B
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: T-149B
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Concrete (precast)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N						S0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y		100			%	S0037	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1066 : Art T-149A
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: T-149A
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Concrete (precast)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Other	Sink	Mastic, Gold			A	Y		1			EA	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1067 : Tech Services T-157B
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: T-157B
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2016			C	Y						V0000	Non-Asbestos		None	
Ceiling		Drywall and joint compound			C	Y		100			%	V0006	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 beige with blue flecks (2016)			A	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1068 : Tech Services T-157A
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: T-157A
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Concrete (precast)			C	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		9			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1069 : Manufacturing
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: T-155
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Fitting		C	Y		35			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Piping		Parging Cement	Fitting		A	Y		4			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Structure		Concrete (precast)			C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1070 : Studio
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: T-153S
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Concrete (precast)			C	Y						V0000	Non-Asbestos		None	
Ceiling		Ceiling Tiles (lay-in), 24" x 48" random width-wise fissures			C	Y		100			%	S0040	None Detected	N.D.	None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1071 : Computer Lab
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: T-153G
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						S0006D	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Other	Countertop	Wood			A	Y										
Other	Sink	Mastic, Gold			A	Y		1			EA	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1072 : Computer Engineering
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: T-151
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Concrete (precast)			C	N						V0000	Non-Asbestos		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Blue Dense Fleck (under counters)			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Orange with Brown Streak (under counters)			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 grey with white and dark grey fleck (new)			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			A	Y		100			%	V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1073 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						S0010A	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small Pinhole			C	Y						S0013A	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Piping		Tar Paper	Insulation		C	N						S0015A	None Detected		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray Applied			C	N						S0012A	None Detected		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1074 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						S0011A	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						S0010B	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Small Pinhole			C	Y						V0013	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1075 : Vestibule
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound, (2018)			C	Y						V0000	Non-Asbestos		None	
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling		Abated Material, 2x2 Large Fissure			C	Y						V0020	[None]		[Abated]	
Ceiling		Abated Material, 2x2 Small Pinhole			C	Y						V0021	[None]		[Abated]	
Ceiling		Abated Material, 2x2 Textured Pinhole			C	Y						V0019	[None]		[Abated]	
Ceiling		Abated Material, 2x2 Horizontal Fissure			C	Y						S0017A	[None]		[Abated]	
Ceiling		Abated Material, 2x4 Scattered Pattern			C	Y						V0010	[None]		[Abated]	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Scattered Pattern			C	Y						V0018	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						S0012C	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1076 : Front Foyer
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound, (2018)			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling		Abated Material, 2x2 Large Fissure			C	Y						S0020A	[None]		[Abated]	
Ceiling		Abated Material, 2x2 Small Pinhole			C	Y						S0021A	[None]		[Abated]	
Ceiling		Abated Material, 2x2 Textured Pinhole			C	Y						S0019A	[None]		[Abated]	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Scattered Pattern			C	Y						S0018A	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spay-Applied			C	N						V0012	None Detected		None	
Wall		Drywall and joint compound, (2018)			A	Y		100			%	V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1077 : Stairs
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Vinyl Floor Tile and Mastic, 12x12 beige and browns flecks			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor ¹		Vinyl Floor Tile (No Mastic), 9x9 Brown w White Streak			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Not Insulated			A	Y										
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

1 - On stairs

Client: Hamilton-Wentworth Catholic District Sch
Location: #1078 : Auditorium
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 ph flecks (2016)			C	Y						V0000	Non-Asbestos		None	
Floor		Concrete (poured)			A	Y										
Floor		Carpet			A	Y										
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Tectum			C	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1079 : Stage
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Wood			A	Y						V0000	Non-Asbestos		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)								V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	Y						V0008	None Detected		None	
Structure	Deck	Steel			C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1080 : Auditorium Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Concrete (poured)			A	Y						V0000	Non-Asbestos		None	
Other	Electric Light Fixture	Foil Face			C	Y		2			EA	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Not Insulated			A	Y										
Wall		Plaster			A	Y						S0022A	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1081 : Stage Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Other	Light Fixture	Foil Face, On Incandescent Lights			C	Y		100			%	V0015	None Detected		None	
Piping ¹		Parging Cement	Fitting		A	Y		6			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Stucco			A	Y						V0022	None Detected		None	

1 - On stair landing

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1082 : Auditorium Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0006	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Other	Light Fixture	Foil Face			C	N		100			%	V0016	Chrysotile	25-50%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1083 : Kilters Room
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1084 : Co-Inst. Office
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Ceiling Tiles (lay-in), 2x4 2018			C	Y		100			%	V0000	Non-Asbestos		None	
Ceiling		Drywall and joint compound			C	N						V0006	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry		Ceramic Tiles	A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1085 : Boys Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1086 : Girls Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1087 : Mens Locker Room
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		2x4 Horizontal Fissure			C	Y						S0011B	None Detected		None	
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						S0010C	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Structure		Fireproofing (Cementitious), Beige Spray Applied			C	N						S0008D	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1088 : Phys Ed. Department
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Structure	Deck	Steel			C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1089 : Fitness Centre
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Rubber, Green			A	Y		100			%	V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Structure	Deck	Steel			C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1090 : Music Room
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Carpet			A	Y										
Floor		Mastic			D	N						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile (No Mastic), New 2017 12x12 beige Dense Fleck			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass			C	Y										
Wall		Plaster			A	Y						V0007	None Detected		None	
Wall		Masonry			A	Y										

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1091 : Gym Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Piping		Fibreglass			A	Y										
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1092 : Gym Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007B	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1093 : Gym Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007B	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1094 : Gym Storage Corridor
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Drywall and joint compound			C	Y						S0006B	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1095 : Gym Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007B	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1096 : Gym Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Structure	Deck	Steel			C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1097 : Gym Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation		A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1098 : Gym Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1099 : Gym Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N						V0037	None Detected		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			A	Y						V0037	None Detected		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1100 : Gym
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						S0009A	None Detected		None	
Duct ¹		Fibreglass w/Parging			C	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	F
Floor		Wood			A	Y						V0000	Non-Asbestos		None	
Floor ²		Vinyl Floor Tile and Mastic			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Structure	Deck	Steel			C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

- 1 - Suspect at elevated height
2 - Corridor

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1101 : Hallway to Gym
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1102 : Hallway Foyer
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x2 Scattered Pattern			C	Y						V0018	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						S0012A	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1103 : Staff Locker Room
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1104 : Hallway to Gym
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	N						S0008A	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1105 : Womens Locker Room
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y		100			%	V0006	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	N						V0008	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1106 : Custodial Closet
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1107 : Womens Locker Room
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						S0009B	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass			C	N										
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	N						V0008	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1108 : Custodial Closet
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #: 116B
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007D	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass			C	Y										
Piping		Horsehair			C	Y										
Piping		Tar Paper	Insulation		C	Y						V0015	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1109 : Custodial Closet
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1110 : Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Vinyl Floor Tile and Mastic, 9x9 beige			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Other	Light Fixture	Foil Face, On Incandescent Lights			C	N		2			EA	V0016	Chrysotile	25-50%	Confirmed Asbestos	NF
Piping		Not Insulated			C	Y										
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1111 : Boiler Room Lunchroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1112 : Gym Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Vinyl Floor Tile and Mastic, 12x12 green flecks			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	N						V0008	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1113 : Hallway to Gym
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Structure		Fireproofing (Cementitious), Beige Spray-Applied			C	N						S0008A	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1114 : Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic, (new 2017)			D	N						V0000	Non-Asbestos		None	
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Brown Streak (new 2017)			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	N						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #1115 : Storage by Stage
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Wood			A	Y										
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Other	Light Fixture	Foil Face, On Incandescent Lights			C	N		2			EA	V0016	Chrysotile	25-50%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1116 : 2018 Addition
Survey Date: 2018-08-03

Site: Secondary
Floor: 1

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Duct		Not Insulated			C	Y										
Floor		Ceramic Tiles			A	Y										
Piping		Fibreglass		Polyvinyl chloride (PVC)	C	Y										
Piping		Not Insulated			C	Y										
Structure		Steel			C	Y										
Wall		Drywall and joint compound, (2018)			A	Y		100			%	V0000	Non-Asbestos		None	
Wall		Masonry			A	Y										

Client: Hamilton-Wentworth Catholic District Sch
Location: #2000 : French Classroom 219
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 219
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2001 : French Classroom 217
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 217
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						S0042F	None Detected	N.D.	None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2002 : English Office 215
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 215
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Laminate, Wood			A	Y										
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	[None]	0.5-5%	[Abated]	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2003 : Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		200			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		200			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Other	Countertop	Bakelite			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2004 : Science Classroom 213
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 213
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop				A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Door	Cement Product			A	Y		50			SF	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y						S0006F	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2005 : Stairwell
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2006 : English Classroom 211
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 211
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2007 : Science Classroom 209
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 209
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Lime Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop	Bakelite			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2008 : Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 208
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Duct		Not Insulated			C	Y										
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2009 : Science Classroom 207
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 207
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop	Bakelite			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other ¹	Fumehood	Cement Product			A	Y		70			SF	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

1 - Includes cabinet below

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2010 : Science Classroom 205
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 205
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop	Bakelite			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Sink	Bakelite			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Window	Caulking, grey, window sill	Exterior		C	Y						S0048ABC	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2011 : Science Classroom 203
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 203
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop	Bakelite			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Sink	Bakelite			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2012 : Classroom 201
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 201
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						S0042E	None Detected	N.D.	None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y						V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		750			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2013 : Stairwell
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2014 : Classroom 240
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 240
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						S0007E	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Ceramic Tiles, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Other	Sink	Mastic, Gold			A	Y		1			EA	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2015 : Classroom 237
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 237
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in)			C	Y						V0009	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass			A	Y										
Wall		Plaster			A	Y						V0007	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2016 : Classroom 235
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 235
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in)			C	Y						V0009	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Lime Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2017 : Classroom 233
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 233
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in)			C	Y						V0009	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2018 : Stairwell
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2019 : History Classroom 231
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 231
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2020 : Math Classroom 229
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 229
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2021 : Math Classroom 227
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 227
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2022 : Math Classroom 225
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 225
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Floor		Mastic			D	N		800			SF	S0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	S0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2023 : Family Studies 223
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 223
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2024 : Family Studies 221
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 221
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2025 : Stairwell
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2026 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Mastic			A	Y		100			%	S0051C	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Abated Material, 12x12 Beige w Tan Streak													[Abated]	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2027 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Mastic			A	Y		1000			SF	S0051B	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Abated Material, 12x12 Beige w Tan Streak													[Abated]	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2028 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Mastic			A	Y		1000			SF	V0051	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Abated Material, 12x12 Beige w Tan Streak													[Abated]	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2029 : Hallway
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Horizontal Fissure			C	Y						V0011	None Detected		None	
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Scattered Pattern			C	Y						V0010	None Detected		None	
Floor		Mastic			A	Y		1000			SF	S0051A	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Abated Material, 12x12 Beige w Tan Streak													[Abated]	
Structure		Fireproofing (Cementitious), Soft Beige Spray-Applied			C	N						V0012	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2030 : English Classroom 210
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 210
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Brown Streak			A	Y		800			SF	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2031 : English Classroom 212
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 212
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic, 12x12 Beige w Tan Streak			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2032 : English Classroom 214
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 214
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2033 : Girls Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2034 : Boys Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2035 : French Classroom 220
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 220
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2036 : French Classroom 222
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 222
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2037 : Math Classroom 224
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 224
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2038 : Math Classroom 226
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 226
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Beige w Tan Streak			A	Y		800			SF	V0038	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2039 : Boys Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2040 : Custodial Closet
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007G	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Fibreglass			B	N						V0000	Non-Asbestos		None	
Piping		Tar Paper	Insulation		B	N						V0015	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2041 : Girls Washroom
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2042 : Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2043 : Science Classroom 234
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 234
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0042G	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 beige Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop															
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2044 : History Classroom 236
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 236
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	N						V0007	None Detected		None	
Ceiling	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Lime Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall	Acoustic Tile	Ceiling tiles (glue-on), 1x1 LPH			C	Y		100			%	V0034	None Detected	N.D.	None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2045 : Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Beige w Brown Streak			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Light Fixture	Foil Face, On Incandescent Lights			C	N		1			EA	S0016A	Chrysotile	25-50%	Confirmed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2046 : Foyer
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Ceramic Tiles			A	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement			C	Y		2			EA	V0033	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2047 : Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 9x9 Beige w Brown Streak			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2048 : Stairwell
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Terrazzo, Multi-Coloured			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2049 : Dance Studio 200A
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 200A
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Vinyl Sheet Flooring, Faux Wood Pattern			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	PF
Wall		Drywall and joint compound			A	Y						V0006	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2050 : Health Sciences 200B
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #: 200B
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Rubber			A	Y										
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Evergreen Dense Fleck			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Light Grey Dense Fleck			D	N						V0037	None Detected		None	
Wall		Drywall and joint compound			A	Y						S0006A	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2051 : Stairwell
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			C	Y						V0006	None Detected		None	
Ceiling		Plaster			C	Y						S0007A	None Detected		None	
Floor		Terrazzo, Multi-Colour			A	Y						V0000	Non-Asbestos		None	
Piping		Parging Cement	Straight		C	Y		15			LF	S0005A	Chrysotile	25-50%	Confirmed Asbestos	F
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2052 : Fan Room
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Deck	Steel			C	Y						V0000	Non-Asbestos		None	
Duct		Parging Cement, Parging on seam			C	Y						S0002A	None Detected		None	
Duct		Canvas	Insulation	Fibreglass	C	Y						V0000	Non-Asbestos		None	
Floor		Concrete (poured)			B	Y						V0000	Non-Asbestos		None	
Other	Electrical Panel	Cement Product			A	Y		100			%	S0003A	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass	Insulation	Polyvinyl chloride (PVC)	C	Y						V0000	Non-Asbestos		None	
Piping		Armaflex			B	Y										
Piping	Heating Water Supply	Parging Cement			B	Y				1	EA					
Structure	Beam, Deck	Fireproofing (Cementitious), Grey Spray-Applied			C	Y						S0001A	None Detected		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	
Wall		Fibreglass, Fibreglass Backing			A	Y						S0004A	None Detected		None	

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2053 : Custodial Closet
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						S0007G	None Detected		None	
Floor		Terrazzo			A	Y						V0000	Non-Asbestos		None	
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth Catholic District Sch
Location: #2054 : Science Storage
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Plaster			C	Y						V0007	None Detected		None	
Floor		Mastic			D	N		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Floor		Vinyl Floor Tile (No Mastic), 12x12 Green Dense Fleck			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other	Countertop	Bakelite			A	Y		100			%	V9500	Presumed Asbestos		Presumed Asbestos	NF
Other ¹	Door	Cement Product			A	Y		160			SF	V9500	Presumed Asbestos		Presumed Asbestos	NF
Wall		Masonry			A	Y						V0000	Non-Asbestos		None	

1 - Both acid cabinets

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2055 : Catwalk
Survey Date: 2018-08-03

Site: Secondary
Floor: 2

Building Name: St Jean de Brebeuf
Room #:
Last Re-Assessment: 2022-07-11

Area (sqft): 0

ASBESTOS																
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 2x4 Pinhole Pattern			C	Y						V0009	None Detected		None	
Floor		Wood			A	Y						V0000	Non-Asbestos		None	
Piping		Tar Paper	Insulation		C	Y		100			%	S0032A	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Wall		Drywall and joint compound			A	Y						S0006E	None Detected		None	
Wall		Texture Coat		Plaster	A	Y		100			%	S0031A	Chrysotile	0.5-5%	Confirmed Asbestos	F

Legend:

Sample number		Units		Other	
S####	Asbestos sample collected	SF	Square feet	A	Access
V####	Material visually similar to numbered sample collected	LF	Linear feet	V	Visible
V0000	Known non-asbestos material	EA	Each	AP	Air Plenum
V9000	Visually identified as an asbestos material	%	Percentage	F	Friable material
V9500	Material is presumed to be an asbestos material			NF	Non Friable material
				PF	Potentially Friable material

Access

A	Accessible to all building occupants
B	Accessible to maintenance and operations staff without a ladder
C	Accessible to maintenance and operations staff with a ladder. Also rarely entered, locked areas
D	Not normally accessible

Condition

Good	No visible damage or deterioration
Fair	Minor, repairable damage, cracking, delamination or deterioration
Poor	Irreparable damage or deterioration with exposed and missing material

Visible

Y	The material is visible when standing on the floor of the room, without the removal or opening of other building components (e.g. ceiling tiles or access panels).
N	The material is not visible to view when standing on the floor of the room and requires the removal of a building component (e.g. ceilings tiles or access panels) to view and access. Includes rarely entered crawlspaces, attic spaces, etc. Observations will be limited to the extent visible from the access points.

Air Plenum

Yes or No	The material is in a return air plenum or in a direct airstream or there is evidence of air erosion (e.g. duct for heating or cooling blowing directly on or across an ACM). This field is only completed where Air Plenum consideration is required by regulation.
-----------	---

Colour Coding

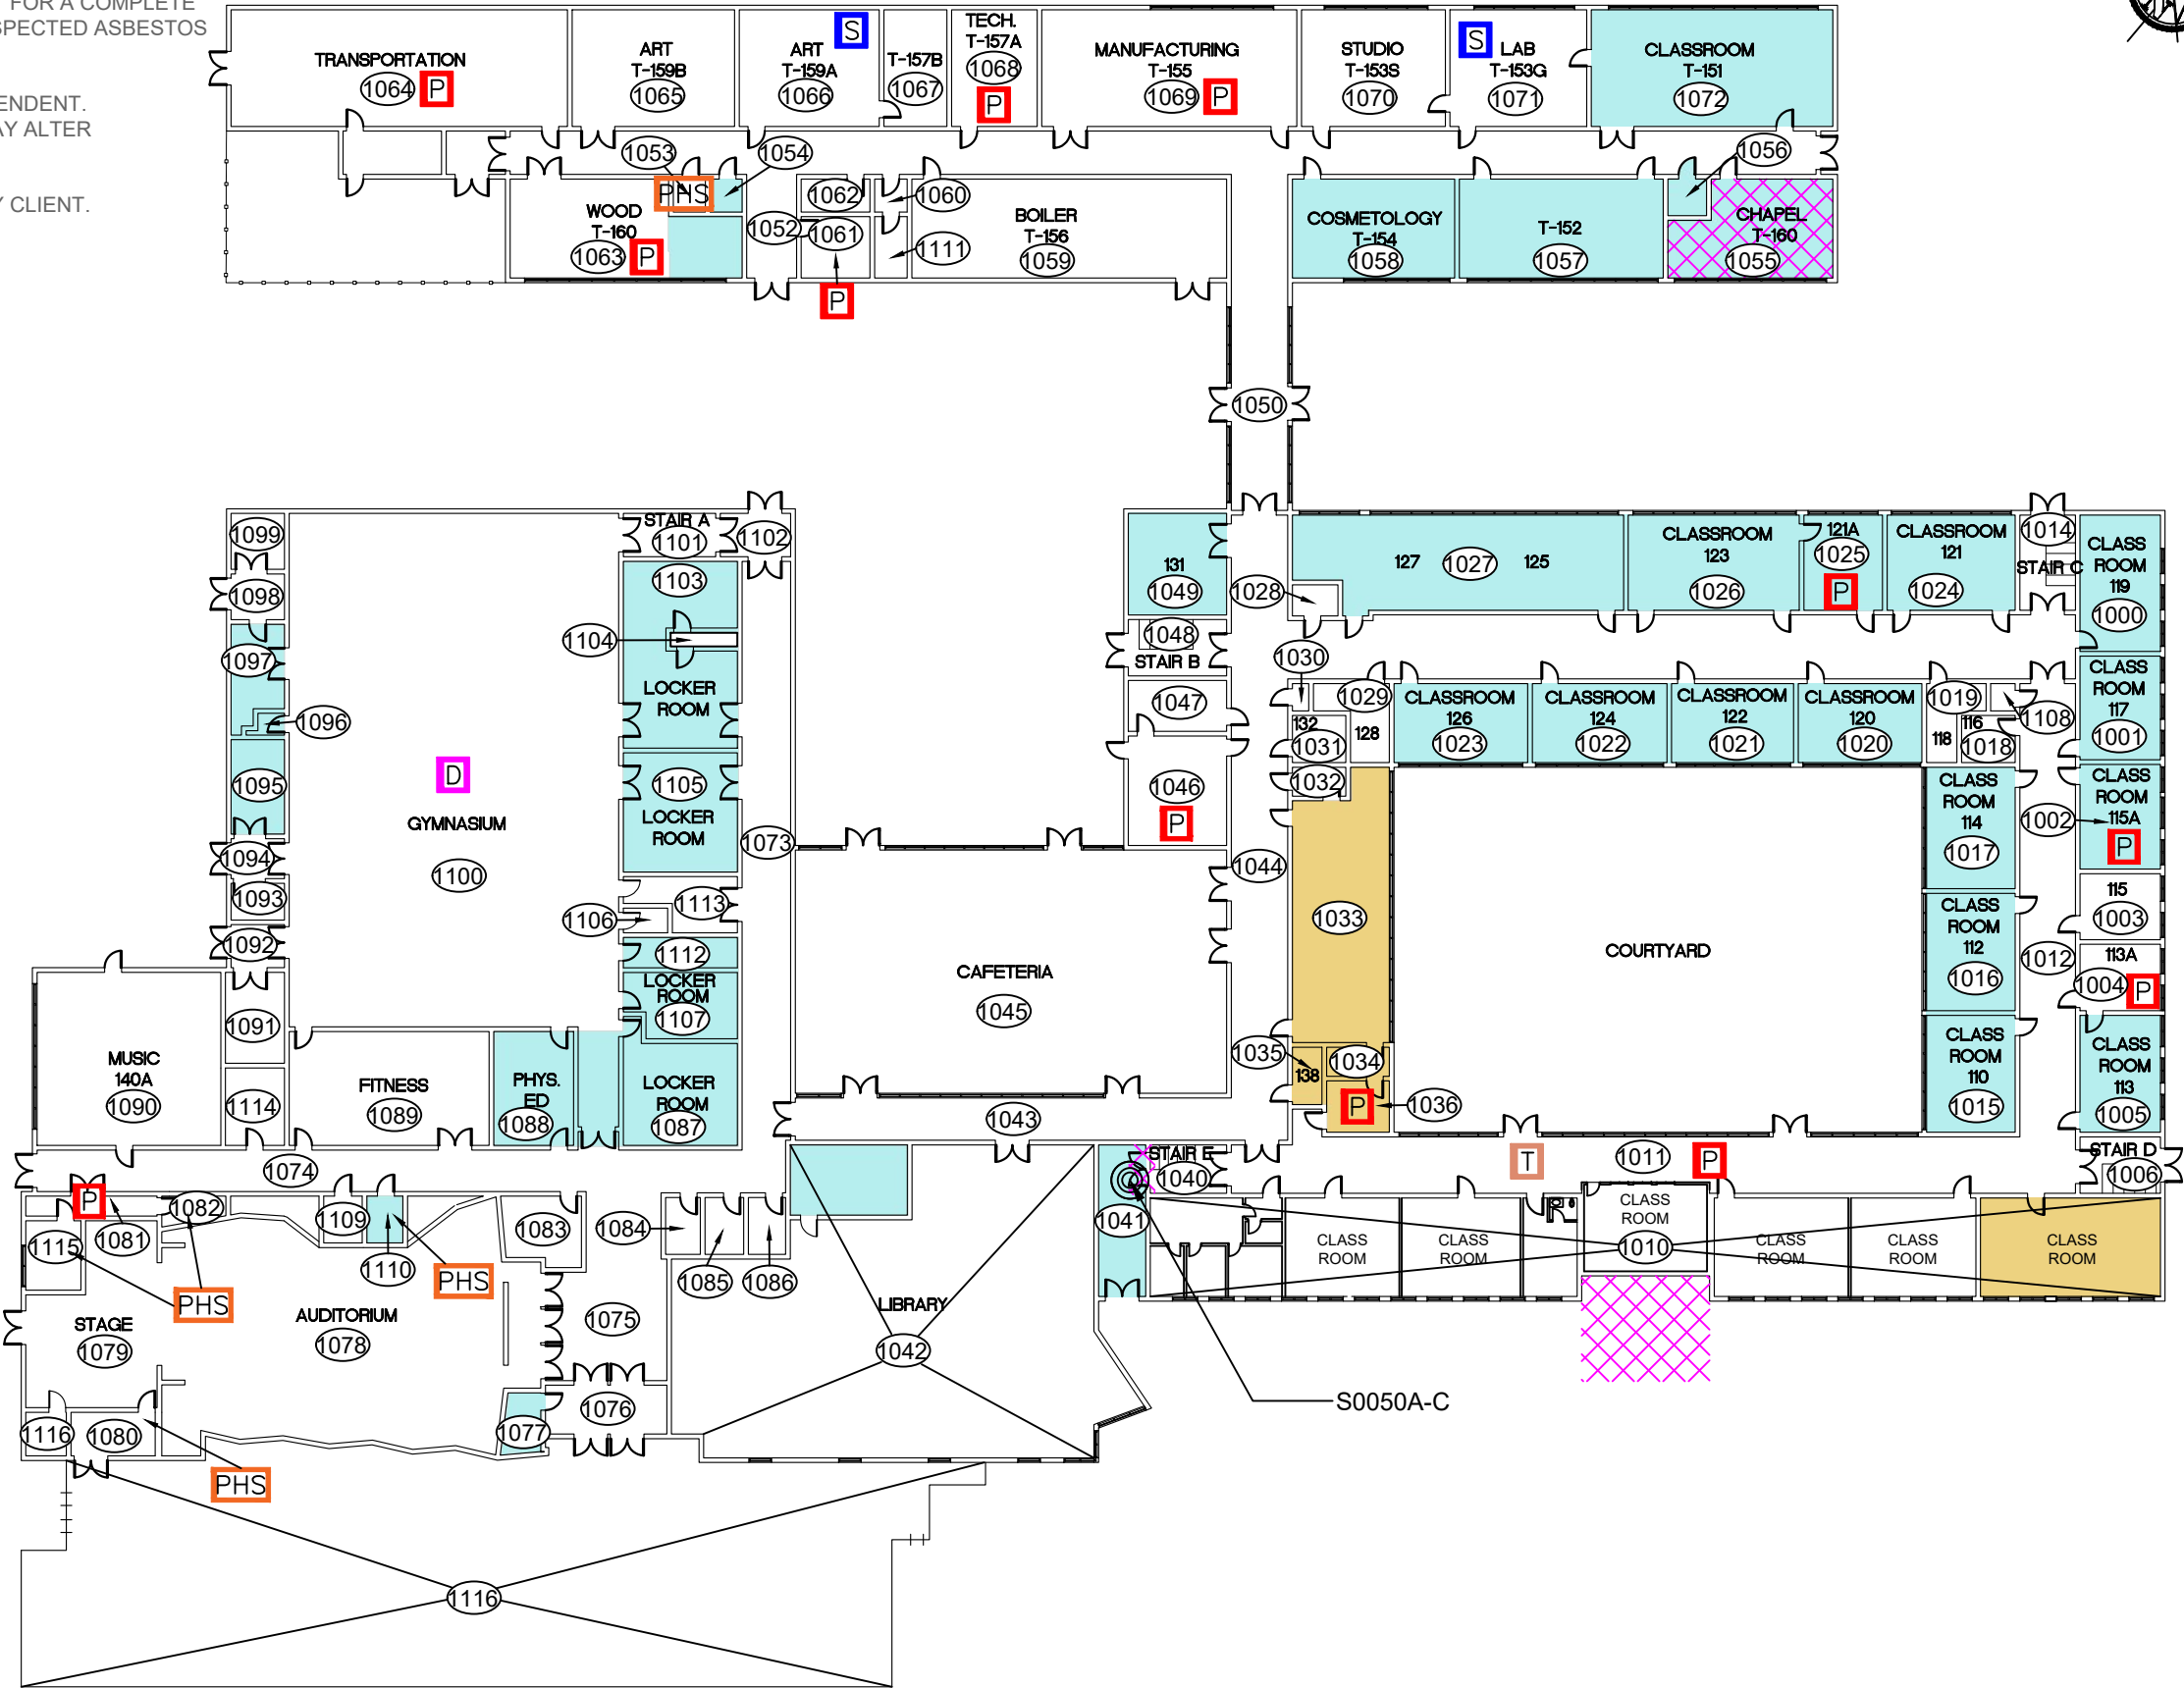
	The material is known to contain regulated concentrations of asbestos; either by analytical results or visible identification (use of the V9000 code).
	The material is presumed to contain asbestos; based on visual appearances; typically a material known to historically contain asbestos; however, not sampled due to limited access or the destructive nature of the sampling.

APPENDIX V
Drawings

NOT ALL KNOWN OR SUSPECTED ASBESTOS BUILDING MATERIALS MAY BE DEPICTED ON THE DRAWING. REFER TO THE ASBESTOS REASSESSMENT REPORT FOR A COMPLETE LIST OF KNOWN AND SUSPECTED ASBESTOS BUILDING MATERIALS.

LEGEND IS COLOUR DEPENDENT. NON-COLOUR COPIES MAY ALTER INTERPRETATION.

BASE PLAN PROVIDED BY CLIENT.



905-577-6206 www.pinchin.com

- LEGEND:
- (X) LOCATION NUMBER
 - (C) ASBESTOS BULK SAMPLES
 - ASBESTOS-CONTAINING MATERIALS:
 - P PIPE INSULATION
 - T TRANSITE
 - B BAKELITE
 - S SINK UNDERCOATING
 - D PRESUMED DUCT INSULATION
 - PHS PAPER HEAT SHIELD
 - TEXTURE FINISH
 - VINYL FLOOR TILES & MASTIC
 - FLOOR MASTIC
 - VINYL SHEET FLOORING

CLIENT:

Hamilton-Wentworth
Catholic District School Board
Believing. Achieving. Serving

LOCATION:
ST. JEAN DE BREBEUF
200 ACADIA DRIVE
HAMILTON, ONTARIO

TITLE:
ASBESTOS REASSESSMENT
FLOOR LEVEL 1

DATE: AUGUST 2022	PROJECT # : 303992.004
DRAWN BY: EB	DRAWING: 1 OF 2
CHECKED BY: EB	
SCALE: NTS	

BASE PLAN PROVIDED BY CLIENT.



www.pinchin.com

 ASBESTOS BULK SAMPLES

VINYL SHEET FLOORING

Believing, Achieving, Serving

ST. JEAN DE BREBEUF
200 ACADIA DRIVE
HAMILTON, ONTARIO

ASBESTOS REASSESSMENT
FLOOR LEVEL 2

PROJECT #:	303992.004
------------	------------

NTS

2 OF 2

