



Asbestos Reassessment

St. Michael
135 Hester Street, Hamilton,
Ontario

Prepared for:

**Hamilton-Wentworth Catholic
District School Board**

90 Mulberry Street
Hamilton, Ontario, L8N 3R9

August 30, 2022

Pinchin File: 303992.004



Asbestos Reassessment

St. Michael, 135 Hester Street, Hamilton, Ontario
Hamilton-Wentworth Catholic District School Board

August 30, 2022
Pinchin File: 303992.004

Issued to: Hamilton-Wentworth Catholic District
School Board
Issued on: August 30, 2022
Pinchin File: 303992.004
Issuing Office: Hamilton, ON
Pinchin Contact: Emily Balfour, Project Manager
289.889.5147
ebalfour@pinchin.com



Author: Luke Thompson, ADip.T.(Arch)
Project Technologist
289.922.8960
lthompson@pinchin.com

Reviewer: Damian Palus, C.E.T.
Operations Manager
289.678.0694
dpalus@pinchin.com



EXECUTIVE SUMMARY

Hamilton-Wentworth Catholic District School Board (Client) retained Pinchin Ltd. (Pinchin) to conduct an asbestos building materials reassessment at the subject building.

The objective of the reassessment was to evaluate the condition and quantity of previously reported asbestos-containing materials (ACM), and develop corrective action plans as required for the purposes of long-term management. The results of this reassessment are not intended for construction, renovation, demolition or project tendering purposes.

Summary of Recommendations

The following is a summary of significant recommendations; refer to the body of the report for detailed recommendations:

- Perform a reassessment of asbestos materials on an annual basis.
- Perform a pre-construction assessment and remove all asbestos-containing materials (ACM) prior to alteration or maintenance work if ACM may be disturbed by the work.
- Follow appropriate safe work procedures when handling or disturbing asbestos.
- Sample any presumed ACM prior to alteration or maintenance work if presumed ACM may be disturbed by the work.

This Executive Summary is subject to the same standard limitations as contained in the report and must be read in conjunction with the entire report.



Asbestos Reassessment

St. Michael, 135 Hester Street, Hamilton, Ontario
Hamilton-Wentworth Catholic District School Board

August 30, 2022
Pinchin File: 303992.004

TABLE OF CONTENTS

| | | |
|-----|--|----|
| 1.0 | INTRODUCTION AND SCOPE | 1 |
| 1.1 | Scope of Assessment | 1 |
| 2.0 | BACKGROUND INFORMATION | 1 |
| 2.1 | Building Year of Construction and Additions | 1 |
| 2.2 | Existing Reports | 1 |
| 2.3 | Excluded Asbestos Materials | 2 |
| 2.4 | Confirmed/Presumed Asbestos-Containing Materials and Confirmed Non-Asbestos Materials | 3 |
| 3.0 | RECOMMENDATIONS | 10 |
| 3.1 | General | 10 |
| 3.2 | Remedial Work | 10 |
| 3.3 | On-going Management and Maintenance | 10 |
| 4.0 | TERMS AND LIMITATIONS | 11 |
| 5.0 | REFERENCES | 11 |

APPENDICES

| | |
|--------------|---|
| APPENDIX I | Asbestos Analytical Certificates |
| APPENDIX II | Location List |
| APPENDIX III | Hazardous Materials Summary / Sample Log Report |
| APPENDIX IV | All Data Report |
| APPENDIX V | Drawings |



Asbestos Reassessment

St. Michael, 135 Hester Street, Hamilton, Ontario
Hamilton-Wentworth Catholic District School Board

August 30, 2022
Pinchin File: 303992.004

1.0 INTRODUCTION AND SCOPE

Hamilton-Wentworth Catholic District School Board (Client) retained Pinchin Ltd. (Pinchin) to conduct an asbestos building materials reassessment at St. Michael, located at 135 Hester Street, Hamilton, Ontario.

The reassessment was performed by Luke Thompson, Project Technologist on June 28, 2022.

The objectives of the reassessment were to document the locations, quantities and conditions of previously identified asbestos-containing building materials and develop corrective action plans as required. This reassessment is only to be used for the purposes of long-term management and routine maintenance. The results of this reassessment are not to be used for construction, renovation, demolition or project tendering purposes.

1.1 Scope of Assessment

The objective of the reassessment was to evaluate the condition and quantity of previously reported asbestos-containing materials (ACM's), and develop corrective action plans as required.

Refer to the Asbestos Building Materials Reassessment Methodology report and Annex A dated 2022, Pinchin File 303992.004, for the methodology used during the reassessment.

2.0 BACKGROUND INFORMATION

2.1 Building Year of Construction and Additions

| Item | Details |
|----------------------|---------|
| Year of Construction | 1966 |
| Year(s) of Additions | 2005 |

2.2 Existing Reports

2.2.1 Review of Previous Reports

Pinchin previously prepared the following reports, which have been reviewed and relied upon as part of this assessment:

- Asbestos Assessment, St. Michael, 135 Hester Street, Hamilton, Ontario, August 2018, Prepared by Pinchin Ltd., Pinchin File: 224334.
- Asbestos Reassessment, St. Michael, 135 Hester Street, Hamilton, Ontario, August 2019, Prepared by Pinchin Ltd., Pinchin File: 243241.
- Asbestos Reassessment, St. Michael, 135 Hester Street, Hamilton, Ontario, June 2020, Prepared by Pinchin Ltd., Pinchin File: 272113.



Asbestos Reassessment

St. Michael, 135 Hester Street, Hamilton, Ontario
Hamilton-Wentworth Catholic District School Board

August 30, 2022
Pinchin File: 303992.004

- Bulk Sampling Letter, Exterior Renovations, St. Michael, 135 Hester Street, Hamilton, Ontario, June 3, 2021, Prepared by Pinchin Ltd., Pinchin File: 286533.002.
- Revised Asbestos Reassessment, St. Michael, 135 Hester Street, Hamilton, Ontario, July 2021, Prepared by Pinchin Ltd., Pinchin File: 286533.001.

The following section summarizes the findings of the reassessment and provides a general description of the asbestos materials identified. For details on quantities, assessment, sample numbers, friability, condition, and locations of asbestos materials; refer to the Hazardous Materials Summary / Sample Log Report and All Data Report in Appendices III and IV, respectively.

Previous analytical sample results have been relied upon and were included in the original asbestos assessment report completed by MTE Consultants Inc. Additional samples results where collected by Pinchin have been included in Appendix I.

2.3 Excluded Asbestos Materials



A number of materials which might contain asbestos were not sampled during this reassessment due to limitations in scope and methodology. Where present, these materials are assumed to contain asbestos until otherwise proven by sampling and analysis. These materials are not shown on the drawings in Appendix V. Excluded materials presumed to contain asbestos include:


| Material | Friability |
|--|-------------|
| Roofing, felts and tar | Non-friable |
| Concrete floor levelling compound | Non-friable |
| Electrical components or wiring within control centers, breakers, motors or lights, insulation on wiring | Non-friable |
| Vermiculite in concrete block wall cavities | Friable |
| Adhesives and duct mastics | Non-friable |
| Caulking and butyl seals | Non-friable |
| Fibre reinforced paints and coatings | Non-friable |
| Paper products | Non-friable |
| Soffit and fascia boards | Non-friable |
| Mechanical packing, ropes and gaskets | Non-friable |
| Vinyl baseboards | Non-friable |



| Material | Friability |
|---|-------------|
| Exterior cladding | Non-friable |
| Fire resistant doors or metal clad finishes | Non-friable |
| Vibration dampers on HVAC equipment | Non-friable |
| Ceramic tile thin-set | Non-friable |

2.4 Confirmed/Presumed Asbestos-Containing Materials and Confirmed Non-Asbestos Materials




This section includes materials that have been confirmed asbestos-containing by sample analysis or presumed asbestos-containing by visual identification. Refer to the drawings in Appendix V for the locations of confirmed and presumed ACMs indicated via hatching or symbols. The locations of samples from the historical assessments, performed by Pinchin, have been included on the drawings.


| Material and Application | Asbestos Type/Friability | Photo |
|---|--------------------------|--|
| Parging cement is present on pipe fittings (elbows, valves, tees, hangers etc.) | Chrysotile/Friable |  |
| Sweatwrap insulation (brown layered paper), is present on straight sections of pipes. | None |  |




| Material and Application | Asbestos Type/Friability | Photo |
|--|--------------------------------|--|
| Remaining pipes are either uninsulated or insulated with non-asbestos fibreglass or elastomeric insulation (Armaflex). | None | |
| Ducts are either uninsulated or insulated with non-asbestos fibreglass (foil-faced or canvas). | None | |
| Mechanical equipment is either uninsulated or insulated with non-asbestos fibreglass. | None | |
| All ceiling tiles are determined to be non-asbestos based on previous sampling, the material (gypsum) or presumed to be non-asbestos based on the date of manufacture determined from the date stamp applied to the top of the tiles or the age of the materials determined from the age of the building addition. | None | |
| Textured plaster is present as a soffit finish. | Chrysotile/Potentially Friable |  |
| Smooth plaster present on walls and ceilings does not contain asbestos. | None | |
| Non-asbestos drywall joint compound is present on wall and ceiling finishes. | None | |

| Material and Application | Asbestos Type/Friability | Photo |
|---|--|--|
| Asbestos in drywall joint compound was banned in Canada in 1980. Drywall joint compound in the 2005 addition was installed after 1986 (1980 plus a reasonable non-compliance period based on our experience) and is assumed to contain no asbestos. | None | |
| Vinyl sheet flooring, with an off-white with dark flecks pattern is present. | Presumed/Potentially Friable |  |
| Vinyl floor tiles, 12"x12", beige with white fleck, are present. | Presumed/Non-friable (tile) Presumed/Non-friable (mastic) |  |

| Material and Application | Asbestos Type/Friability | Photo |
|--|--|--|
| Vinyl floor tiles, 12"x12", mint with grey fleck, are present. | Presumed/Non-friable (tile) Presumed/Non-friable (mastic) |  |
| Vinyl floor tiles, 12"x12", beige with grey streak, are present. | Presumed/Non-friable (tile) Presumed/Non-friable (mastic) |  |
| Vinyl floor tiles, 12"x12", beige with brown fleck, are present. | Presumed/Non-friable (tile) Presumed/Non-friable (mastic) |  |

| Material and Application | Asbestos Type/Friability | Photo |
|--|--|--|
| Vinyl floor tiles, 12"x12", beige with orange fleck, are present. | Presumed/Non-friable (tile) Presumed/Non-friable (mastic) |  |
| Vinyl floor tiles, 12"x12", salmon with white fleck, are present. | Presumed/Non-friable (tile) Presumed/Non-friable (mastic) |  |
| Vinyl floor tiles, 12"x12", salmon with brown streak, are present. | Presumed/Non-friable (tile) Presumed/Non-friable (mastic) |  |

| Material and Application | Asbestos Type/Friability | Photo |
|---|--|--|
| Vinyl floor tiles, 12"x12", grey dense flecks, are present. | Presumed/Non-friable (tile) Presumed/Non-friable (mastic) |  |
| Vinyl floor tiles, 12"x12", beige with yellow flecks, are present. | Presumed/Non-friable (tile) Presumed/Non-friable (mastic) |  |
| Vinyl floor tiles, 12"x12", tan with brown, are present. | Presumed/Non-friable (tile) Presumed/Non-friable (mastic) |  |
| <p>Remaining vinyl floor tiles were presumed to be non-asbestos based on historical knowledge of the date of installation.</p> <p>Mastic underneath new vinyl floor tiles (excluding the 2005 addition) is presumed to contain asbestos until</p> | <p>None (tile)</p> <p>Presumed/Non-friable (mastic)</p> | |
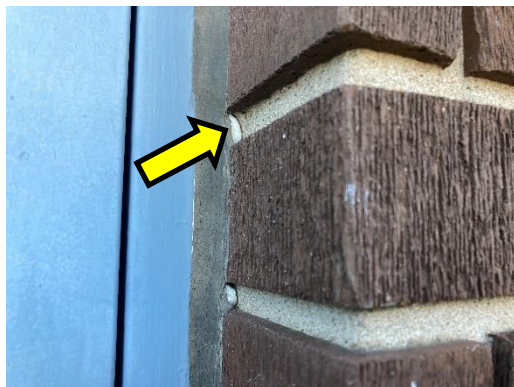
| Material and Application | Asbestos Type/Friability | Photo |
|---|--|--|
| sampling proves otherwise. | | |
| Paper heat shields are present. | Presumed/Non-friable |  |
| Packing is present in an exterior bell and spigot fitting. | Amosite and Chrysotile/Potentially friable |  |
| White caulking is present around an exterior door | Chrysotile/Non-friable |  |
| Non-asbestos caulking is present on the exterior of the building around window frames, door frames, and expansion joints. | None | |



Asbestos Reassessment

St. Michael, 135 Hester Street, Hamilton, Ontario
Hamilton-Wentworth Catholic District School Board

August 30, 2022
Pinchin File: 303992.004

| Material and Application | Asbestos Type/Friability | Photo |
|--|--|-------|
| Destructive testing was conducted in exterior masonry block walls, including creating penetrations at 6 locations. The locations of destructive testing have been indicated on the drawings in Appendix I. | Loose fill vermiculite was not observed within the cavities. | |

Additional notes on the drywall joint compound discussed above:

- Drywall (gypsum board) and drywall joint compound is present as a wall and ceiling finish in the original section of the building. As per the methodology, drywall joint compound is sampled at exterior walls, columns or other locations that are unlikely to have been renovated in an attempt to determine the presence of asbestos in the original drywall compound. A total of 3 samples of drywall joint compound were collected (samples S0003A-C, lab reference no. 71919978) and it was found that all samples do not contain asbestos. Therefore, drywall joint compound present on drywall finishes should be considered to be non-asbestos.

3.0 RECOMMENDATIONS

3.1 General

Perform a detailed intrusive assessment prior to building renovation or demolition operations. The assessment should include; destructive testing (i.e. coring and/or removal of building finishes and components), sampling of other hazardous materials (lead, mercury, PCBs, mould, etc.), and materials not tested in this study (i.e. excluded asbestos materials).

3.2 Remedial Work

There is no remedial work recommended.

3.3 On-going Management and Maintenance

The following recommendations are made regarding on-going management and maintenance work involving the asbestos materials identified.

3.3.1 Asbestos

Maintain the Asbestos Management Program (AMP).

Perform a reassessment of asbestos materials on an annual basis.



Asbestos Reassessment

St. Michael, 135 Hester Street, Hamilton, Ontario
Hamilton-Wentworth Catholic District School Board

August 30, 2022
Pinchin File: 303992.004

Remove asbestos-containing materials (ACM) prior to alteration or maintenance work if ACM may be disturbed by the work. Follow appropriate asbestos precautions for the classification of work being performed.

Sample presumed ACM prior to alteration or maintenance work if the presumed ACM may be disturbed by the work.

Update the asbestos inventory report upon completion of any abatement and removal of asbestos-containing materials.

4.0 TERMS AND LIMITATIONS

This work was performed subject to the Terms and Limitations presented or referenced in the proposal for this project.

Information provided by Pinchin is intended for Client use only. Pinchin will not provide results or information to any party unless disclosure by Pinchin is required by law. Any use by a third party of reports or documents authored by Pinchin or any reliance by a third party on or decisions made by a third party based on the findings described in said documents, is the sole responsibility of such third parties. Pinchin accepts no responsibility for damages suffered by any third party as a result of decisions made or actions conducted. No other warranties are implied or expressed.

5.0 REFERENCES

The following legislation and documents were referenced in completing the assessment and this report:

1. Asbestos on Construction Projects and in Buildings and Repair Operations, Ontario Regulation 278/05.
2. Designated Substances, Ontario Regulation 490/09.

J:\303000s\303992.000 HWCDSB,Various2022Projects,ASB,CONS\303992.004 HWCDSB,AllFacilities,2022,ASB,REASSMT\Deliverables\Elementary\St. Michael\Report\303992.004 St. Michael ACM Reassessment Report HWCDSB Aug 30 2022.docx

Template: Master Report for Asbestos Reassessment, HAZ, April 23, 2019

APPENDIX I
Asbestos Analytical Certificates



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Emily Balfour
Michael Maiorana

Lab Order ID: 71919978
Analysis ID: 71919978_PLM
Date Received: 7/30/2019
Date Reported: 8/5/2019

Project: 230748,135 Hester St, Hamilton, ON,Hamilton-Wentworth Catholic School Board,St. Michael Catholic Elementary School

| Sample ID | Description | Asbestos | Fibrous Components | Non-Fibrous Components | Attributes |
|----------------|--|---------------|--------------------|------------------------|---------------------------------|
| Lab Sample ID | Lab Notes | | | | Treatment |
| S0001A | Textured Plaster, Soffit, Location 1007 | 1% Chrysotile | | 99% Other | White Non Fibrous Heterogeneous |
| 71919978PLM_1 | | | | | Crushed |
| S0001B | Textured Plaster, Soffit, Location 1007 | Not Analyzed | | | |
| 71919978PLM_2 | | | | | |
| S0001C | Textured Plaster, Soffit, Location 1007 | Not Analyzed | | | |
| 71919978PLM_3 | | | | | |
| S0002A - A | Smooth plaster on ceiling, Boy's Washroom, Location 1018 | None Detected | | 100% Other | White Non Fibrous Heterogeneous |
| 71919978PLM_4 | finish | | | | Crushed |
| S0002A - B | Smooth plaster on ceiling, Boy's Washroom, Location 1018 | None Detected | | 100% Other | Tan Non Fibrous Heterogeneous |
| 71919978PLM_14 | base | | | | Crushed |
| S0002B - A | Smooth plaster on wall, Kitchen, Location 1022 | None Detected | | 100% Other | White Non Fibrous Heterogeneous |
| 71919978PLM_5 | finish | | | | Crushed |
| S0002B - B | Smooth plaster on wall, Kitchen, Location 1022 | None Detected | | 100% Other | Tan Non Fibrous Heterogeneous |
| 71919978PLM_15 | base | | | | Crushed |
| S0002C - A | Smooth plaster on ceiling, Main Office, Location 1005 | None Detected | | 100% Other | White Non Fibrous Heterogeneous |
| 71919978PLM_6 | finish | | | | Crushed |

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (20)


Analyst

Approved Signatory



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E

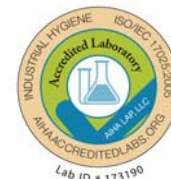

Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Emily Balfour
Michael Maiorana

Lab Order ID: 71919978
Analysis ID: 71919978_PLM
Date Received: 7/30/2019
Date Reported: 8/5/2019

Project: 230748,135 Hester St, Hamilton, ON,Hamilton-Wentworth Catholic School Board,St.
Michael Catholic Elementary School

| Sample ID | Description | Asbestos | Fibrous Components | Non-Fibrous Components | Attributes |
|----------------|--|---------------|--------------------|------------------------|---------------------------------------|
| Lab Sample ID | Lab Notes | | | | Treatment |
| S0002C - B | Smooth plaster on ceiling, Main Office, Location 1005 | None Detected | | 100% Other | Tan Non Fibrous Heterogeneous |
| 71919978PLM_16 | base | | | | Crushed |
| S0002D - A | Smooth plaster on ceiling, Classroom 2, Location 1015 | None Detected | | 100% Other | White Non Fibrous Heterogeneous |
| 71919978PLM_7 | finish | | | | Crushed |
| S0002D - B | Smooth plaster on ceiling, Classroom 2, Location 1015 | None Detected | | 100% Other | Tan Non Fibrous Heterogeneous |
| 71919978PLM_17 | base | | | | Crushed |
| S0002E - A | Smooth plaster on ceiling, Women's Staff Washroom, Location 1012 | None Detected | | 100% Other | White Non Fibrous Heterogeneous |
| 71919978PLM_8 | finish | | | | Crushed |
| S0002E - B | Smooth plaster on ceiling, Women's Staff Washroom, Location 1012 | None Detected | | 100% Other | Tan Non Fibrous Heterogeneous |
| 71919978PLM_18 | base | | | | Crushed |
| S0002F - A | Smooth plaster on wall above door, Stairwell, Location 2002 | None Detected | | 100% Other | White Non Fibrous Heterogeneous |
| 71919978PLM_9 | finish | | | | Crushed |
| S0002F - B | Smooth plaster on wall above door, Stairwell, Location 2002 | None Detected | | 100% Other | Tan Non Fibrous Heterogeneous |
| 71919978PLM_19 | base | | | | Crushed |
| S0002G - A | Smooth plaster on ceiling, Boy's Washroom, Location 2008 | None Detected | | 100% Other | White Non Fibrous Heterogeneous |
| 71919978PLM_10 | finish | | | | Crushed |

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Charmel Dozier (20)

Analyst

Approved Signatory



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Emily Balfour
Michael Maiorana

Lab Order ID: 71919978
Analysis ID: 71919978_PLM
Date Received: 7/30/2019
Date Reported: 8/5/2019

Project: 230748,135 Hester St, Hamilton, ON,Hamilton-Wentworth Catholic School Board,St. Michael Catholic Elementary School

| Sample ID | Description | Asbestos | Fibrous Components | Non-Fibrous Components | Attributes |
|----------------|--|---------------|--------------------|------------------------|---------------------------------------|
| Lab Sample ID | Lab Notes | | | | Treatment |
| S0002G - B | Smooth plaster on ceiling, Boy's Washroom, Location 2008 | None Detected | | 100% Other | Tan Non Fibrous Heterogeneous |
| 71919978PLM_20 | base | | | | Crushed |
| S0003A | DJC on wall, Kitchen, Location 1022 | None Detected | | 100% Other | White Non Fibrous Heterogeneous |
| 71919978PLM_11 | | | | | Crushed |
| S0003B | DJC on wall, Library, Location 1040 | None Detected | | 100% Other | White Non Fibrous Heterogeneous |
| 71919978PLM_12 | | | | | Crushed |
| S0003C | DJC on column, Classroom 2, Location 1015 | None Detected | | 100% Other | White Non Fibrous Heterogeneous |
| 71919978PLM_13 | | | | | Crushed |

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.


Charmel Dozier (20)

Analyst

Approved Signatory

71919978

Version 1-15-2012

| | | | |
|------------------------|---|---|--|
| Client: | Pinchin Ltd. | *Instructions: Use Column "B" for your contact info To See an Example Click the bottom Example Tab. Enter samples between "<<" and ">>" Begin Samples with a "<<" above the first sample and end with a ">>" below the last sample. Only Enter your data on the first sheet "Sheet1" Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data. | Invoice to: |
| Contact: | Emily Balfour | | ap@pinchin.com |
| Address: | 6-875 Main Street West, Suite 200, Hamilton ON L8S 4P9 | |  Scientific Analytical Institute 4604 Dundas Dr. Greensboro, NC 27407 Phone: 336.292.3888 Fax: 336.292.3313 Email: lab@sailab.com |
| Phone: | 905-577-6206 | | |
| Fax: | 905-577-6207 | | |
| Email: | ebalfour@pinchin.com mmaiorana@pinchin.com | | |
| Project: | 230748, 135 Hester St, Hamilton, ON, Hamilton-Wentworth Catholic School Board, St. Michael Catholic Elementary School | | |
| Client Notes: | | | |
| P.O. #. | 230748 | | |
| Date Submitted: | July 29, 2019 | | |
| Analysis: | PLM - Stop Positive EXCEPT S0003 | | |
| TurnAroundTime: | 4days | | |

| Sample Number | Data 1 (Lab use only) | Sample Description | Data 2 (Lab use only) |
|---------------|-----------------------|--------------------|-----------------------|
|---------------|-----------------------|--------------------|-----------------------|

| | | | |
|--------|--|--|--|
| << | | | |
| S0001A | | Textured Plaster, Soffit, Location 1007 | |
| S0001B | | Textured Plaster, Soffit, Location 1007 | |
| S0001C | | Textured Plaster, Soffit, Location 1007 | |
| S0002A | | Smooth plaster on ceiling, Boy's Washroom, Location 1018 | |
| S0002B | | Smooth plaster on wall, Kitchen, Location 1022 | |
| S0002C | | Smooth plaster on ceiling, Main Office, Location 1005 | |
| S0002D | | Smooth plaster on ceiling, Classroom 2, Location 1015 | |
| S0002E | | Smooth plaster on ceiling, Women's Staff Washroom, Location 2012 | |
| S0002F | | Smooth plaster on wall above door, Stairwell, Location 2002 | |
| S0002G | | Smooth plaster on ceiling, Boy's Washroom, Location 2008 | |
| S0003A | | DJC on wall, Kitchen, Location 1022 | |
| S0003B | | DJC on wall, Library, Location 1040 | |
| S0003C | | DJC on column, Classroom 2, Location 1015 | |
| >> | | | |

Accepted ☒

Rejected ☐

N. Franco 7/30 10:30A



Pinchin Ltd. Asbestos Laboratory *Certificate of Analysis*

| | | | |
|--------------------|--|----------------------|--------------|
| Project Name: | Hamilton-Wentworth Catholic School Board, St. Michael Catholic Elementary School, 135 Hester St, Hamilton, ON | | |
| Project No.: | 0272113.000 | | |
| Prepared For: | E. Balfour / M. Maiorana | | |
| Lab Reference No.: | b230666 | Date Received: | May 21, 2020 |
| Analyst(s): | K. Cockburn | Date Analyzed: | June 1, 2020 |
| | | # Samples submitted: | 6 |
| | | # Phases analyzed: | 7 |

Method of Analysis:

EPA 600/R-93/116 - Method for the Determination of Asbestos in Bulk Building Materials dated July, 1993

Bulk samples are checked visually and scanned under a stereomicroscope. Slides are prepared and observed under a Polarized Light Microscope (PLM) at magnifications of 40X, 100X or 400X as appropriate. Asbestos fibres are identified by a combination of morphology, colour, refractive index, extinction, sign of elongation, birefringence and dispersion staining colours. A visual estimate is made of the percentage of asbestos present. A reported concentration of less than (<) the regulatory threshold (see chart below) indicates the presence of confirmed asbestos in trace quantities, limited to only a few fibres or fibre bundles in an entire sample. This method complies with provincial regulatory requirements where applicable. Multiple phases within a sample are analyzed and reported separately.

All bulk samples submitted to this laboratory for asbestos analysis are retained for a minimum of three months. Samples may be retrieved, upon request, for re-examination at any time during that period.

The Pinchin Ltd. Mississauga asbestos laboratory is accredited by the National Institute of Standards and Technology, National Voluntary Laboratory Accreditation Program (NVLAP Lab Code 101270-0) for the 'EPA – 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples,' and the 'EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials'; and meets all requirements of ISO/IEC 17025:2005.

This report relates only to the items tested.

NOTE: *This test report may not be reproduced, except in full, without the written approval of the laboratory. The client may not use this report to claim product endorsement by NVLAP or any agency of the U.S. Government. This report is valid only when signed in blue ink by the analyst. Vinyl asbestos floor tiles contain very fine fibres of asbestos and may be missed by some laboratories using the PLM method. Internal verification studies performed by Pinchin indicate that the chance of missing asbestos in floor tiles is no higher than about 2%. The vinyl tile study and laboratory documentation on measurement uncertainty is available upon request. The analysis of dust samples by PLM cannot be used as an indicator of past or present airborne asbestos fibre levels.*



Pinchin Ltd. Asbestos Laboratory

Certificate of Analysis

Project Name: Hamilton-Wentworth Catholic School Board,
 St. Michael Catholic Elementary School, 135 Hester St, Hamilton, ON
Project No.: 0272113.000
Prepared For: E. Balfour / M. Maiorana

Lab Reference No.: b230666
Date Analyzed: June 1, 2020

BULK SAMPLE ANALYSIS

| SAMPLE IDENTIFICATION | SAMPLE DESCRIPTION | % COMPOSITION (VISUAL ESTIMATE) | | | |
|--|--|---------------------------------|--------|--|------------------|
| | | ASBESTOS | | OTHER | |
| S0004A Parging cement, Corridor, Location 1003 | Homogeneous, grey, soft, parging cement. | Chrysotile | 50-75% | Non-Fibrous Material | 25-50% |
| S0004B Parging cement, Corridor, Location 1003 | | | | Not Analyzed | |
| Comments: | Analysis was stopped due to a previous positive result. | | | | |
| S0004C Parging cement, Corridor, Location 1003 | | | | Not Analyzed | |
| Comments: | Analysis was stopped due to a previous positive result. | | | | |
| S0005A Sweatwrap, Corridor, Location 2005 | 2 Phases: a) Homogeneous, beige, dimpled, layered paper. b) Homogeneous, black, layered paper. | None Detected | | Cellulose Non-Fibrous Material | > 75% 0.5-5% |
| | | None Detected | | Cellulose Tar and other non- fibrous | 50-75% 25-50% |
| S0005B Sweatwrap, Corridor, Location 2005 | 2 Phases: a) Homogeneous, beige, dimpled, layered paper. b) Homogeneous, black, layered paper. | None Detected | | Cellulose Non-Fibrous Material | > 75% 0.5-5% |
| | | None Detected | | Cellulose Tar and other non- fibrous | 50-75% 25-50% |



Pinchin Ltd. Asbestos Laboratory
Certificate of Analysis

Project Name: Hamilton-Wentworth Catholic School Board,
St. Michael Catholic Elementary School, 135 Hester St, Hamilton, ON
Project No.: 0272113.000
Prepared For: E. Balfour / M. Maiorana
Lab Reference No.: b230666
Date Analyzed: June 1, 2020

BULK SAMPLE ANALYSIS

| SAMPLE IDENTIFICATION | SAMPLE DESCRIPTION | % COMPOSITION (VISUAL ESTIMATE) | |
|---|--|---------------------------------|--|
| | | ASBESTOS | OTHER |
| S0005C Sweatwrap, Corridor, Location 2005 | 2 Phases: a) Homogeneous, beige, dimpled, layered paper. | None Detected | Cellulose > 75% Non-Fibrous Material 0.5-5% |
| | b) Homogeneous, black, layered paper. | None Detected | Cellulose 50-75% Tar and other non- fibrous 25-50% |

Reviewed by:

Reporting Analyst:



Analyzed by: *KC*
Reviewed by: *KB*
Report Sent by: *19*



Instructions:

**Pinchin Ltd. - Asbestos Laboratory
Internal Asbestos Bulk Sample Chain of Custody**

| | | | |
|---|--|-------------------------|-----------------------------|
| Client Name: | Hamilton-Wentworth Catholic School Board | Project Address: | 135 Hester St, Hamilton, ON |
| Portfolio/Building No: | St. Michael Catholic Elementary School | Pinchin File: | 272113 |
| Submitted by: | Emily Balfour | Email: | ebalfour@pinchin.com |
| CC Results to: | Michael Maiorana | CC Email: | mmaiorana@pinchin.com |
| Invoice to: | Accounts Payable | Invoice Email: | ap@pinchin.com |
| Date Submitted: | May 19 2020 | Required by: | May 26 2020 |
| # of Samples: | 6 | Priority: | 5 Day Turnaround |
| Year of Building Construction (Mandatory Field): | | 1966 | |
| Do NOT Stop on Positive (Sample Numbers): | | | |
| Pinchin Group Company (Mandatory Field): | | Pinchin | |

| To be Completed by Lab Personnel Only: | | | |
|---|-------------|---------------|--|
| Lab Reference #: | b230666 dk | | Time: 24 hour clock |
| Received by: | MAY 21 2020 | | Date: Month Day Year |
| Name(s) of Analyst(s): KC 2020/06/01 | | | |
| Sample Prefix | Sample No. | Sample Suffix | Sample Description/Location (Mandatory) |
| | S0004 | A | Parging cement, Corridor, Location 1003 CH50-757 |
| | S0004 | B | Parging cement, Corridor, Location 1003 - NA - |
| | S0004 | C | Parging cement, Corridor, Location 1003 - NA - |
| | S0005 | A | Sweatwrap, Corridor, Location 2005 a) ND b) ND |
| | S0005 | B | Sweatwrap, Corridor, Location 2005 a) ND b) ND |
| | S0005 | C | Sweatwrap, Corridor, Location 2005 a) ND b) ND |



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Matt Pitman
Emily Balfour

Lab Order ID: 71965751
Analysis ID: 71965751_PLM
Date Received: 5/17/2021
Date Reported: 5/19/2021

Project: HWCDSB 135 Hester Street, ON, Hamilton St. Michael Catholic School 286533.002

| Sample ID | Description | Asbestos | Fibrous Components | Non-Fibrous Components | Attributes |
|---------------|---|---------------|--------------------|------------------------|-------------------------------------|
| Lab Sample ID | Lab Notes | | | | Treatment |
| S0006A | Wall,Caulking,Brown Caulking,Loc:1041,Exterior - Old Section | None Detected | | 100% Other | Black Non Fibrous Homogeneous |
| 71965751PLM_1 | | | | | Ashed |
| S0006B | Wall,Caulking,Brown Caulking,Loc:1041,Exterior - Old Section | None Detected | | 100% Other | Black Non Fibrous Homogeneous |
| 71965751PLM_2 | | | | | Ashed |
| S0006C | Wall,Caulking,Brown Caulking,Loc:1041,Exterior - Old Section | None Detected | | 100% Other | Black Non Fibrous Homogeneous |
| 71965751PLM_3 | | | | | Ashed |
| S0007A | Wall,Caulking,Light Grey Caulking,Loc:1041,Exterior - Old Section | None Detected | | 100% Other | Gray Non Fibrous Homogeneous |
| 71965751PLM_4 | | | | | Ashed |
| S0007B | Wall,Caulking,Light Grey Caulking,Loc:1041,Exterior - Old Section | None Detected | | 100% Other | Gray Non Fibrous Homogeneous |
| 71965751PLM_5 | | | | | Ashed |
| S0007C | Wall,Caulking,Light Grey Caulking,Loc:1041,Exterior - Old Section | None Detected | | 100% Other | Gray Non Fibrous Homogeneous |
| 71965751PLM_6 | | | | | Ashed |
| S0008A | Wall,Caulking,Dark Grey Caulking,Loc:1041,Exterior - Old Section | None Detected | | 100% Other | Gray Non Fibrous Homogeneous |
| 71965751PLM_7 | | | | | Ashed |
| S0008B | Wall,Caulking,Dark Grey Caulking,Loc:1041,Exterior - Old Section | None Detected | | 100% Other | Gray Non Fibrous Homogeneous |
| 71965751PLM_8 | | | | | Ashed |

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAL. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Yanelis Delgado (21)

Analyst

Approved Signatory



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Matt Pitman
Emily Balfour

Lab Order ID: 71965751
Analysis ID: 71965751_PLM
Date Received: 5/17/2021
Date Reported: 5/19/2021

Project: HWCDSB 135 Hester Street, ON, Hamilton St. Michael Catholic School 286533.002

| Sample ID | Description | Asbestos | Fibrous Components | Non-Fibrous Components | Attributes |
|----------------|--|---------------|--------------------|------------------------|-------------------------------------|
| Lab Sample ID | Lab Notes | | | | Treatment |
| S0008C | Wall,Caulking,Dark Grey Caulking,Loc:1041,Exterior - Old Section | None Detected | | 100% Other | Gray Non Fibrous Homogeneous |
| 71965751PLM_9 | | | | | Ashed |
| S0009A | Wall,Caulking,Beige Caulking,Loc:1041,Exterior - Old Section | None Detected | | 100% Other | Gray Non Fibrous Homogeneous |
| 71965751PLM_10 | | | | | Ashed |
| S0009B | Wall,Caulking,Beige Caulking,Loc:1041,Exterior - Old Section | None Detected | | 100% Other | Gray Non Fibrous Homogeneous |
| 71965751PLM_11 | | | | | Ashed |
| S0009C | Wall,Caulking,Beige Caulking,Loc:1041,Exterior - Old Section | None Detected | | 100% Other | Gray Non Fibrous Homogeneous |
| 71965751PLM_12 | | | | | Ashed |
| S0010A | Wall,Caulking,White Caulking,Loc:1041,Exterior - Old Section | 5% Chrysotile | | 95% Other | White Non Fibrous Homogeneous |
| 71965751PLM_13 | | | | | Ashed |
| S0010B | Wall,Caulking,White Caulking,Loc:1041,Exterior - Old Section | Not Analyzed | | | |
| 71965751PLM_14 | | | | | |
| S0010C | Wall,Caulking,White Caulking,Loc:1041,Exterior - Old Section | Not Analyzed | | | |
| 71965751PLM_15 | | | | | |
| S0011A | Wall,Caulking,White Caulking,Loc:1042,Exterior - Addition | None Detected | | 100% Other | Gray Non Fibrous Homogeneous |
| 71965751PLM_16 | | | | | Ashed |

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAL. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Yanelis Delgado (21)

Analyst

Approved Signatory



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E,
App.E



Customer: Pinchin Ltd.
6-875 Main St West
Suite 200
Hamilton, Ontario L8S 4P9

Attn: Matt Pitman
Emily Balfour

Project: HWCDSB 135 Hester Street, ON, Hamilton St. Michael Catholic School 286533.002

Lab Order ID: 71965751
Analysis ID: 71965751_PLM
Date Received: 5/17/2021
Date Reported: 5/19/2021

| Sample ID | Description | Asbestos | Fibrous Components | Non-Fibrous Components | Attributes |
|----------------|--|-------------------------------|--------------------|------------------------|--------------------------------------|
| Lab Sample ID | Lab Notes | | | | Treatment |
| S0011B | Wall,Caulking,White Caulking,Loc:1042,Exterior - Addition | None Detected | | 100% Other | Gray Non Fibrous Homogeneous |
| 71965751PLM_17 | | | | | Ashed |
| S0011C | Wall,Caulking,White Caulking,Loc:1042,Exterior - Addition | None Detected | | 100% Other | Gray Non Fibrous Homogeneous |
| 71965751PLM_18 | | | | | Ashed |
| S0012A | Wall,Unidentified Material,Bell And Spigot Packing,Loc:1041,Exterior - O | 20% Amosite 10% Chrysotile | | 70% Other | Gray Non Fibrous Heterogeneous |
| 71965751PLM_19 | | | | | Crushed |
| S0012B | Wall,Unidentified Material,Bell And Spigot Packing,Loc:1041,Exterior - O | Not Analyzed | | | |
| 71965751PLM_20 | | | | | |
| S0012C | Wall,Unidentified Material,Bell And Spigot Packing,Loc:1041,Exterior - O | Not Analyzed | | | |
| 71965751PLM_21 | | | | | |

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Yanelis Delgado (21)

Analyst

Approved Signatory

Waiting on Ecoc.

by: 11965751

Pinchin Ltd. - Asbestos Laboratory
Internal Asbestos Bulk Sample Chain of Custody

| Client Name: | HWCDSD | Project Address: | 135 Hester Street, ON, Hamilton |
|---|-----------------------------|-------------------------|---|
| Portfolio/Building No: | St. Michael Catholic School | Pinchin File: | 286533.002 |
| Submitted by: | Matt Pitman | Email: | mpitman@pinchin.com |
| CC Results to: | Emily Balfour | CC Email: | ebalfour@pinchin.com |
| Date Submitted: | May 13 2021 | Required by: | May 20 2021 |
| # of Samples: | 21 | Priority: | 5 Day Turnaround |
| Year of Building Construction (Mandatory, Years ONLY): | 1966 | | |
| Do NOT Stop on Positive (Sample Numbers): | | | |
| Pinchin Group Company (Mandatory Field): | Pinchin | | |
| HMIS2 Building Reference #: | 23604/201807063683556 | | |
| To be Completed by Lab Personnel Only: | | | |
| Lab Reference #: | | Time: | 24 hour clock |
| Received by: | | Date: | Month Day Year |
| Name(s) of Analyst(s): | | | |
| Sample Prefix | Sample No. | Sample Suffix | Sample Description/Location (Mandatory) |
| S | 0006 | A | Wall,Caulking,Brown Caulking,Loc:1041,Exterior - Old Section |
| S | 0006 | B | Wall,Caulking,Brown Caulking,Loc:1041,Exterior - Old Section |
| S | 0006 | C | Wall,Caulking,Brown Caulking,Loc:1041,Exterior - Old Section |
| S | 0007 | A | Wall,Caulking,Light Grey Caulking,Loc:1041,Exterior - Old Section |
| S | 0007 | B | Wall,Caulking,Light Grey Caulking,Loc:1041,Exterior - Old Section |
| S | 0007 | C | Wall,Caulking,Light Grey Caulking,Loc:1041,Exterior - Old Section |
| S | 0008 | A | Wall,Caulking,Dark Grey Caulking,Loc:1041,Exterior - Old Section |
| S | 0008 | B | Wall,Caulking,Dark Grey Caulking,Loc:1041,Exterior - Old Section |
| S | 0008 | C | Wall,Caulking,Dark Grey Caulking,Loc:1041,Exterior - Old Section |
| S | 0009 | A | Wall,Caulking,Beige Caulking,Loc:1041,Exterior - Old Section |

Accepted

Rejected

5/17

10/17

| | | | |
|---|------|---|---|
| S | 0009 | B | Wall,Caulking,Beige Caulking,Loc:1041,Exterior - Old Section |
| S | 0009 | C | Wall,Caulking,Beige Caulking,Loc:1041,Exterior - Old Section |
| S | 0010 | A | Wall,Caulking,White Caulking,Loc:1041,Exterior - Old Section |
| S | 0010 | B | Wall,Caulking,White Caulking,Loc:1041,Exterior - Old Section |
| S | 0010 | C | Wall,Caulking,White Caulking,Loc:1041,Exterior - Old Section |
| S | 0011 | A | Wall,Caulking,White Caulking,Loc:1042,Exterior - Addition |
| S | 0011 | B | Wall,Caulking,White Caulking,Loc:1042,Exterior - Addition |
| S | 0011 | C | Wall,Caulking,White Caulking,Loc:1042,Exterior - Addition |
| S | 0012 | A | Wall,Unidentified Material,Bell and Spigot Packing,Loc:1041,Exterior - Addition |
| S | 0012 | B | Wall,Unidentified Material,Bell and Spigot Packing,Loc:1041,Exterior - Addition |
| S | 0012 | C | Wall,Unidentified Material,Bell and Spigot Packing,Loc:1041,Exterior - Addition |

APPENDIX II
Location List

Client: Hamilton-Wentworth Catholic District Sch
Building Name: St. Michael
Survey Date: 2018-07-13

Site: 135 Hester Street, Hamilton, ON
Last Re-Assessment: 2022-06-29

| Location No. | Name or Description | Area ft ² | Floor No. | Bldg. Phase | Notes |
|--------------|--|----------------------|-----------|-------------|-------|
| 1 | Presumed Asbestos-Containing Materials | 0 | | A | |
| 1000 | Classroom 7 | 0 | 1 | A | |
| 1001 | Stairwell 1 | 0 | 1 | A | |
| 1002 | Classroom 6 | 0 | 1 | A | |
| 1003 | Corridor | 0 | 1 | A | |
| 1004 | Classroom 5 | 0 | 1 | A | |
| 1005 | Main Office | 0 | 1 | A | |
| 1006 | Principals Office | 0 | 1 | A | |
| 1007 | Front Entrance | 0 | 1 | A | |
| 1008 | Corridor | 0 | 1 | A | |
| 1009 | Girls Washroom | 0 | 1 | A | |
| 1010 | Staff Room | 0 | 1 | A | |
| 1011 | Classroom 3 | 0 | 1 | A | |
| 1012 | Classroom 1 | 0 | 1 | A | |
| 1013 | Storage | 0 | 1 | A | |
| 1014 | Stairwell 2 | 0 | 1 | A | |
| 1015 | Classroom 2 | 0 | 1 | A | |
| 1016 | Classroom 4 | 0 | 1 | A | |
| 1017 | Boiler Room | 0 | 1 | A | |
| 1018 | Boys Washroom | 0 | 1 | A | |
| 1019 | Special Needs Washroom | 0 | 1 | A | |
| 1020 | corridor | 0 | 1 | A | |
| 1021 | Back Room | 0 | 1 | A | |
| 1022 | Kitchen | 0 | 1 | A | |
| 1023 | Electrical Room | 0 | 1 | A | |
| 1024 | Library Storage | 0 | 1 | A | |
| 1025 | Corridor | 0 | 1 | A | |
| 1026 | Storage | 0 | 1 | A | |
| 1027 | Corridor | 0 | 1 | A | |
| 1028 | Computer Lab | 0 | 1 | A | |
| 1029 | Corridor | 0 | 1 | A | |
| 1030 | Gym Corridor | 0 | 1 | A | |
| 1031 | Boys Washroom | 0 | 1 | A | |
| 1032 | Boys Shower | 0 | 1 | A | |
| 1033 | Girls' Washroom | 0 | 1 | A | |
| 1034 | Girls Shower | 0 | 1 | A | |
| 1035 | Gym Kitchen | 0 | 1 | A | |
| 1036 | Gym Storage | 0 | 1 | A | |
| 1037 | Gymnasium | 0 | 1 | A | |
| 1039 | Vice Principal Office | 0 | 1 | A | |
| 1040 | Library | 0 | 1 | A | |
| 1041 | Exterior - Original | 0 | 1 | A | |
| 1042 | Exterior - Addition | 0 | 1 | A | |
| 2000 | Classroom 14 | 0 | 1 | A | |
| 2001 | Classroom 12 | 0 | 1 | A | |
| 2002 | Stairwell | 0 | 1 | A | |
| 2003 | Classroom 15 | 0 | 1 | A | |
| 2004 | Classroom 13 | 0 | 1 | A | |
| 2005 | Corridor | 0 | 1 | A | |
| 2006 | Corridor | 0 | 1 | A | |
| 2007 | Stairwell | 0 | 1 | A | |
| 2008 | Boys Washroom | 0 | 1 | A | |
| 2009 | French Resource | 0 | 1 | A | |
| 2010 | Staff Room | 0 | 1 | A | |
| 2011 | Staff Washroom | 0 | 1 | A | |
| 2012 | Womans Staff Washroom | 0 | 1 | A | |
| 2013 | Classroom 11 | 0 | 2 | A | |
| 2014 | Classroom 10 | 0 | 2 | A | |
| 2015 | Storage | 0 | 2 | A | |
| 2016 | Storage Sink Room | 0 | 2 | A | |
| 2017 | Washroom | 0 | 2 | A | |
| 2018 | Classroom 8 | 0 | 2 | A | |

| Location No. | Name or Description | Area ft ² | Floor No. | Bldg. Phase | Notes |
|--------------|---------------------|----------------------|-----------|-------------|-------|
| 2019 | Classroom 9 | 0 | 2 | A | |
| 2020 | Stairwell | 0 | 2 | A | |
| 2021 | Girl's Washroom | 0 | 2 | A | |
| 2022 | Storage | 0 | 2 | A | |

APPENDIX III

Hazardous Materials Summary / Sample Log Report

Client: Hamilton-Wentworth Catholic District Sch

Site: 135 Hester Street, Hamilton, ON

Building Name: St. Michael

Survey Date: 2018-07-13

| HAZMAT | Sample No | System/Component/Material/Sample Description | Locations | Bldg. Phase | LF | SF | EA | % | Type | Positive | Friability |
|----------|---------------|--|--|-------------|----|----|----|-----|-------------------|----------|------------|
| Asbestos | S0001 ABC | Ceiling Soffit Plaster | 1041 | A | 0 | 0 | 0 | 100 | Chrysotile | Yes | PF |
| Asbestos | S0002 ABCDEFG | Ceiling, Wall, Ceiling, Wall Plaster | 1001,1005,1006,1009,1010,1014,1015,1018,1019 1021,1022,1023,2002,2008,2011,2012,2016,2017 2021 | A | 0 | 0 | 0 | 100 | None Detected | No | |
| Asbestos | S0003 ABC | Wall, Ceiling, Wall Column, Bulkhead, Column Drywall And Joint Compound | 1000,1005,1006,1012,1015,1016,1022,1023,1024 1026,1028,1039,1040 | A | 0 | 0 | 0 | 100 | None Detected | No | |
| Asbestos | S0004 ABC | Piping Parging Cement | 1003,1018 | A | 0 | 0 | 17 | 0 | Chrysotile | Yes | F |
| Asbestos | S0005 ABC | Piping Rain Water Leader Sweatwrap | 2005 | A | 5 | 0 | 0 | 0 | None Detected | No | |
| Asbestos | S0006 ABC | Wall Caulking Brown Caulking | 1041 | A | 0 | 0 | 0 | 100 | None Detected | No | |
| Asbestos | S0007 ABC | Wall Caulking Light Grey Caulking | 1041 | A | 0 | 0 | 0 | 100 | None Detected | No | |
| Asbestos | S0008 ABC | Wall Caulking Dark Grey Caulking | 1041 | A | 0 | 0 | 0 | 100 | None Detected | No | |
| Asbestos | S0009 ABC | Wall Caulking Beige Caulking | 1041 | A | 0 | 0 | 0 | 100 | None Detected | No | |
| Asbestos | S0010 ABC | Wall Caulking White Caulking | 1041 | A | 60 | 0 | 0 | 0 | Chrysotile | Yes | NF |
| Asbestos | S0011 ABC | Wall Caulking White Caulking | 1042 | A | 0 | 0 | 0 | 100 | None Detected | No | |
| Asbestos | S0012 ABC | Wall Unidentified Material Bell And Spigot Packing | 1041 | A | 0 | 0 | 0 | 100 | Amosite | Yes | [PF]* |
| Asbestos | V9500 | Floor Mastic | 1000,1011,1012,1013,1015,1016,1023,1024,1026 1028,1040,2003,2009,2013,2014,2015,2018,2019 2022 | A | 0 | 0 | 0 | 100 | Presumed Asbestos | Yes | NF |
| Asbestos | V9500 | Floor Vinyl Floor Tile (no Mastic) 12" X 12" Beige With Yellow Fleck, 12" X 12" Salmon With Brown Streak, 12x12 Beige W Yellow Fleck, Tan W Brown | 2001,2015,2018,2019,2022 | A | 0 | 2 | 5 | 100 | Presumed Asbestos | Yes | NF |
| Asbestos | V9500 | Floor Vinyl Floor Tile And Mastic 12" X 12" Beige With Brown Fleck, 12" X 12" Beige With Grey Streak, 12" X 12" Beige With Orange Fleck, 12" X 12" Beige With White Fleck, 12" X 12" Beige With Yellow Fleck, 12" X 12" Grey Dense Flecks, 12" X 12" Mint With Grey Fleck, 12" X 12" Salmon With Brown Streak, 12" X 12" Salmon With White Fleck | 1002,1004,1009,1010,2000,2004 | A | 0 | 0 | 0 | 100 | Presumed Asbestos | Yes | NF |
| Asbestos | V9500 | Floor Vinyl Sheet Flooring Off-white With Dark Flecks | 2001 | A | 0 | 0 | 0 | 100 | Presumed Asbestos | Yes | PF |
| Asbestos | V9500 | Other Door, Window Caulking | 1 | A | 0 | 0 | 0 | 100 | Presumed Asbestos | Yes | NF |
| Asbestos | V9500 | Other Electrical Equipment Cement Product | 1 | A | 0 | 0 | 0 | 100 | Presumed | Yes | NF |

| HAZMAT | Sample No | System/Component/Material/Sample Description | Locations | Bldg. Phase | LF | SF | EA | % | Type | Positive | Friability |
|----------|-----------|--|--|-------------|----|----|----|-----|-------------------|----------|------------|
| Asbestos | V9500 | Other Electric Light Fixture Paper | 1016 | A | 0 | 0 | 1 | 0 | Presumed Asbestos | Yes | NF |
| Asbestos | V9500 | Other Roof Roofing Material | 1 | A | 0 | 0 | 0 | 100 | Presumed Asbestos | Yes | NF |
| Asbestos | V9500 | Other Electrical Wire Textile | 1 | A | 0 | 0 | 0 | 100 | Presumed Asbestos | Yes | NF |
| Asbestos | V9500 | Wall Metal Suspect Materials Behind Metal Cladding | 1041 | A | 0 | 0 | 0 | 100 | Presumed Asbestos | Yes | [PF]* |
| Asbestos | V9500 | Wall Vermiculite/concrete Block Walls | 1 | A | 0 | 0 | 0 | 100 | Presumed Asbestos | Yes | F |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) | 1012 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2' X 4' Dense Fleck (2005) | 1040 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2' X 4' Pinhole And Round Flecks (2012) | 1008 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2' X 4' Short Fissure Random Pinhole (2005) | 1005 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2' X 4' Flat Face | 1033 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2' X 4' Flat Face (gypsum) | 1031 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2' X 4' Long | 2006 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2' X 4' Long Fissure Random Pinhole (2012) | 1013,1021,1027,1030 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2' X 4' Pinhole And Round Flecks (2012) | 1010 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2' X 4' Short Fissure Random Pinhole (2005) | 1001,1003,1013,1020,1024,1025,1026,1029,1039 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2' X 4' Smooth Gypsum Board | 1019 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2' X 4' Textured Pinhole | 2005,2006 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2' X 4' Textured Pinhole (fiberglass) | 1014 | A | 0 | 0 | 0 | 0 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2x4 Short Fissure Random Pinhole (2005) | 1006 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) 2x4 Pinhole And Small Fleck (new) | 1011 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Ceiling Tiles (lay-in) Long | 2005,2015 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Ceiling Drywall And Joint Compound | 1032,1034,1035 | A | 0 | 0 | 0 | 100 | Non | No | |

| HAZMAT | Sample No | System/Component/Material/Sample Description | Locations | Bldg. Phase | LF | SF | EA | % | Type | Positive | Friability |
|----------|-----------|--|--|-------------|----|----|----|-----|--------------|----------|------------|
| Asbestos | V0000 | Ceiling Masonry | 1006,2019 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Floor Carpet | 1005,1039,1040,2019 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Floor Ceramic Tiles | 1025,1027,1029,1032,1034 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Floor Concrete (poured) | 1017 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Floor Terrazzo | 1001,1003,1007,1008,1014,1018,1019,1020,1021 1022,2002,2005,2006,2007,2008,2011,2012,2016 2017,2020,2021 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Floor Vinyl Floor Tile (no Mastic) 12" X 12" Beige With Brown Fleck (2006) | 2003 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Floor Vinyl Floor Tile (no Mastic) 12" X 12" Beige With Brown Fleck (2015) | 1012,1013,1015,1016 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Floor Vinyl Floor Tile (no Mastic) 12" X 12" Beige With White Fleck | 1028 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Floor Vinyl Floor Tile (no Mastic) 12" X 12" Beige With White Fleck (2006) | 1023,1024,1026,1040 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Floor Vinyl Floor Tile (no Mastic) 12" X 12" Brown With Brown Fleck (2015) | 1000 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Floor Vinyl Floor Tile (no Mastic) 12" X 12" Grey With Grey Fleck (2006) | 1036 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Floor Vinyl Floor Tile And Mastic 12" X 12" Beige With White Fleck (2006) | 1031,1033,1035 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Floor Vinyl Sheet Flooring Faux Wood (2006) | 1037 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Floor Wood Laminate | 1005 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Piping Fibreglass | 1005,1006,1008,1013,1017,1018,1019,1020,1021 1024,1026,1027,1028,1029,1030,1031,1033,1036 1037,1039 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Piping Not Insulated | 1022 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Structure Concrete (precast) | 1000,1001,1002,1004,1007,1011,1012,1015,1016 1017,1022,1023,1039,2000,2001,2002,2003,2004 2007,2010,2013,2014,2018,2020,2022 | A | 0 | 0 | 0 | 96 | Non Asbestos | No | |
| Asbestos | V0000 | Structure Deck Steel | 1036,1037 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Wall Ceramic Tiles | 1007,1032,1034,2005,2006,2007 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Wall Drywall And Joint Compound New | 1011,2010 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |

| HAZMAT | Sample No | System/Component/Material/Sample Description | Locations | Bldg. Phase | LF | SF | EA | % | Type | Positive | Friability |
|----------|-----------|--|--|-------------|----|----|----|-----|--------------|----------|------------|
| Asbestos | V0000 | Wall All Masonry | 1000,1001,1002,1003,1004,1005,1006,1008,1009 1010,1011,1012,1013,1014,1015,1016,1017,1018 1019,1020,1021,1022,1023,1024,1025,1026,1027 1028,1029,1030,1031,1032,1033,1034,1035,1036 1037,1039,1040,2000,2001,2002,2003,2004,2005 2006,2008,2009,2010,2011,2012,2013,2014,2015 2016,2017,2018,2019,2020,2021,2022 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Wall Wood | 1003,2008 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |
| Asbestos | V0000 | Wall Wood Panels | 1008,1017,1018,1020 | A | 0 | 0 | 0 | 100 | Non Asbestos | No | |

Legend:

| Sample number | | Units | | | |
|---------------|--|-------|-------------|----|------------------------------|
| S#### | Asbestos sample collected | SF | Square feet | NF | Non Friable material. |
| L#### | Paint sample collected | LF | Linear feet | F | Friable material |
| P#### | PCB sample collected | EA | Each | PF | Potentially Friable material |
| M#### | Mould sample collected | % | Percentage | | |
| V#### | Material visually similar to numbered sample collected | | | | |
| V0000 | Known non Hazardous Material | | | | |
| V9000 | Material is visually identified as Hazardous Material | | | | |
| V9500 | Material is presumed to be Hazardous Material | | | | |
| [Loc. No.] | Abated Material | | | | |

APPENDIX IV
All Data Report

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1 : Presumed Asbestos-Containing Materials
Survey Date: 2018-07-13

Site: Elementary
Floor:

Building Name: St. Michael

Room #:

Area (sqft): 0

Last Re-Assessment: 2022-06-29

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|----------------------|----------------------------------|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Other | Door | Caulking | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Other | Electrical Equipment | Cement Product | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Other | Electrical Wire | Textile | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Other | Roof | Roofing material | | | B | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Other | Window | Caulking | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Wall | | Vermiculite/concrete block walls | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | F |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1000 : Classroom 7
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|---------------------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | Bulkhead | Drywall and joint compound | | | C | Y | | 100 | | | % | V0003 | None Detected | N.D. | None | |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" brown with brown fleck (2015) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping ¹ | | Unidentified Material | | | D | N | | | | | | | | | | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

1 - Inaccessible enclosure behind/above closet

Client: Hamilton-Wentworth Catholic District Sch
Location: #1001 : Stairwell 1
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|---|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' short fissure random pinhole (2005) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Structure | | Concrete (precast) | | | C | N | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Plaster | | | C | Y | | 100 | | | % | V0002 | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1002 : Classroom 6
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Vinyl Floor Tile and Mastic, 12" x 12" beige with white fleck | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile and Mastic, 12" x 12" mint with grey fleck | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile and Mastic, 12" x 12" Beige with grey streak | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1003 : Corridor
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|---------|----------|----|----|-----|-------|------|------|------|----------|---------------|--------|--------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' short fissure random pinhole (2005) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | N | | | | | | | | | | |
| Piping | | Parging Cement | Fitting | | C | N | | 15(7) | | | EA | S0004ABC | Chrysotile | 50-75% | Confirmed Asbestos | F |
| Wall | | Wood | | | A | Y | | | | | | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1004 : Classroom 5
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|---------------------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Vinyl Floor Tile and Mastic, 12" x 12" beige with brown fleck | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Piping ¹ | | Unidentified Material | | | D | N | | | | | | | | | | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

1 - Concealed by column enclosure

Client: Hamilton-Wentworth Catholic District Sch
Location: #1005 : Main Office
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' short fissure random pinhole (2005) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Ceiling | | Plaster | | | C | Y | | 100 | | | % | S0002C | None Detected | N.D. | None | |
| Floor | | Wood, Laminate | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Carpet | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | N | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Drywall and joint compound | | | A | Y | | 100 | | | % | V0003 | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1006 : Principals Office
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2x4 short fissure random pinhole (2005) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Ceiling | | Plaster | | | C | Y | | 100 | | | % | V0002 | None Detected | N.D. | None | |
| Ceiling | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Carpet | | | A | Y | | 100 | | | % | | | | | |
| Piping | | Fibreglass | | | C | N | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Drywall and joint compound | | | A | Y | | 100 | | | % | V0003 | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1007 : Front Entrance
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|--------------------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Ceramic Tiles | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1008 : Corridor
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' pinhole and round flecks (2012) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | N | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Wood, Panels | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1009 : Girls Washroom
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|--|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Plaster | | | C | Y | | 100 | | | % | V0002 | None Detected | N.D. | None | |
| Floor | | Vinyl Floor Tile and Mastic, 12" x 12" beige with orange fleck | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1010 : Staff Room
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' pinhole and round flecks (2012) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Ceiling | | Plaster | | | C | Y | | | | | | V0002 | None Detected | N.D. | None | |
| Floor | | Vinyl Floor Tile and Mastic, 12" x 12" salmon with white fleck | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Piping | | Fibreglass | | | C | N | | | | | | | | | | |
| Wall | | Plaster | | | A | Y | | 100 | | | % | V0002 | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1011 : Classroom 3
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2x4 pinhole and small fleck (new) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Laminate | | | A | Y | | | | | | | | | | |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Drywall and joint compound, new | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1012 : Classroom 1
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-------------------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" beige with brown fleck (2015) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall ¹ | | Drywall and joint compound | | | A | Y | | 100 | | | % | V0003 | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

1 - In washroom

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1013 : Storage
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' long fissure random pinhole (2012) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' short fissure random pinhole (2005) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" beige with brown fleck (2015) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1014 : Stairwell 2
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' textured pinhole (fiberglass) | | | C | Y | | 100 | | | | V0000 | Non-Asbestos | | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Plaster | | | A | Y | | 100 | | | % | V0002 | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1015 : Classroom 2
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------------------|----------------|---|------|---------------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling ¹ | | Plaster | | | C | Y | | 100 | | | % | S0002D | None Detected | N.D. | None | |
| Floor | | Terrazzo | | | A | Y | | | | | | | | | | |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" beige with brown fleck (2015) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | Sanitary Drain | Metal | | Not Insulated | B | N | | | | | | | | | | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | Column | Drywall and joint compound | | | A | Y | | 100 | | | % | S0003C | None Detected | N.D. | None | |

1 - Washroom

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1016 : Classroom 4
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|--------------------|------------------------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Terrazzo | | | A | Y | | | | | | | | | | |
| Floor | | Mastic | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" beige with brown fleck (2015) | | | A | Y | | 100 | | | | V0000 | Non-Asbestos | | None | |
| Other ¹ | Electric Light Fixture | Paper | | | C | Y | | 1(7) | | | EA | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | Column | Drywall and joint compound | | | A | Y | | 100 | | | % | V0003 | None Detected | N.D. | None | |

1 - In washroom

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1017 : Boiler Room
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|--------------------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Concrete (poured) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Wood, Panels | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1018 : Boys Washroom
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|----------------|---------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Plaster | | | C | Y | | 100 | | | % | S0002A | None Detected | N.D. | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | N | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Parging Cement | Fitting | | C | N | | 2(7) | | | EA | V0004 | Chrysotile | 50-75% | Confirmed Asbestos | F |
| Wall | | Wood, Panels | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1019 : Special Needs Washroom
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' smooth gypsum board | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Plaster | | | A | Y | | 100 | | | % | V0002 | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1020 : corridor
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' short fissure random pinhole (2005) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | N | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Wood, Panels | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1021 : Back Room
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|--|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' long fissure random pinhole (2012) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | N | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Plaster | | | A | Y | | 100 | | | % | V0002 | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1022 : Kitchen
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|----------------------------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | Bulkhead | Drywall and joint compound | | | C | Y | | 100 | | | % | V0003 | None Detected | N.D. | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Not Insulated | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Drywall and joint compound | | | A | Y | | 100 | | | % | S0003A | None Detected | N.D. | None | |
| Wall | | Plaster | | | A | Y | | 100 | | | % | S0002B | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1023 : Electrical Room
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" beige with white fleck (2006) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Drywall and joint compound | | | A | Y | | 100 | | | % | V0003 | None Detected | N.D. | None | |
| Wall | | Plaster | | | A | Y | | | | | | V0002 | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1024 : Library Storage
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' short fissure random pinhole (2005) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" beige with white fleck (2006) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Drywall and joint compound | | | A | Y | | 100 | | | % | V0003 | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1025 : Corridor
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' short fissure random pinhole (2005) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Ceramic Tiles | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1026 : Storage
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' short fissure random pinhole (2005) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" beige with white fleck (2006) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Drywall and joint compound | | | A | Y | | 100 | | | % | V0003 | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1027 : Corridor
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|--|------|--------------------------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' long fissure random pinhole (2012) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Ceramic Tiles | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | Polyvinyl chloride (PVC) | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1028 : Computer Lab
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|--|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Mastic | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" beige with white fleck | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Drywall and joint compound | | | A | Y | | 100 | | | % | V0003 | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1029 : Corridor
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' short fissure random pinhole (2005) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Ceramic Tiles | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1030 : Gym Corridor
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|--|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' long fissure random pinhole (2012) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Ceramic Tiles, 12" x 12" beige with white fleck | | | A | Y | | 100 | | | % | | | | | |
| Piping | | Fibreglass | | | C | N | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Structure | | | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1031 : Boys Washroom
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|--|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' flat face (gypsum) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Vinyl Floor Tile and Mastic, 12" x 12" beige with white fleck (2006) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1032 : Boys Shower
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|----------------------------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Drywall and joint compound | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Ceramic Tiles | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Ceramic Tiles | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1033 : Girls' Washroom
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|--|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' flat face | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Vinyl Floor Tile and Mastic, 12" x 12" beige with white fleck (2006) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1034 : Girls Shower
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|----------------------------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Drywall and joint compound | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Ceramic Tiles | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Ceramic Tiles | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1035 : Gym Kitchen
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|--|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Drywall and joint compound | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Vinyl Floor Tile and Mastic, 12" x 12" beige with white fleck (2006) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1036 : Gym Storage
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|---|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" grey with grey fleck (2006) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Structure | Deck | Steel | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | All | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1037 : Gymnasium
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|--|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Vinyl Sheet Flooring, Faux wood (2006) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Structure | Deck | Steel | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1039 : Vice Principal Office
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|---|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' short fissure random pinhole (2005) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Carpet | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Fibreglass | | | C | N | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Drywall and joint compound | | | A | Y | | 100 | | | % | V0003 | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1040 : Library
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2 x 4' dense fleck (2005) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Carpet | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" beige with white fleck (2006) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Drywall and joint compound | | | A | Y | | 100 | | | % | S0003B | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #1041 : Exterior - Original
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|--|----------|----------|----|----|-----|--------|------|------|------|----------|-------------------|--------|--------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | Soffit | Plaster, Textured | Exterior | | C | Y | | 100(7) | | | % | S0001ABC | Chrysotile | 0.5-5% | Confirmed Asbestos | PF |
| Wall | | Metal, Suspect materials behind metal cladding | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | [PF]* |
| Wall | | Unidentified Material, Bell and Spigot Packing | | | A | Y | | 100(7) | | | % | S0012ABC | Amosite | 10-25% | Confirmed Asbestos | [PF]* |
| Wall | | Caulking, Brown Caulking | | | A | Y | | 100 | | | % | S0006ABC | None Detected | N.D. | None | |
| Wall | | Caulking, Light Grey Caulking | | | A | Y | | 100 | | | % | S0007ABC | None Detected | N.D. | None | |
| Wall | | Caulking, Dark Grey Caulking | | | A | Y | | 100 | | | % | S0008ABC | None Detected | N.D. | None | |
| Wall | | Caulking, Beige Caulking | | | A | Y | | 100 | | | % | S0009ABC | None Detected | N.D. | None | |
| Wall | | Caulking, White Caulking | | | A | Y | | 60(7) | | | LF | S0010ABC | Chrysotile | 5-10% | Confirmed Asbestos | NF |

Client: Hamilton-Wentworth Catholic District Sch
Location: #1042 : Exterior - Addition
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-------------------|-----------|--------------------------|------|----------|----|----|-----|------|------|------|------|----------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Wall ¹ | | Caulking, White Caulking | | | A | Y | | 100 | | | % | S0011ABC | None Detected | N.D. | None | |

1 - Underneath Brown Caulking

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2000 : Classroom 14
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|--|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Vinyl Floor Tile and Mastic, 12" x 12" grey dense flecks | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #2001 : Classroom 12
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|--------------------|-----------|--|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor ¹ | | Vinyl Sheet Flooring, Off-white with dark flecks | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | PF |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" beige with yellow fleck | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), 12x12 beige w yellow fleck | | | A | Y | | | 2(7) | | SF | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" salmon with brown streak | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

1 - On low shelf/platform

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2002 : Stairwell
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|---------------------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Not Insulated | | | A | Y | | | | | | | | | | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Plaster, above door | | | A | Y | | 100 | | | % | S0002F | None Detected | N.D. | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #2003 : Classroom 15
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), 12" x 12" beige with brown fleck (2006) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | | Unidentified Material | | | D | N | | | | | | | | | | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | | | | | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2004 : Classroom 13
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Vinyl Floor Tile and Mastic, 12" x 12" beige with yellow fleck | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile and Mastic, 12" x 12" salmon with brown streak | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Structure | | Concrete (precast) | | | C | Y | | | | | | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #2005 : Corridor
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-------------------|--|---------|----------|----|----|-----|------|------|------|------|----------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), Long | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' textured pinhole | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Piping | Rain Water Leader | Sweatwrap | | | C | N | | 5 | | | LF | S0005ABC | None Detected | N.D. | None | |
| Piping | Rain Water Leader | Horsehair | Fitting | | C | N | | | | | | | | | | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Ceramic Tiles | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2006 : Corridor
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|--|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' long | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Ceiling | | Ceiling Tiles (lay-in), 2' x 4' textured pinhole | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Ceramic Tiles | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #2007 : Stairwell
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|--------------------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Ceramic Tiles | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Glass | | | A | Y | | | | | | | | | | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2008 : Boys Washroom
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-------------------|-----------|----------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Plaster | | | C | Y | | 100 | | | % | S0002G | None Detected | N.D. | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall ¹ | | Wood | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

1 - wood panel

Client: Hamilton-Wentworth Catholic District Sch
Location: #2009 : French Resource
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|--------------------|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Laminate | | | A | Y | | 100 | | | % | | | | | |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | | | | | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2010 : Staff Room
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|---------------------------------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Laminate | | | A | Y | | 100 | | | % | | | | | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Drywall and joint compound, new | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #2011 : Staff Washroom
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|----------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Plaster | | | A | Y | | 100 | | | % | V0002 | None Detected | N.D. | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2012 : Womans Staff Washroom
Survey Date: 2018-07-13

Site: Elementary
Floor: 1

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|----------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Plaster | | | A | Y | | 100 | | | % | S0002E | None Detected | N.D. | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #2013 : Classroom 11
Survey Date: 2018-07-13

Site: Elementary
Floor: 2

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|--------------------|-----------|------------------------------|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Laminate, Wood | | | A | Y | | | | | | | | | | |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor ¹ | | Vinyl Floor Tile (No Mastic) | | | A | Y | | 100 | | | % | V9500 | [None] | | [Abated] | |
| Floor ² | | Vinyl Floor Tile (No Mastic) | | | A | Y | | 100 | | | % | V9500 | [None] | | [Abated] | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

- 1 - 12x12 beige with yellow fleck
2 - 12x12 tan w brown streak

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2014 : Classroom 10
Survey Date: 2018-07-13

Site: Elementary
Floor: 2

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|--------------------|-----------|------------------------------|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Laminate, Wood | | | A | Y | | | | | | | | | | |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor ¹ | | Vinyl Floor Tile (No Mastic) | | | A | Y | | 100 | | | % | V9500 | [None] | | [Abated] | |
| Floor ² | | Vinyl Floor Tile (No Mastic) | | | A | Y | | | 3 | | SF | V9500 | [None] | | [Abated] | |
| Floor ³ | | Vinyl Floor Tile (No Mastic) | | | A | Y | | 100 | | | % | V9500 | [None] | | [Abated] | |
| Structure | | Concrete (precast) | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

- 1 - 12x12 aqua dense fleck
2 - 12x12 aqua dense fleck
3 - 12x12 tan w brown streak

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2015 : Storage
Survey Date: 2018-07-13

Site: Elementary
Floor: 2

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|---|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Ceiling Tiles (lay-in), Long | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Rubber | | | A | Y | | | | | | | | | | |
| Floor | | Mastic | | | D | N | | 100(7) | | | | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor | | Vinyl Floor Tile (No Mastic), Tan w brown | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #2016 : Storage Sink Room
Survey Date: 2018-07-13

Site: Elementary
Floor: 2

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|----------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Plaster | | | C | Y | | 100 | | | % | V0002 | None Detected | N.D. | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2017 : Washroom
Survey Date: 2018-07-13

Site: Elementary
Floor: 2

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|----------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Plaster | | | C | Y | | 100 | | | % | V0002 | None Detected | N.D. | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #2018 : Classroom 8
Survey Date: 2018-07-13

Site: Elementary
Floor: 2

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|--------------------|-----------|------------------------------|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor ¹ | | Vinyl Floor Tile (No Mastic) | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor ² | | Vinyl Floor Tile (No Mastic) | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor ³ | | Vinyl Floor Tile (No Mastic) | | | A | Y | | | 1(7) | | EA | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor ⁴ | | Vinyl Floor Tile (No Mastic) | | | A | Y | | | 1(7) | | EA | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

- 1 - 12x12 mint with grey fleck
- 2 - 12x12 mint with grey fleck
- 3 - 12x12 pink with dense fleck
- 4 - 12x12 Pink dense fleck

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2019 : Classroom 9
Survey Date: 2018-07-13

Site: Elementary
Floor: 2

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|--------------------|-----------|------------------------------|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Carpet | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor ¹ | | Vinyl Floor Tile (No Mastic) | | | A | Y | | | 3(7) | | EA | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor ² | | Vinyl Floor Tile (No Mastic) | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

1 - 12x12 beige w yellow fleck
2 - 12x12 Salmon w white fleck

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2020 : Stairwell
Survey Date: 2018-07-13

Site: Elementary
Floor: 2

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|-----------|-----------|--------------------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

Client: Hamilton-Wentworth Catholic District Sch
Location: #2021 : Girl's Washroom
Survey Date: 2018-07-13

Site: Elementary
Floor: 2

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|----------|-----------|----------|------|----------|----|----|-----|------|------|------|------|--------|---------------|--------|--------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Ceiling | | Plaster | | | C | Y | | 100 | | | % | V0002 | None Detected | N.D. | None | |
| Floor | | Terrazzo | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

ALL DATA REPORT

Client: Hamilton-Wentworth Catholic District Sch
Location: #2022 : Storage
Survey Date: 2018-07-13

Site: Elementary
Floor: 2

Building Name: St. Michael
Room #:
Last Re-Assessment: 2022-06-29

Area (sqft): 0

| ASBESTOS | | | | | | | | | | | | | | | | |
|--------------------|-----------|------------------------------|------|----------|----|----|-----|--------|------|------|------|--------|-------------------|--------|-------------------|---------|
| System | Component | Material | Item | Covering | A* | V* | AP* | Good | Fair | Poor | Unit | Sample | Asbestos Type | Amount | Hazard | Friable |
| Floor | | Mastic | | | D | N | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Floor ¹ | | Vinyl Floor Tile (No Mastic) | | | A | Y | | 100(7) | | | % | V9500 | Presumed Asbestos | | Presumed Asbestos | NF |
| Structure | | Concrete (precast) | | | C | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |
| Wall | | Masonry | | | A | Y | | 100 | | | % | V0000 | Non-Asbestos | | None | |

1 - 9x9 grey w black streak

Legend:



| Sample number | | Units | | Other | |
|---------------|--|-------|-------------|-------|------------------------------|
| S#### | Asbestos sample collected | SF | Square feet | A | Access |
| V#### | Material visually similar to numbered sample collected | LF | Linear feet | V | Visible |
| V0000 | Known non-asbestos material | EA | Each | AP | Air Plenum |
| V9000 | Visually identified as an asbestos material | % | Percentage | F | Friable material |
| V9500 | Material is presumed to be an asbestos material | | | NF | Non Friable material |
| | | | | PF | Potentially Friable material |

| Access | |
|--------|---|
| A | Accessible to all building occupants |
| B | Accessible to maintenance and operations staff without a ladder |
| C | Accessible to maintenance and operations staff with a ladder. Also rarely entered, locked areas |
| D | Not normally accessible |

| Condition | |
|-----------|---|
| Good | No visible damage or deterioration |
| Fair | Minor, repairable damage, cracking, delamination or deterioration |
| Poor | Irreparable damage or deterioration with exposed and missing material |

| Visible | |
|---------|---|
| Y | The material is visible when standing on the floor of the room, without the removal or opening of other building components (e.g. ceiling tiles or access panels). |
| N | The material is not visible to view when standing on the floor of the room and requires the removal of a building component (e.g. ceilings tiles or access panels) to view and access. Includes rarely entered crawlspaces, attic spaces, etc. Observations will be limited to the extent visible from the access points. |

| Air Plenum | |
|------------|---|
| Yes or No | The material is in a return air plenum or in a direct airstream or there is evidence of air erosion (e.g. duct for heating or cooling blowing directly on or across an ACM). This field is only completed where Air Plenum consideration is required by regulation. |

| Colour Coding | |
|--|---|
|  | The material is known to contain regulated concentrations of asbestos; either by analytical results or visible identification (use of the V9000 code). |
|  | The material is presumed to contain asbestos; based on visual appearances; typically a material known to historically contain asbestos; however, not sampled due to limited access or the destructive nature of the sampling. |

| Action | | | | | |
|--------|--|-----|--|-----|-------------|
| (1) | Clean up of ACM Debris | (2) | Precautions for Access Which may Disturb ACM Debris | (3) | ACM removal |
| (4) | Precautions for Work Which may Disturb ACM in Poor Condition | (5) | Proactive ACM removal (Minimum repair required for fair condition) | (6) | ACM repair |
| (7) | Management program and surveillance | | | | |

APPENDIX V
Drawings

BASE PLAN PROVIDED BY CLIENT.



www.pinchin.com

(X) LOCATION NUMBER

 ASBESTOS BULK SAMPLE

P PIPE INSULATION

VINYL SHEET FLOORING

 VINYL FLOOR TILES & MASTIC

 MASTIC

 PLASTER SOFFIT PAPER HEAT SHIELD LOCATION OF VERMICULITE DRILLING

CLK CAULKING

PP PIPE PACKING

Hamilton-Wentworth
Catholic District School Board
Believing. Achieving. Serving

ST. MICHAEL

135 HESTER STREET
HAMILTON, ONTARIO


ASBESTOS REASSESSMENT
FLOOR LEVEL 1

| | |
|------------|------------|
| PROJECT #: | 303992.004 |
|------------|------------|

DRAWING:

1 OF 2


SCALE: NTS

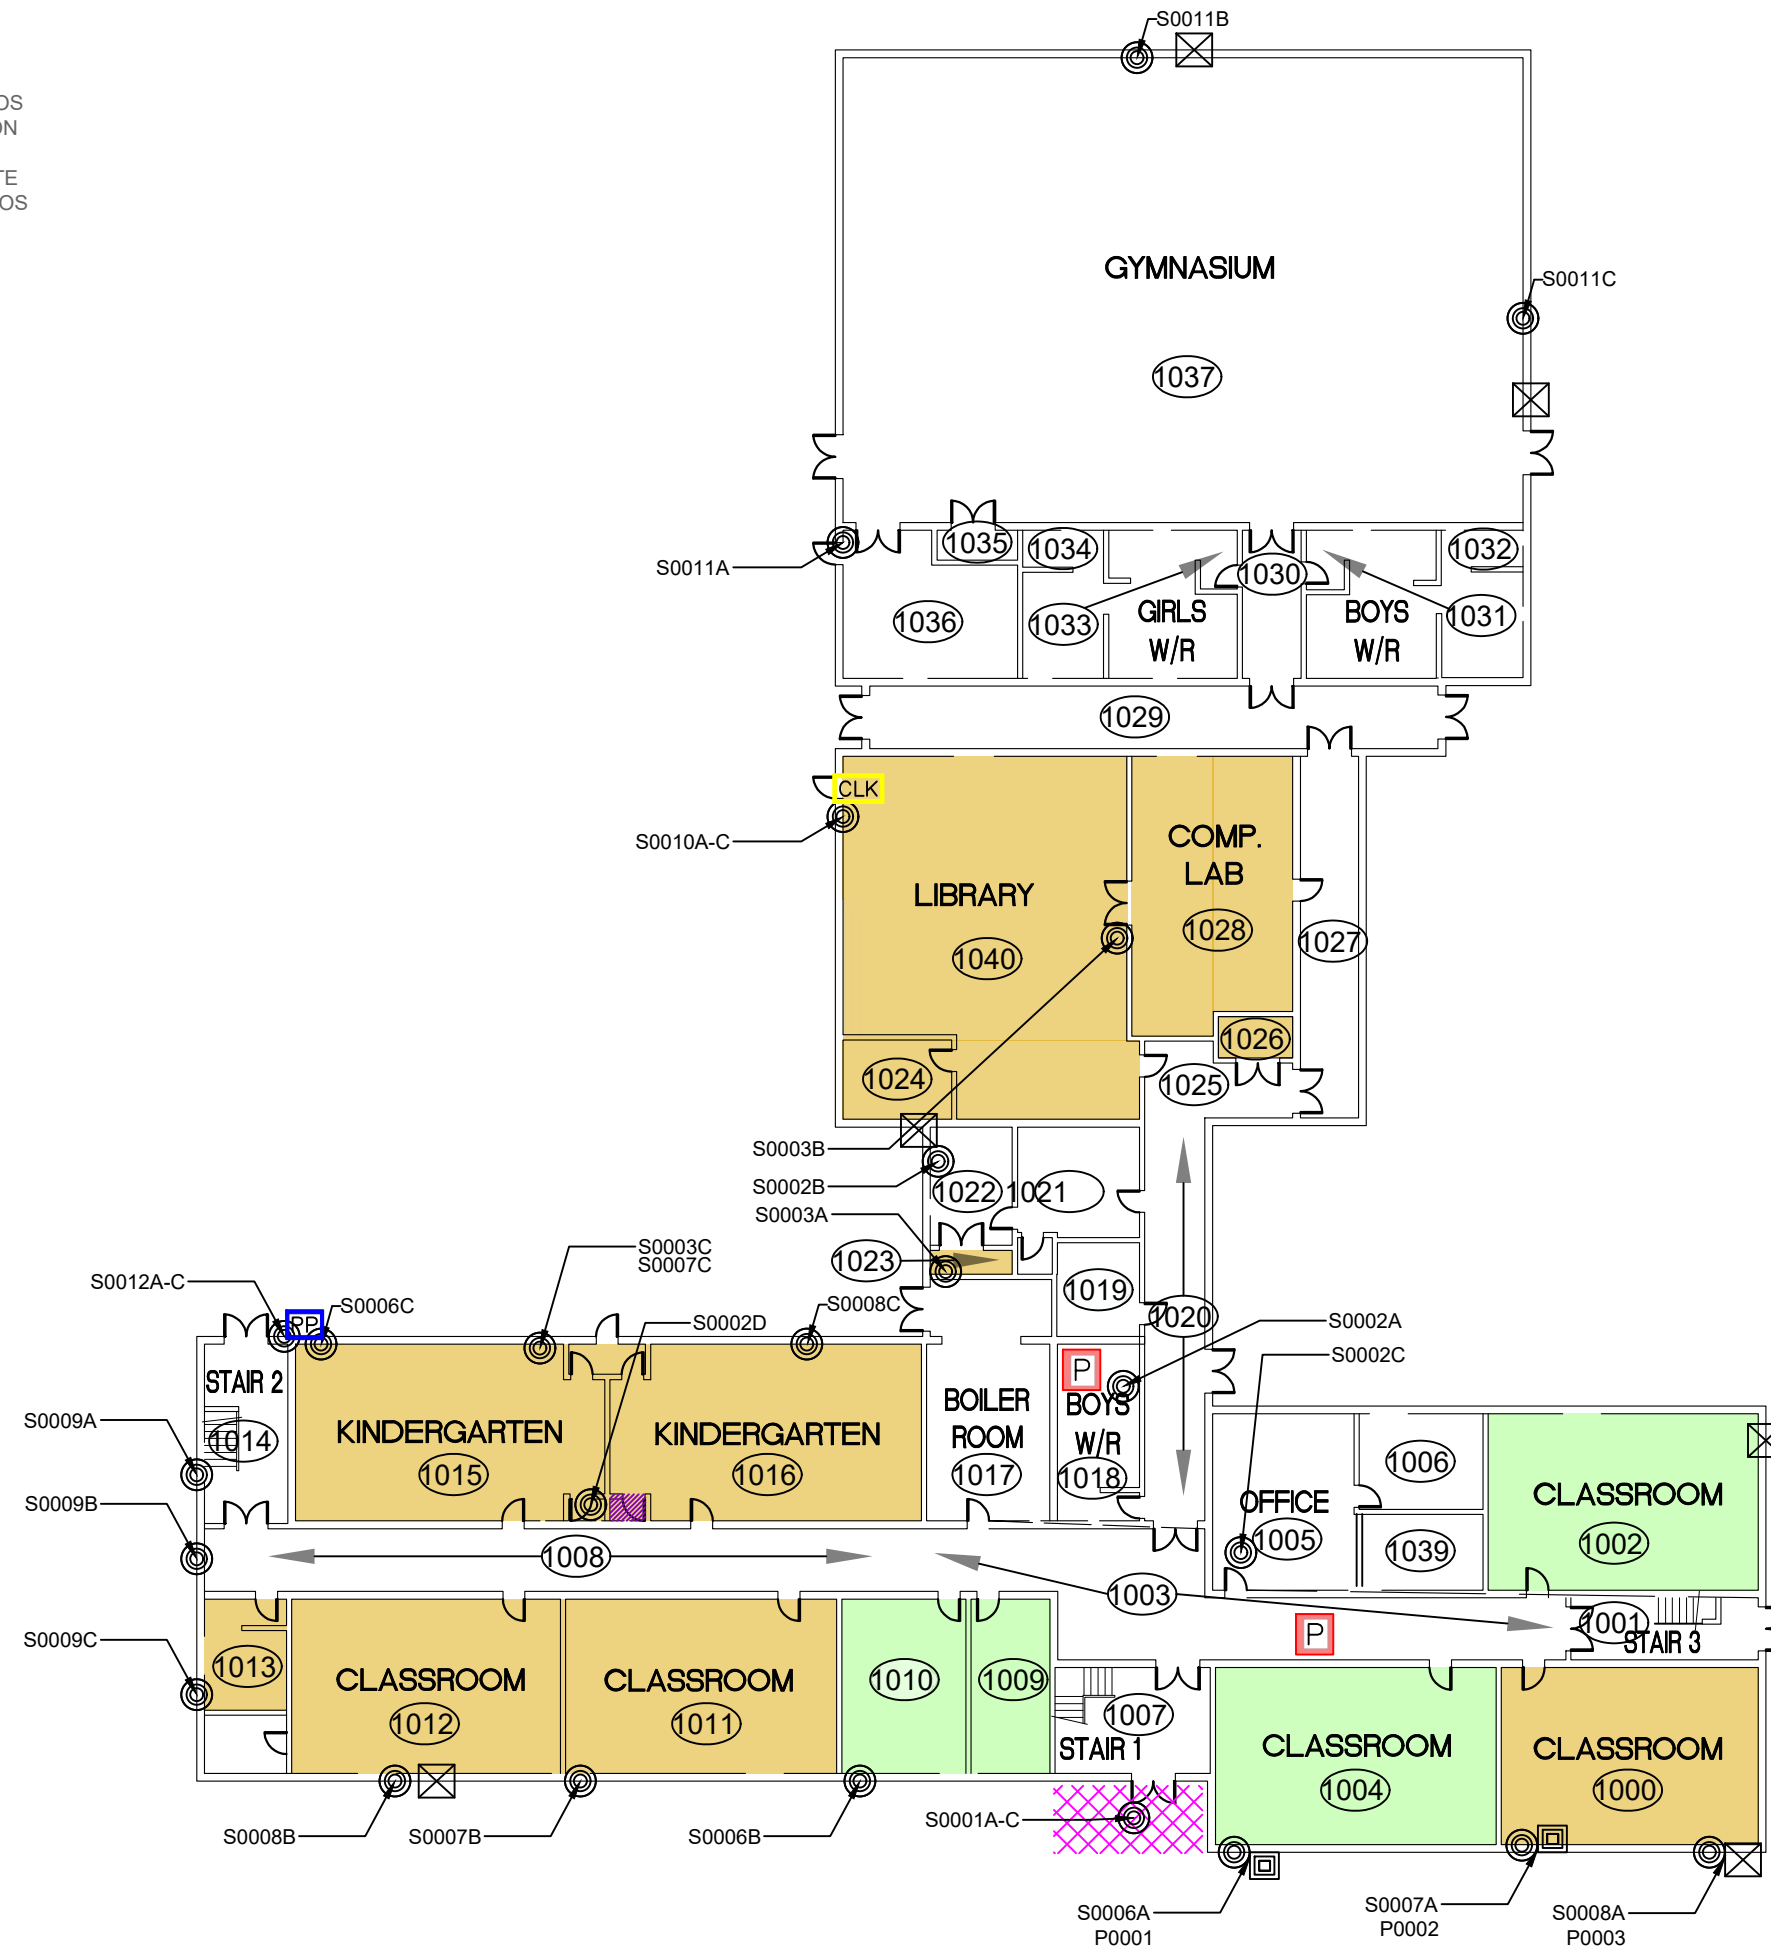

NOT ALL KNOWN OR SUSPECTED ASBESTOS BUILDING MATERIALS MAY BE DEPICTED ON THE DRAWING. REFER TO THE ASBESTOS REASSESSMENT REPORT FOR A COMPLETE LIST OF KNOWN AND SUSPECTED ASBESTOS BUILDING MATERIALS.

LEGEND IS COLOUR DEPENDENT. NON-COLOUR COPIES MAY ALTER INTERPRETATION.

BASE PLAN PROVIDED BY CLIENT.

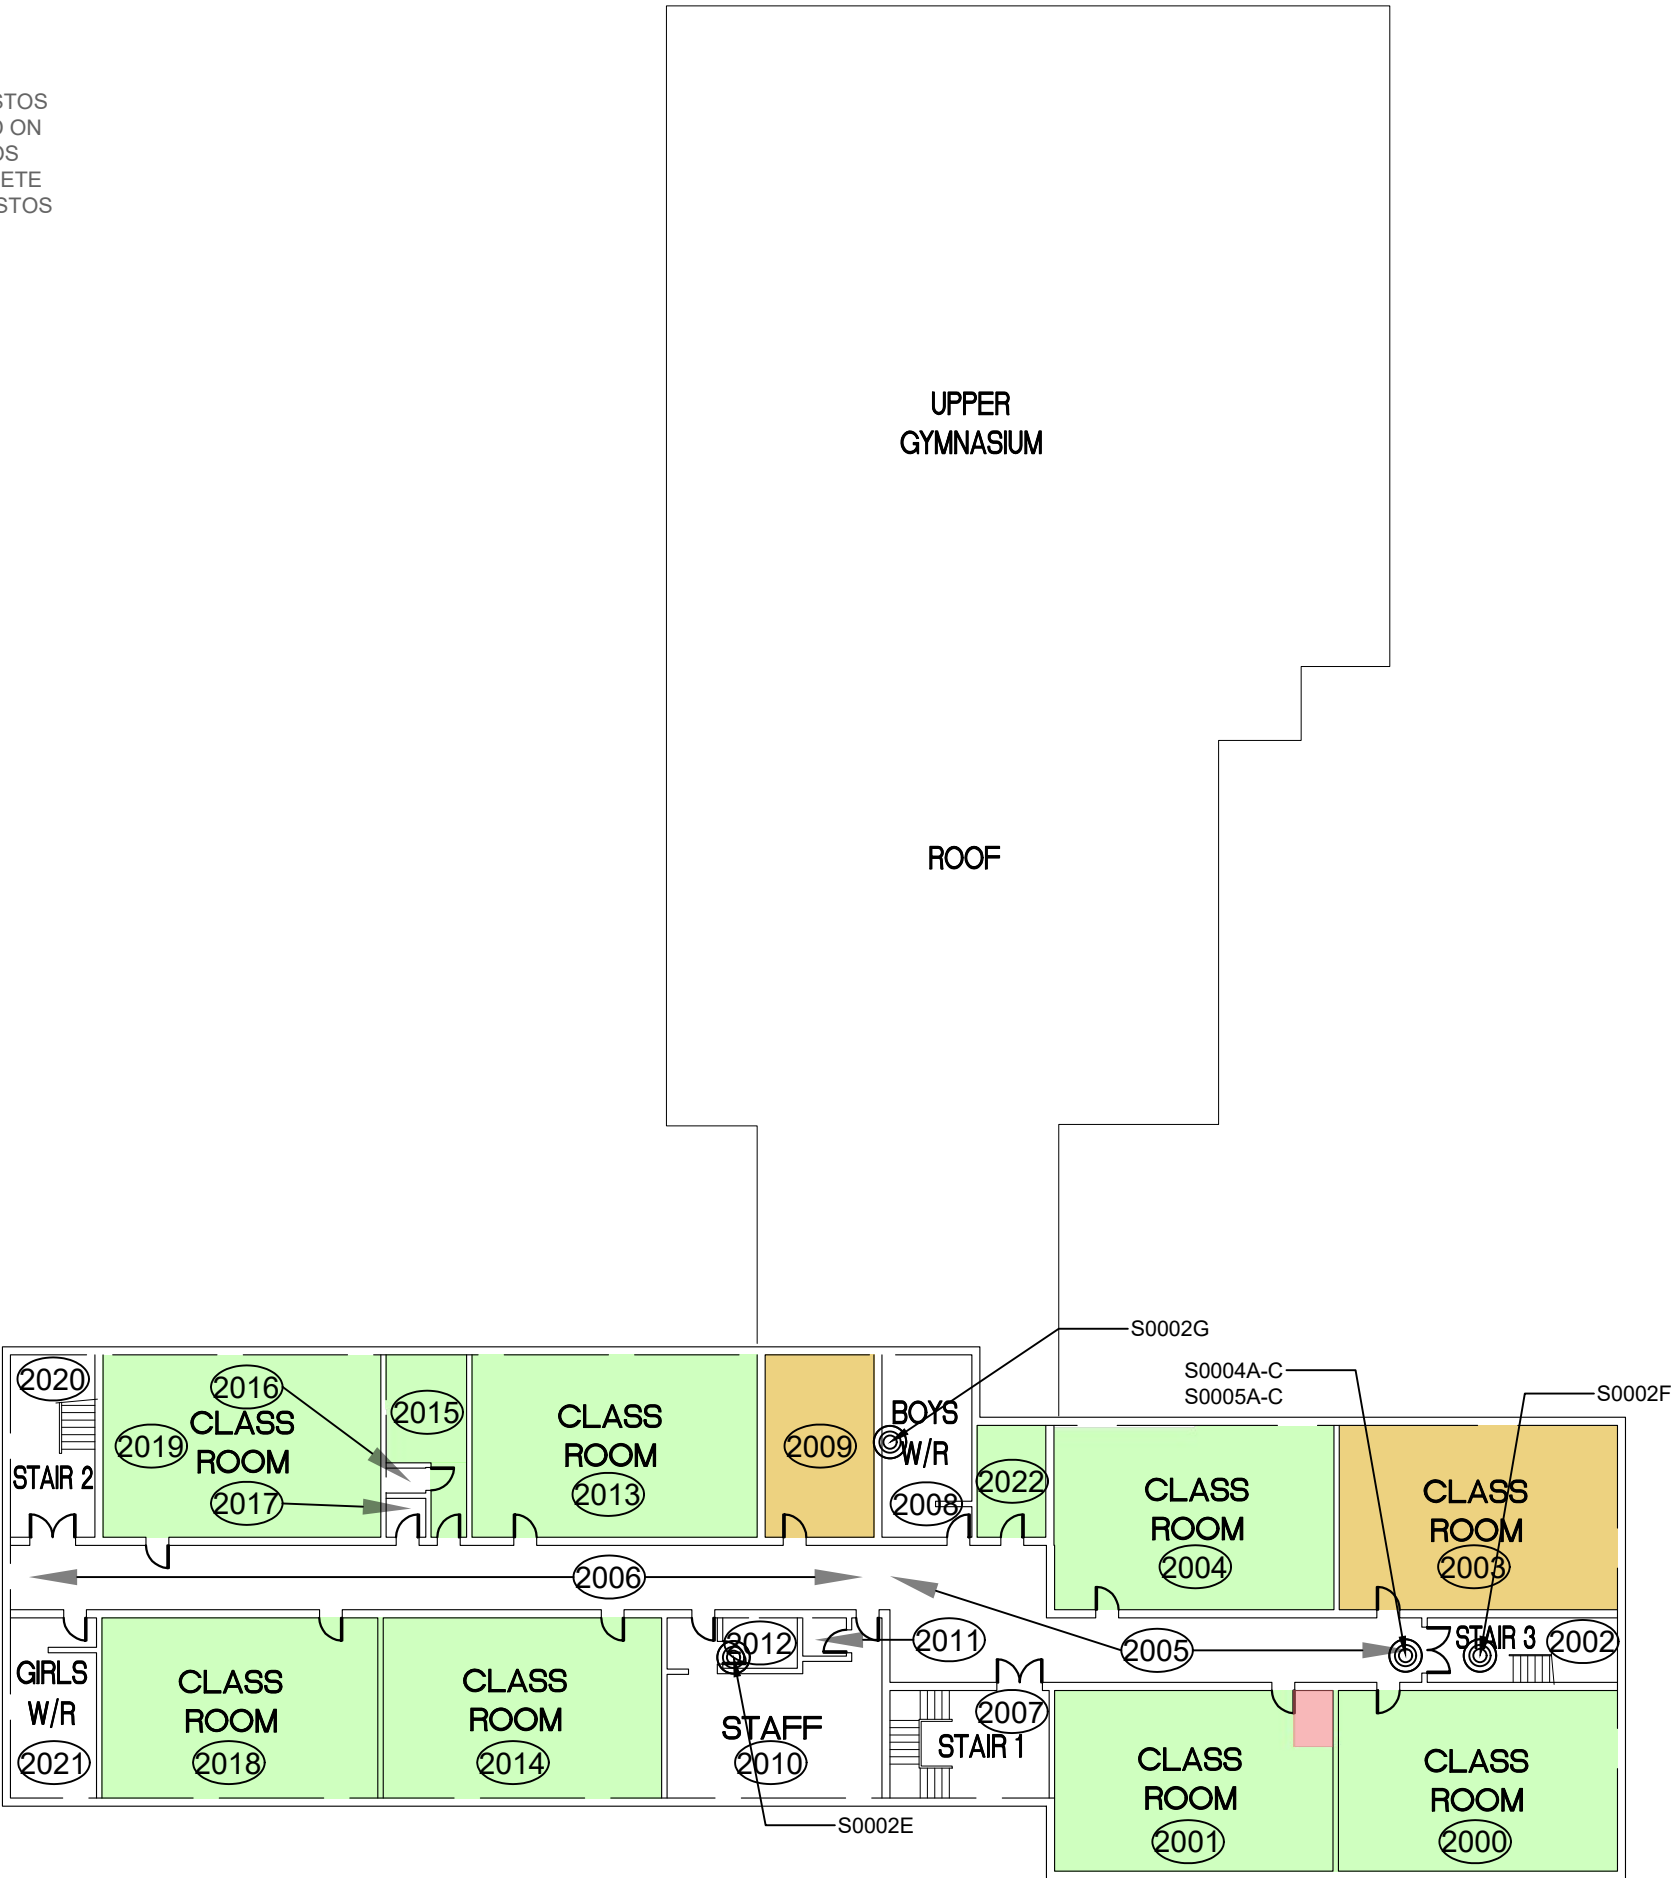

905-577-6206 www.pinchin.com

LEGEND:

- (X) LOCATION NUMBER
- ⊙ ASBESTOS BULK SAMPLE

ASBESTOS-CONTAINING MATERIALS:

- P PIPE INSULATION
- VINYL SHEET FLOORING
- VINYL FLOOR TILES & MASTIC
- MASTIC
- PLASTER SOFFIT
- PAPER HEAT SHIELD
- LOCATION OF VERMICULITE DRILLING
- CLK CAULKING
- PP PIPE PACKING

CLIENT:



LOCATION:

ST. MICHAEL
135 HESTER STREET
HAMILTON, ONTARIO

TITLE:

ASBESTOS REASSESSMENT
FLOOR LEVEL 2

DATE:
AUGUST 2022

PROJECT # :
303992.004

DRAWN BY:
EB

CHECKED BY:
EB

SCALE:
NTS

DRAWING:

2 OF 2